

C.H.J. Incorporated

1355 E. Cooley Drive, Colton, CA 92324 ♦ Phone (909) 824-7210 ♦ Fax (909) 824-7209
 15345 Anacapa Road, Suite D, Victorville, CA 92392 ♦ Phone (760) 243-0506 ♦ Fax (760) 243-1225

July 23, 2008

The Magnon Companies

Job No. 07489-3

815 Marlborough Avenue, Suite 200

Riverside, California 92507

Attention: Mr. Ray Magnon

Subject: Grading Plan Review and Update to Geotechnical Investigation
 Proposed Industrial Development - Sycamore V
 Lance and Sierra Drives
 Riverside, California

References: See Reference Sheet

Dear Mr. Magnon:

As requested, we have reviewed the 40-scale Precise Grading Plan prepared by GFB - Friedrich & Associates, Incorporated, dated June 2008, as it pertains to the geologic/geotechnical aspects of the development (Sycamore V). This firm conducted a geotechnical investigation on the site (July 20, 2007). It is our understanding that the subject site is to be developed with an approximately 1.1-million square feet industrial structure and related infrastructure. It is anticipated that the site will be developed with one- to two-story structures of concrete tilt-up construction, utilizing conventional spread foundations for support.

CUT/FILL TRANSITION:

Due to the topographic relief across the site and the varying depth of bedrock, it is not planned for the foundations of the proposed structure to bear entirely in undisturbed bedrock. Grading of the building pad area will entail maximum cuts on the order of 15 to 18 feet and maximum fills on the order of 12 to



16 feet, when alluvial/colluvial removals are included. Cut-fill transition lines are present in the southern and central portions of the proposed building (Enclosure 1). In order to mitigate the potential for differential settlement across the cut/fill transition area, the pad area including areas underlain by bedrock, should be subexcavated to provide no greater than 8 feet difference in the fill mat thickness within 150 feet of the cut/fill transition line. The 150-foot distance from the transition line is also shown on Enclosure 1. The attached draft cross sections illustrate the cut/fill transition, areas of fill, bedrock cut areas, and potential fill depths beneath footings in rock areas. Our geotechnical investigation recommended a minimum fill thickness of 18 inches beneath all structure footings.

Other portions of the Precise Grading Plan appear to be in compliance with our geotechnical investigation report. When available, the foundation plans should be reviewed by the geotechnical engineer.

CUT SLOPES:

Cut slopes up to approximately 30 feet in height and inclined at 2 horizontal to 1 vertical [2(h):1(v)] and flatter are proposed in the northern portion of the site. Retaining walls up to approximately 15 feet in height are proposed below the toes of some cut slopes. Cut slopes in competent bedrock may be safely constructed at inclinations as steep as 1.5(h):1(v) up to a maximum height of 30 feet. Where the tops of bedrock cut slopes intersect natural ground with associated topsoils and highly weathered rock, the upper 5 feet of these slopes should be constructed no steeper than 2(h):1(v). All cut slopes should be observed by the engineering geologist during grading. These recommendations are subject to change by the engineering geologist as dictated by conditions exposed during grading.

ROCK DISPOSAL:

Grading of the site may result in the generation of rock with dimensions greater than 12 inches. No rock greater than 12 inches in dimension may be buried or placed in fills within 10 feet of final grade. If it is necessary to dispose of such material on-site, the boulders should not be placed in site fills except in areas designated as "rock disposal areas". Such "rock disposal areas" should be non-buildable areas or areas below the depth of 10 feet.



In order to properly compact soils in "rock disposal areas", the rock should be placed in windrows, in such a manner as to avoid nesting and to allow access for compaction equipment. The oversized material should be placed in lifts, alternating with lifts of soil without oversized material. Continuous observation by the geotechnical engineer should be provided to confirm that adequate compaction is achieved in such areas. A typical rock disposal detail is included in Appendix "D" of the referenced geotechnical report.

Further recommendations may be made in the field depending on the actual conditions encountered.

GEOTECHNICAL UPDATE:

A site visit was performed on July 11, 2008. The purpose of the site visit was to observe the site as it presently exists and to determine whether any new or revised recommendations are necessary. As observed during our site visit, the site appeared to be in the same condition as it was during our original investigation in 2007. Except where included in this report, no additional or revised recommendations appear to be necessary at this time.

The seismic design parameters were determined according the 2007 California Building Code (CBC) based on the site class "C", "stiff soil", and are summarized in the table below.

2007 California Building Code - Seismic Parameters	
Mapped Spectral Acceleration Parameters	$S_s = 1.50$ and $S_1 = 0.60$
Site Coefficients	$F_a = 1.0$ and $F_v = 1.3$
Adjusted Maximum Considered Earthquake (MCE) Spectral Response Parameters	$S_{MS} = 1.50$ and $S_{M1} = 0.78$
Design Spectral Acceleration Parameters	$S_{DS} = 1.00$ and $S_{D1} = 0.52$


The corresponding value of peak ground acceleration based on the project design response spectrum is 0.40g.





CLOSURE:


We trust this information is as requested. If you should have any questions, please do not hesitate to contact this firm at your convenience.

Respectfully submitted,
C.H.J., INCORPORATED

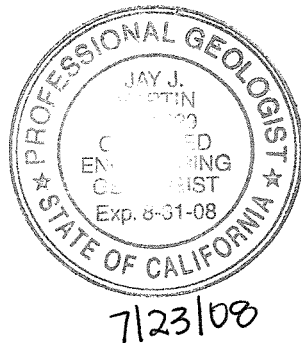


Jay J. Martin, E.G. 1529
Vice President



Allen D. Evans, G.E. 2060
Vice President

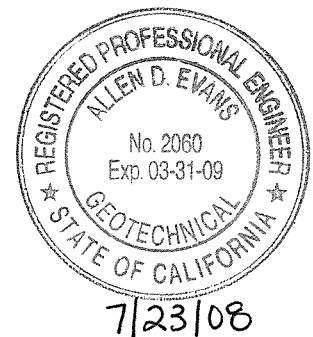

JJM/ADE:ndt

- Enclosures:
- 1) Site Location Map
 - 2) Cross Section A-A' (draft)
 - 3) Cross Section B-B' (draft)
 - 4) Cross Section C-C' (draft)


Distribution: The Magnon Companies (4)
GFB - Friedrich & Associates, Inc. (2)

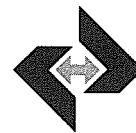

REFERENCES

C.H.J, Incorporated, July 20, 2007, Geotechnical Investigation, Proposed Industrial Development, Lance and Sierra Drives, Riverside, California, Job No. 07489-3.

GFB - Friedrich & Associates, Inc., June 2008, Precise Grading Plan, Sycamore V, 6275 Lance Drive, Riverside, California.

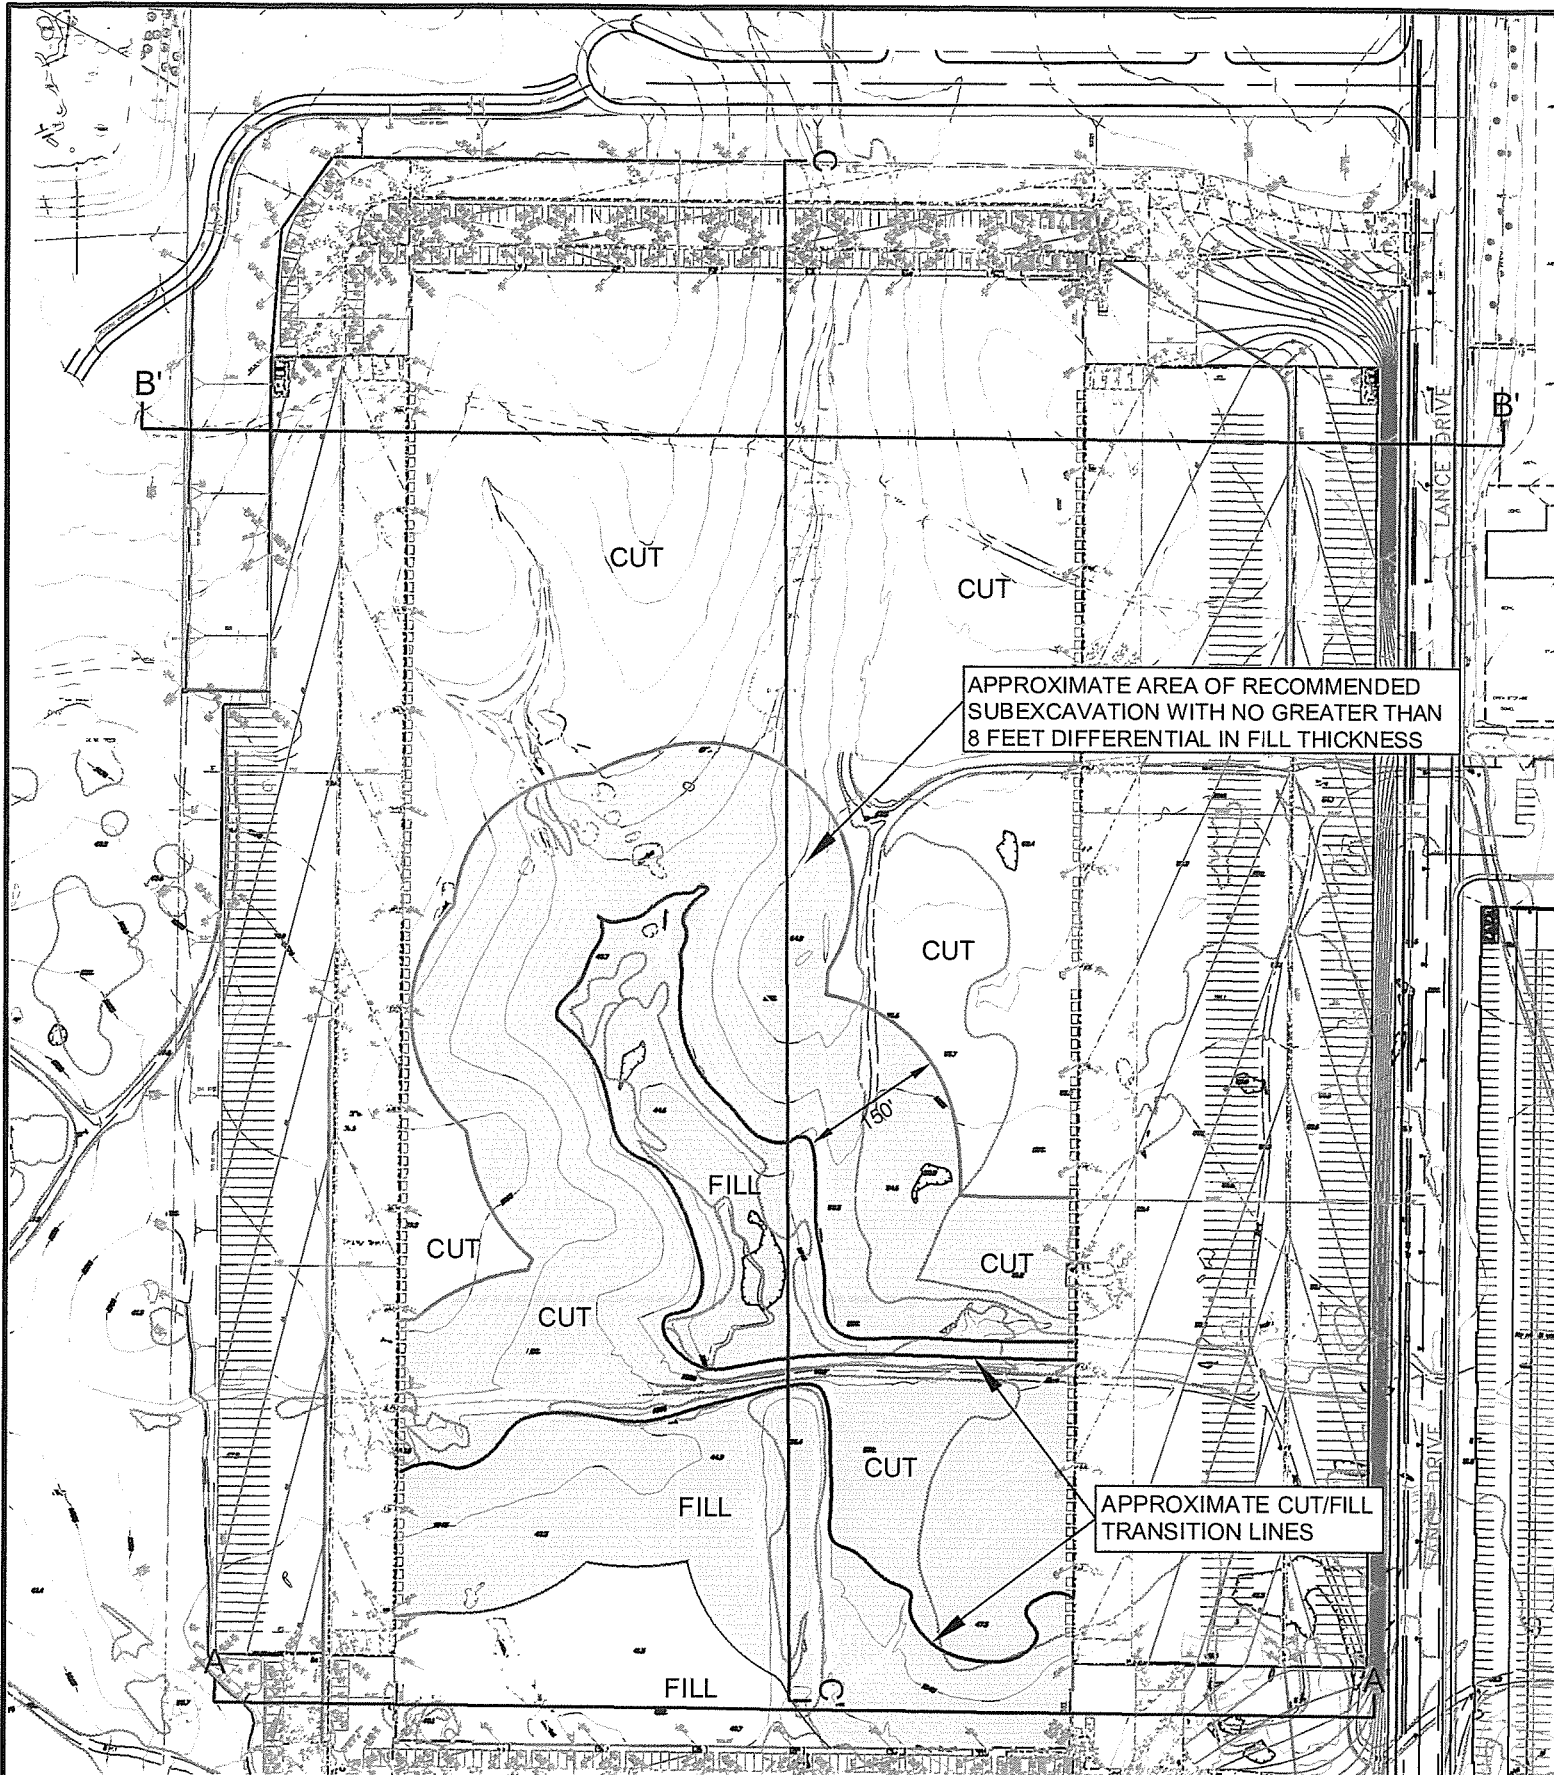

SCALE 1" = 200'

LEGEND:

C C'

GEOLOGIC CROSS SECTION

SITE LOCATION MAP

FOR:
THE MAGNON COMPANIES

DATE:
JULY 2008

SYCAMORE CANYON V PROJECT
RIVERSIDE, CALIFORNIA

ENCLOSURE
1

JOB NUMBER
07489-3



A Job #07849-3


Client: Morgan

7/08

H: 1"=100' V: 1"=20'


A'

A Proposed Building A'

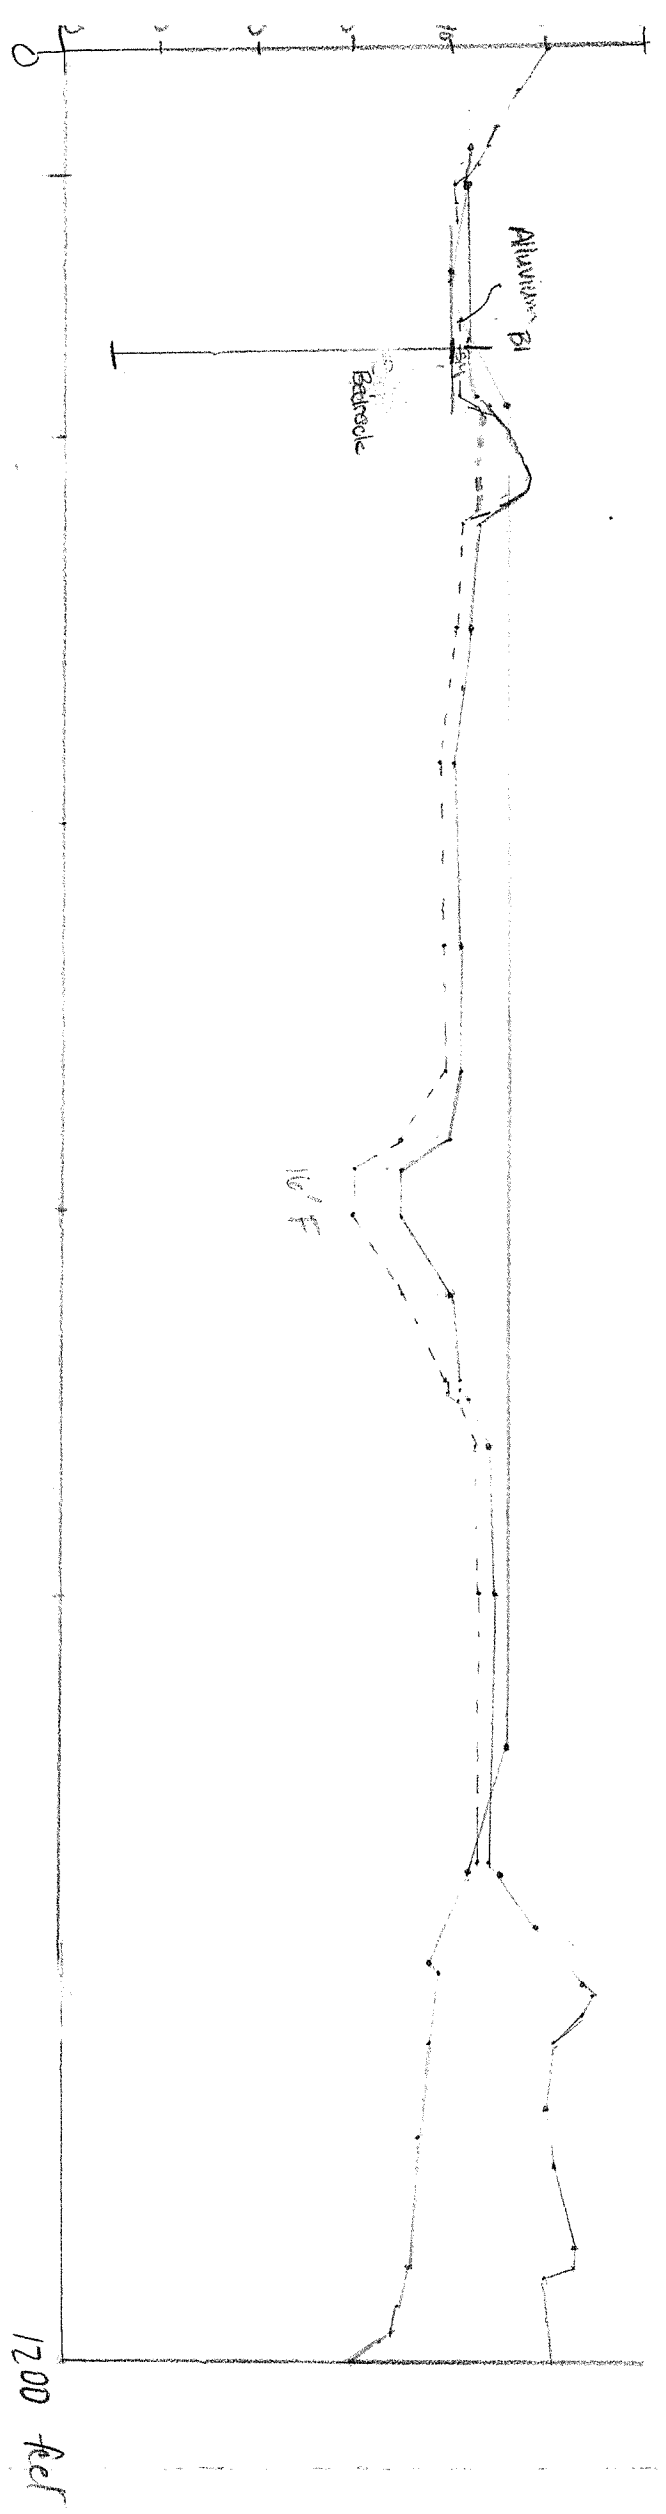

- Existing Elevation
- Proposed Grade
- - - Potential Removal Depth (CHS, July 29, 2007)
- - - Potential Footing Overex per CHS (July 29, 2007)

Job 07489-3 Client: Magnum 7/08 H:1"=160' V:1"=20'

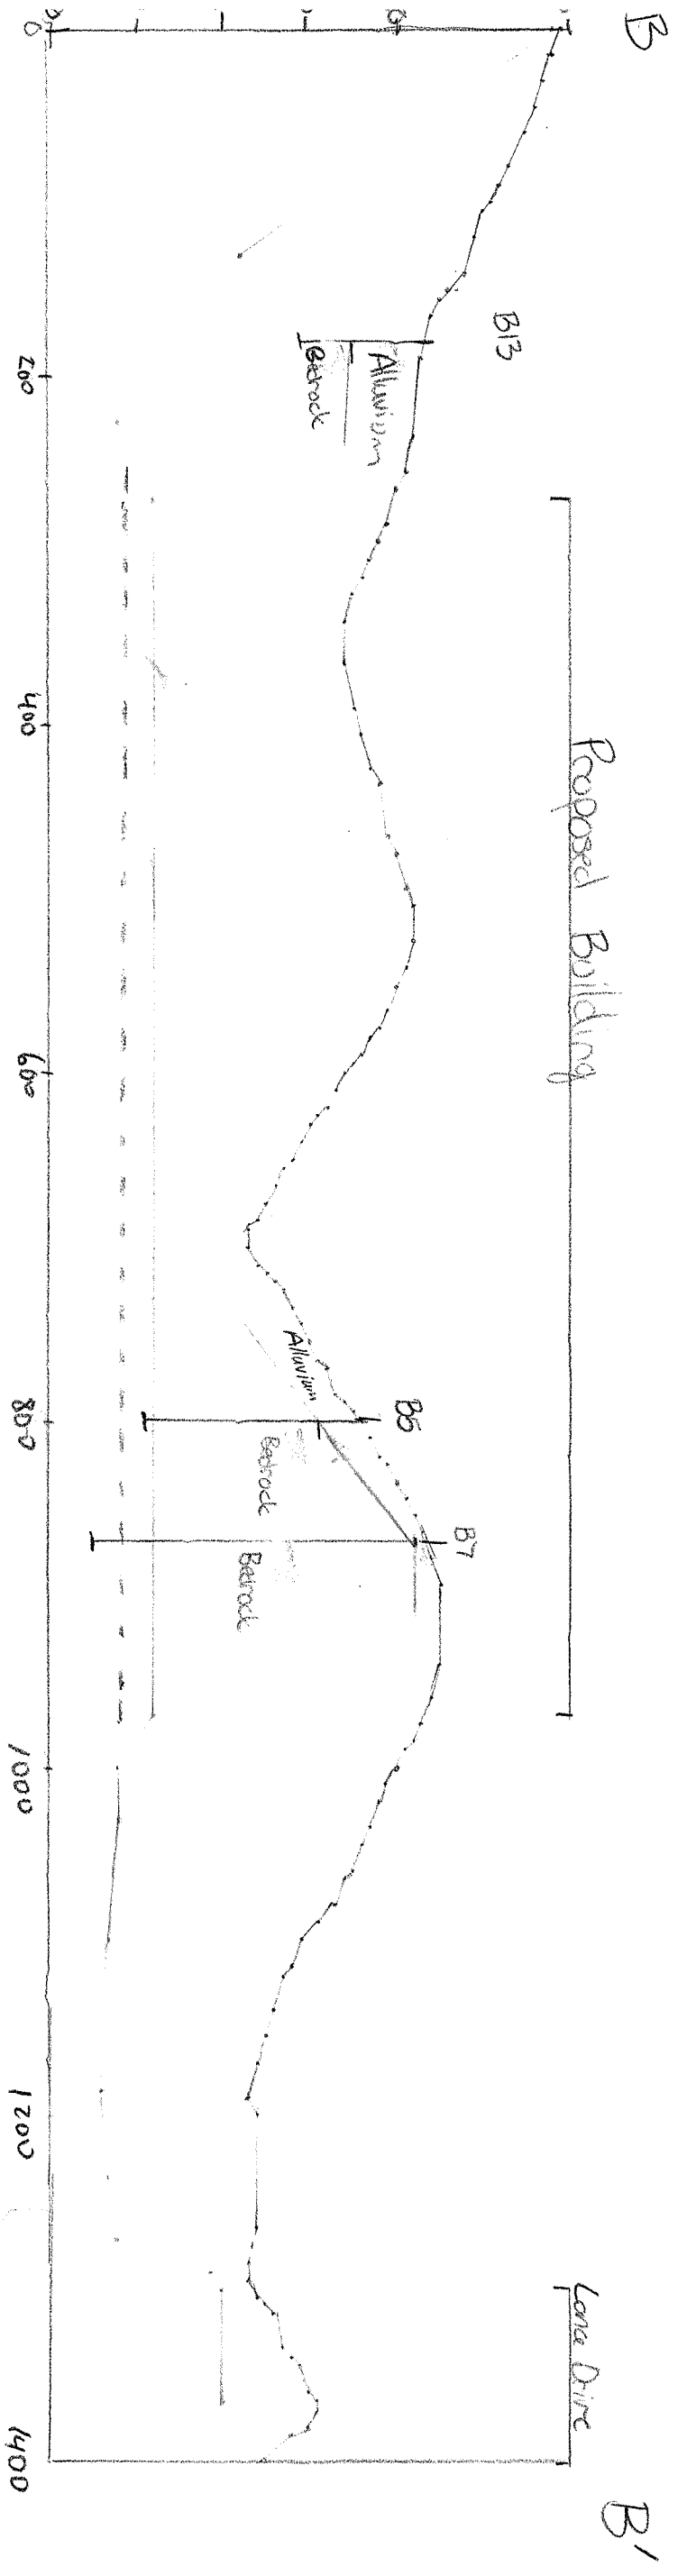


— Existing Elevation
 - - - Proposed Grade
 - - - Potential Polym Overce per CHJ (July 20, 2007)

Sbs 07489-3


Client: Magnum 7/08

H: 1" = 100' V: 1" = 20'

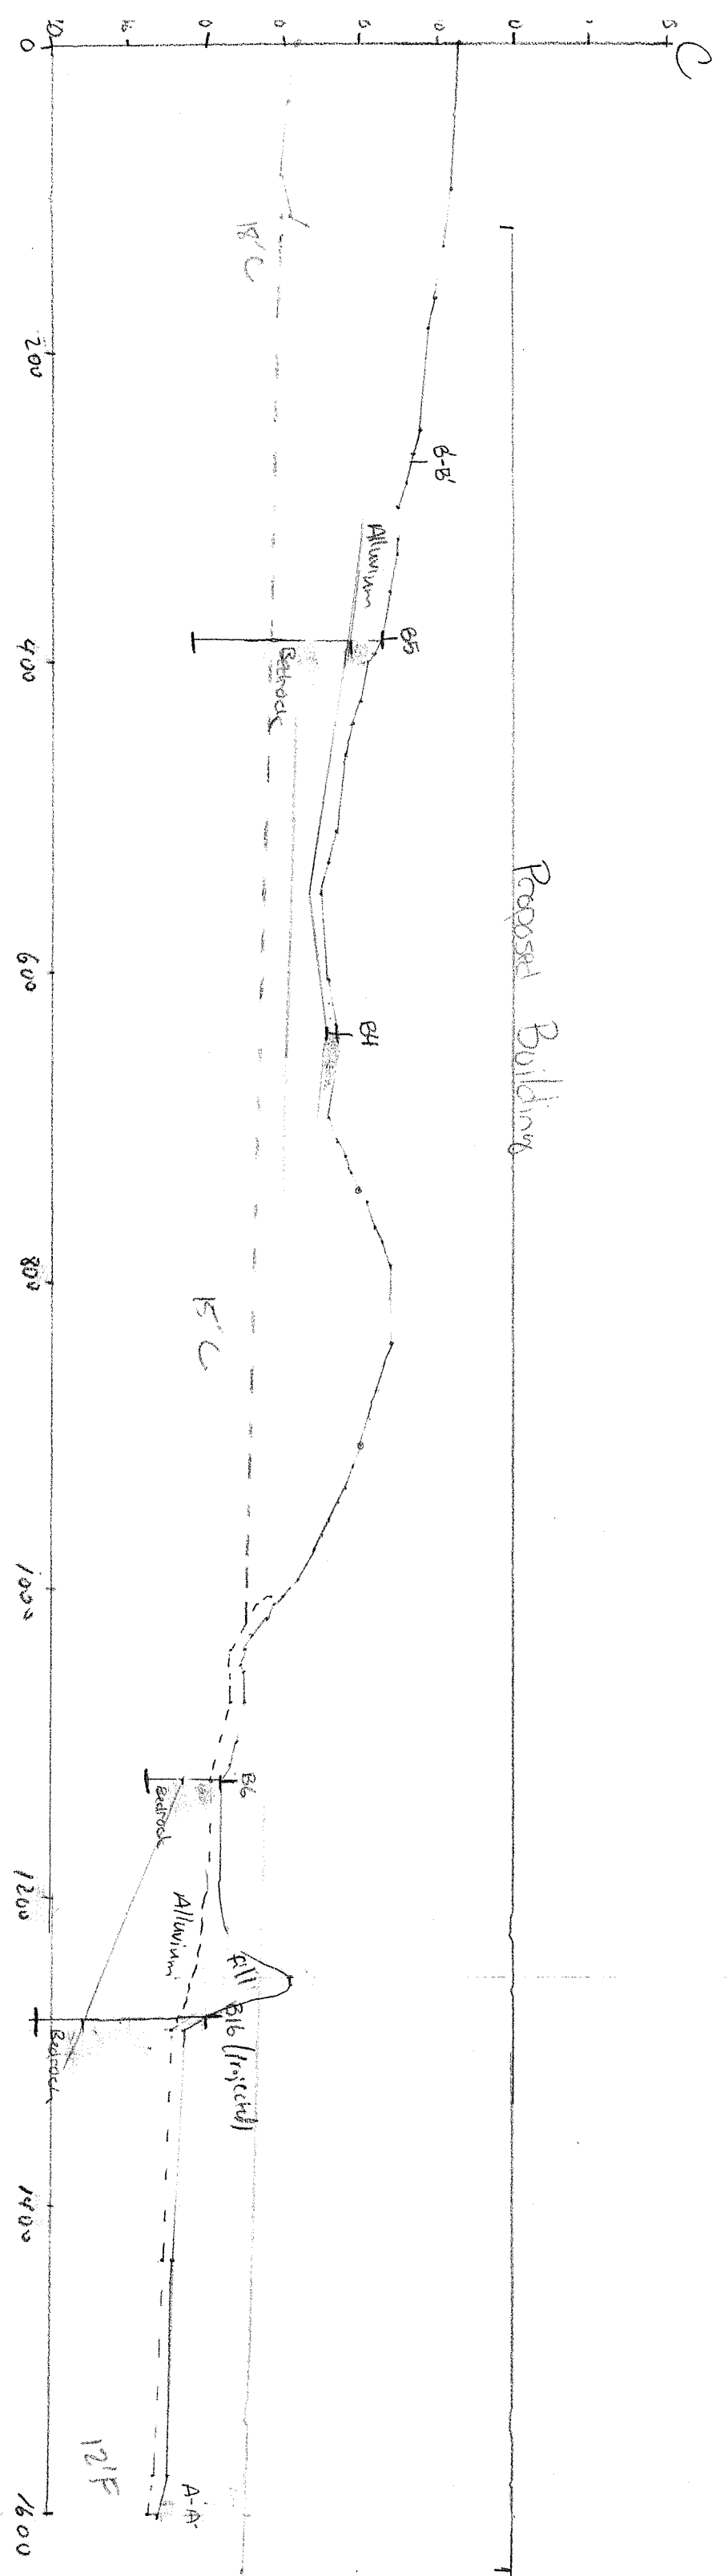

- Existing Elevation
- Proposed Grade
- - - Abutment Removal Depth (CHD, July 20, 2007)
- - - Potential Footing Overex per CHD (July 20, 2007)


C'

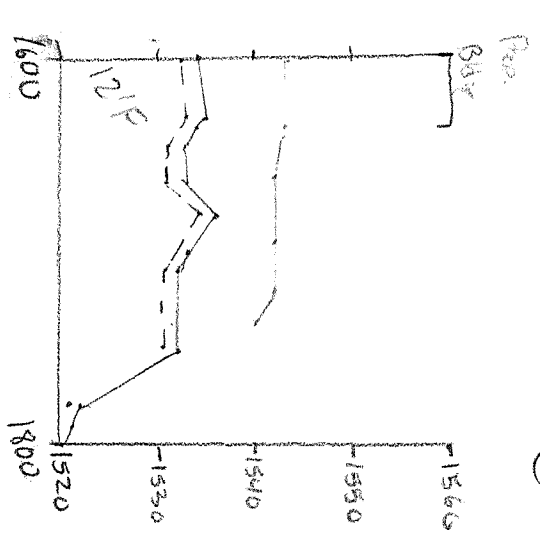



**GEOTECHNICAL INVESTIGATION
PROPOSED INDUSTRIAL DEVELOPMENT
LANE AND SIERRA RIDGE DRIVES
RIVERSIDE, CALIFORNIA
PREPARED FOR
THE MAGNON COMPANIES
JOB NO. 07489-3**

540 W. VI. VII (78-ACR)

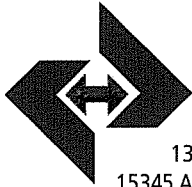

C.H.J. Incorporated

1355 E. Cooley Drive, Colton, CA 92324 ♦ Phone (909) 824-7210 ♦ Fax (909) 824-7209
15345 Anacapa Road, Suite D, Victorville, CA 92392 ♦ Phone (760) 243-0506 ♦ Fax (760) 243-1225

July 20, 2007

The Magnon Companies
815 Marlborough Avenue, Suite 200
Riverside, California 92507
Attention: Mr. David Stapley

Job No. 07489-3

Dear Mr. Stapley:

Attached herewith is the Geotechnical Investigation report prepared for the proposed industrial development, to be located northwest of the intersection of Lance Drive and Sierra Crest Drive in the Sycamore Canyon area of Riverside, California.

This report was based upon a scope of services generally outlined in our proposal letter, dated June 14, 2007, and other written and verbal communications.

We appreciate this opportunity to provide geotechnical services for this project. If you have questions or comments concerning this report, please contact this firm at your convenience.

Respectfully submitted,
C.H.J., INCORPORATED

Ben Williams
Ben Williams, P.G. 7542
Senior Staff Geologist

BW:ndt

Distribution: The Magnon Companies (6)

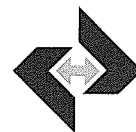


TABLE OF CONTENTS

	<u>PAGE</u>
INTRODUCTION	1
SCOPE OF SERVICES	1
PROJECT CONSIDERATIONS	2
SITE DESCRIPTION	2
FIELD INVESTIGATION	3
LABORATORY INVESTIGATION	4
SITE GEOLOGY AND SUBSURFACE SOIL CONDITIONS	4
FAULTING	6
HISTORICAL EARTHQUAKES	7
SEISMIC ANALYSIS	8
Probabilistic Hazard Analysis	8
Seismic Zone	9
Soil Profile Characterization	9
Near-Source Effects	9
GROUNDWATER AND LIQUEFACTION	9
FLOODING AND EROSION	10
SLOPE STABILITY	10
RIPPABILITY AND ROCK DISPOSAL	11
Rock Disposal	12
CONCLUSIONS	13
RECOMMENDATIONS	14
Seismic Design Considerations	14
Cut Slope Construction	15
Site Drainage	15
General Site Grading	15
Initial Site Preparation	16
Preparation of Fill Areas	17
Preparation of Footing Areas	17
Rock Disposal	17
Compacted Fills	17
Subdrainage	18
Expansive Soils	19
Foundation Design	19
Lateral Loading	19
Slabs-on-Grade	20
Potential Erosion	20



TABLE OF CONTENTS

	<u>PAGE</u>
Preliminary Pavement Design	20
Preliminary Asphalt Pavement Design	21
Preliminary Concrete Pavement Design	21
Chemical/Corrosivity Tests	22
Construction Observation	23
LIMITATIONS	23
CLOSURE	25
REFERENCES	26
AERIAL PHOTOGRAPHS REVIEWED	29

ENCLOSURE

APPENDIX "A" - GEOTECHNICAL MAPS

Index Map	"A-1"
Plat	"A-2"
Geologic Index Map	"A-3"
Earthquake Epicenter Map	"A-4"

APPENDIX "B" - EXPLORATORY LOGS

Key to Logs	"B" (1of2)
Soil Classification Chart	"B" (2of2)
Exploratory Borings	"B-1"-"B-16"

APPENDIX "C" - LABORATORY TESTING


Grain Size Distribution	"C-1"
Moisture Density Relationship	"C-2"
Direct Shear Test	"C-3"
Expansion Index Summary	"C-4"
R-Value Test Results	"C-5"
Corrosivity Test Results	"C-6"

APPENDIX "D" - GEOTECHNICAL DETAILS

Rock Disposal Detail	"D-1"
----------------------------	-------

APPENDIX "E" - SEISMIC REFRACTION SURVEY

Seismic Refraction Survey	"E-1"
---------------------------------	-------

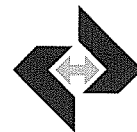

GEOTECHNICAL INVESTIGATION
PROPOSED INDUSTRIAL DEVELOPMENT
LANCE AND SIERRA RIDGE DRIVES
RIVERSIDE, CALIFORNIA
PREPARED FOR
THE MAGNON COMPANIES
JOB NO. 07489-3

INTRODUCTION

During July of 2007, a geotechnical investigation was performed by this firm for the proposed industrial development, to be located northwest of the intersection of Lance Drive and Sierra Ridge Drive in the Sycamore Canyon area of Riverside, California. The purpose of this investigation was to explore and evaluate the geotechnical conditions at the subject site and to provide appropriate geotechnical recommendations for design of the proposed structures and infrastructure.

To orient our investigation at the site, a master plan of the Sycamore Canyon Complex was provided for our use. To further delineate the subject site, aerial photographs were utilized. The approximate location of the site is shown on the attached Index Map (Enclosure "A-1").

The results of our investigation, together with our conclusions and recommendations, are presented in this report.

SCOPE OF SERVICES

The scope of services provided during this geotechnical investigation included the following:

- Review of published and unpublished literature and maps
- Review and analysis of stereoscopic aerial photographs flown from 1962 to 1995
- Placement of 12 seismic refraction lines within the site boundaries
- Analysis of seismic data in order to evaluate the rippability of the bedrock material
- Geologic field reconnaissance of the site and surrounding area
- Placement of 16 exploratory borings on the site
- Logging and sampling of exploratory borings as well as surficial soils for testing and evaluation



- Laboratory testing on selected samples
- Evaluation of the geotechnical engineering data to develop site-specific recommendations for site preparation, conventional static foundation design, and mitigation of potential geotechnical constraints.

PROJECT CONSIDERATIONS

It is our understanding that the subject site is to be developed with industrial/warehouse/distribution center type structures and related infrastructure. It is anticipated that the site will be developed with one- to two-story structures of concrete tilt-up construction, utilizing conventional spread foundations for support. Moderate foundation loading is anticipated for the structures.

The project grading plan was not available at the time of our investigation. The general topography indicates that the grading of this site will entail maximum cuts and fills on the order of 30 to 40 feet. The final grading plan should be reviewed by the geotechnical engineer.

SITE DESCRIPTION

The subject site is a rectangular-shaped parcel of approximately 75± acres located northwest of the intersection of Sierra Ridge Drive and Lance Drive in the Sycamore Canyon Development of the City of Riverside, California. The site is bounded by existing commercial developments to the east and south, a residential development to the north and the northwest, and vacant land to the west.

At the time of our investigation, the site was vacant with slightly rolling topography. Drainage was generally toward the center of the parcel to a shallow ravine and then to the south, with maximum slope inclinations on the order of 6 to 8 percent. Portions of the site were used for burrow purposes in the past, and evidence of minor cut/fill grading was visible in the southern portions of the site. A rock crusher operation existed in the southeast portion of the parcel.

Sparse vegetation consisting of annual weeds and grasses was growing on the site. No significant debris was observed. It is anticipated that areas of undocumented fill may exist associated with the crusher operation.



Review of our in-house stereoscopic aerial photographs dating back to 1962 show the site to be vacant. The site had a slightly rolling topography that was moderately incised by ephemeral drainages with a southern trend. The 1995 photographs show the site similar to its current condition.

No other surface features pertinent to this investigation were noted.

FIELD INVESTIGATION

A site reconnaissance was performed by representatives of this firm and our geophysical consultant on June 25, 2007. At that time, twelve locations were selected for placement of seismic refraction lines. The seismic refraction survey was conducted by Terra Geosciences on the following Saturday to limit the influence of background noise from rock crushing activity on-site and nearby construction. The results of the seismic refraction survey are included as Appendix "E".

The soil conditions underlying the subject site were explored by means of 16 exploratory borings drilled to a maximum depth of 37 feet below the existing ground surface with a truck-mounted CME 55 drill rig equipped for soil sampling. The approximate locations of our exploratory borings are indicated on the attached Plat (Enclosure "A-2").

Continuous logs of the subsurface conditions, as encountered within the exploratory borings, were recorded at the time of drilling by a staff geologist from this firm. Both a standard penetration test (SPT) sampler (2-inch outer diameter and 1 3/8-inch inner diameter) and a ring sampler (3 1/4-inch outer diameter and 2.42 inch inner diameter) were utilized in our investigation. The penetration resistance was recorded on the boring logs as the number of hammer blows used to advance the sampler in 6-inch increments (or less if noted). The samplers were driven with an automatic hammer that drops a 140-pound weight 30 inches for each blow. After the required seating, samplers are advanced up to 18 inches providing up to three sets of blowcounts at each sampling interval. The recorded blows are raw numbers without any corrections such as hammer type (automatic vs. manual cathead) or sampler size (ring sampler vs. SPT sampler). Relatively undisturbed as well as bulk samples of typical soil types obtained were returned to the laboratory in sealed containers for testing and evaluation.

Our exploratory boring logs, together with our in-place blowcounts per 6-inch increment, are presented in Appendix "B". The stratification lines presented on the boring logs represent approximate boundaries between soil types, which may include gradual transitions.



LABORATORY INVESTIGATION

Included in the laboratory testing program were field moisture content tests on all samples returned to the laboratory and field dry density tests on all relatively undisturbed samples. The results are included on the boring logs. Optimum moisture content - maximum dry density relationships were established for typical soil types. Direct shear testing was performed on selected remolded samples in order to provide shear strength parameters for bearing capacity and earth pressure evaluations. Sieve analyses and sand equivalent tests were performed on selected samples to aid in soil classification. Expansion index testing (UBC 18-2) was performed on a selected sample of clay bearing soil in order to evaluate the soil expansion characteristics. R-value testing was performed on a sample of probable pavement subgrade soil to assist in preliminary pavement structural section design. Selected samples of material were delivered to our corrosivity consultant for testing.

Summaries of the laboratory test results appear in Appendix "C".

SITE GEOLOGY AND SUBSURFACE SOIL CONDITIONS

The site is located on the Perris Block, a portion of the Peninsular Ranges Geomorphic Province. The Perris Block is a fault-bounded region of relative tectonic stability, a mass of relatively high land composed of crystalline bedrock of the southern California batholith that is thinly and discontinuously mantled by sedimentary material (Woodford and others, 1971). Several geomorphic surfaces are well developed on the Perris Block that represent former, local, erosional/depositional base levels. The site is located on the youngest of the Perris Block surfaces, known as the Paloma surface (Woodford and others, 1971). The Paloma surface is characterized by crystalline bedrock overlain by fine-grained alluvial deposits.

Regional geologic mapping conducted by Morton and Cox (2001) of the site and surrounding area, show the site as underlain by Val Verde Tonalite (granitic bedrock). Granitic bedrock was exposed in scattered areas throughout the site.

Data from our exploratory borings indicated that the subject site is generally blanketed by a layer of silty sand, underlain by granitic bedrock. In the areas explored, the silty sand (SM) is medium dense to dense and on the order of zero to 17 feet in thickness. Localized areas of clay bearing silty sand (SM) were encountered.



The upper soils were generally granular and are not anticipated to have a significant expansion potential. In localized areas, clay bearing silty sands were encountered. Expansion index testing (UBC 18-2) was performed on a selected sample of clay bearing soil. The results of our test, included in Appendix "C", indicate a "very low" expansion potential for these clay bearing soils.

The underlying bedrock is in a very dense state. Due to the grinding action of the augers the bedrock material was recovered as silty sand. Bedrock was encountered in all of the exploratory borings.

It appears that the bedrock is at or near the surface over a large portion of the site. In only four of the sixteen borings, was bedrock material encountered at a depth of 4 feet or greater. Within Exploratory Boring No. 16 the bedrock was encountered at a depth of 17 feet.

Fill to a depth of 11 feet was encountered in Exploratory Boring No. 16 associated with road construction across a stream channel. Fill was not encountered in the remaining borings utilized for this investigation. It is anticipated that undocumented fill, associated with previous site usage, may exist in localized areas of the site.

Refusal was encountered within all exploratory borings utilized for this investigation. The depth of refusal varied from 1 to 37 feet below the existing ground surface.

Groundwater was not encountered within any of our exploratory borings.

Our exploratory borings experienced only slight caving upon removal of the drilling augers.

The results of our soluble sulfate testing indicate a "negligible" exposure to sulfate attack according to the American Concrete Institute. The soils tested are classified as moderately corrosive to corrosive to ferrous metals. Further information on the corrosivity analysis is included in the Chemical/Corrosivity Tests section of this report and Appendix "C".

The locations of the exploratory borings are shown on the attached Plat (Enclosure "A-2").

A more detailed description of the subsurface soil conditions encountered within our exploratory borings is presented on the attached boring logs (Appendix "B").




FAULTING

The tectonics of the Southern California area are dominated by the interaction of the North American plate and the Pacific plate, which are apparently sliding past each other in a translational manner. Although some of the motion may be accommodated by rotation of crustal blocks such as the western Transverse Ranges (Dickinson, 1996), the San Andreas fault zone is thought to represent the major surface expression of the tectonic boundary and to be accommodating most of the translational motion between the Pacific plate and the North American plate. However, some of the plate motion is apparently also partitioned out to the other northwest-trending strike-slip faults that are thought to be related to the San Andreas system, such as the San Jacinto fault and the Elsinore fault. Local compressional or extensional strain resulting from the translational motion along this boundary is accommodated by left-lateral, reverse, and normal faults such as the San Jose fault, the Cucamonga fault zone, and the Crafton Hills fault zone (Matti and others, 1992; Morton and Matti, 1993).

The site does not lie within or adjacent to an Alquist-Priolo Earthquake Fault Zone designated by the State of California to include traces of suspected active faulting. No evidence for active faulting on the site was observed during the geologic field reconnaissance or on the aerial photographs reviewed.

The San Jacinto fault zone, a system of northwest-trending, right-lateral, strike-slip faults, is present approximately 6 miles northeast of the site. In the San Jacinto Valley, southeast of the site, the San Jacinto fault is expressed as two parallel main strands. The western strand, known as the Casa Loma fault, is well expressed in late Holocene alluvium in the Hemet area, but evidence of recent activity decreases to the north. North of the San Jacinto River, Rogers (1966) mapped the Casa Loma fault as a buried trace that links with the Reche Canyon fault as mapped by Morton (1978). That fault is approximately 11 miles north of the site. The eastern strand, or Claremont fault, is well expressed in the northern San Jacinto Valley at a closest distance of approximately 12 miles.

A maximum moment magnitude (M_{max}) earthquake of M 6.9 is assigned to a rupture of the San Jacinto Valley segment of the San Jacinto fault (Petersen and others, 1996). More large historic earthquakes have occurred on the San Jacinto fault than any other fault in Southern California (Working Group on California Earthquake Probabilities, 1988). Based on the data of Matti and others (1992), this portion of the San Jacinto fault may be accommodating much of the motion between the Pacific plate and the North American plate in this area. Matti and others (1992) suggest this motion is transferred to the San

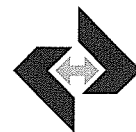

Andreas fault in the Cajon Pass region by "stepping over" to parallel fault strands which include the Glen Helen fault. The Working Group on California Earthquake Probabilities (1995) tentatively assigned a 43 percent (± 17 percent) probability of a major earthquake on the San Jacinto Valley segment of the San Jacinto fault for the 30-year interval from 1994 to 2024.


The San Andreas fault zone is located along the southwest margin of the San Bernardino Mountains, approximately 16 miles northeast of the site. The toe of the mountain front in the San Bernardino area roughly demarcates the presently active trace of the San Andreas fault, which is characterized by youthful fault scarps, vegetational lineaments, springs, and offset drainages. The Working Group on California Earthquake Probabilities (1995) tentatively assigned a 28 percent (± 13 percent) probability to a major earthquake occurring on the San Bernardino Mountains segment of the San Andreas fault between 1994 and 2004.

The Elsinore fault zone is present approximately 17 miles southwest of the site. The Elsinore fault zone is composed of multiple *en echelon* and diverging fault traces and splays into the Whittier and Chino faults to the north. Although a zone of overall right-lateral deformation consistent with the regional plate tectonics, traces of the Elsinore fault zone form the graben of the Elsinore and Temecula Valleys. Holocene surface rupture events have been documented for several principal strands of the Elsinore fault zone (Saul, 1978; Rockwell and others, 1986; Wills, 1988).

HISTORICAL EARTHQUAKES

A map of recorded earthquake epicenters is included as Enclosure "A-4" (Epi Software, 2000). This map includes the Cal Tech database for earthquakes with magnitudes of 4.0 or greater from 1977 through 2007.

The San Jacinto fault is the most seismically active fault in Southern California, although it has no record of producing great events comparable to those that occurred on the San Andreas fault during the Fort Tejon earthquake of 1857 and the San Francisco earthquake of 1906 (Working Group on California Earthquake Probabilities, 1988). Between 1899 and 1990, seven earthquakes of **M** 6.0 or greater have occurred along the San Jacinto fault. Two of these earthquakes, an estimated **M** 6.7 in 1899 and an **M** 6.8 in 1918, took place in the San Jacinto Valley, southeast of the site. Two others, an estimated **M** 6.5 in 1899 and an **M** 6.2 in 1923, took place in the San Bernardino Valley, north of the site (Working Group on California Earthquake Probabilities, 1988).

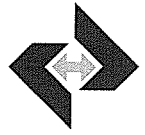

No large earthquakes have occurred on the San Bernardino Mountains segment of the San Andreas fault within the regional historical time frame. Using dendrochronological evidence, Jacoby and others (1987) inferred that a great earthquake on December 8, 1812 ruptured the northern reaches of this segment. Recent trenching studies have revealed evidence of rupture on the San Andreas fault at Wrightwood occurred within this time frame (Fumal and others, 1993). Comparison of rupture events at the Wrightwood site and Pallett Creek, and analysis of reported intensities at the coastal missions, led Fumal and others (1993) to conclude that the December 8, 1812 event ruptured the San Bernardino Mountains segment of the San Andreas fault largely to the southeast of Wrightwood, possibly extending into the San Bernardino Valley. The average recurrence interval for large earthquakes along the southern San Andreas fault at six paleoseismic sites is 182 years (Stone and others, 2002). Surface rupture occurred on the Mojave segment of the San Andreas fault in the great 1857 Fort Tejon earthquake. The Coachella Valley segment of the San Andreas fault was responsible for the 1948 **M** 6.5 earthquake in the Desert Hot Springs area and for the 1986 **M** 5.6 earthquake in the North Palm Springs area.


The only large historical earthquake that can definitely be attributed to the Elsinore fault was an **M** 6.0 event in 1910 in the Temescal Valley area. This event caused damage to structures from Corona to Wildomar (Weber, 1977). Since 1932, four **M** 4.0+ earthquakes have occurred along the Elsinore fault zone in the Santiago Peak area (Weber, 1977).

SEISMIC ANALYSIS

The precise relationship between magnitude and recurrence interval of large earthquakes for a given fault is not known due to the relatively short time span of recorded seismic activity. As a result, a number of assumptions must be made to quantify the ground shaking hazard at a particular site. Seismic hazard evaluations can be conducted from both a probabilistic and a deterministic standpoint. The probabilistic method is prescribed for seismic design by current building codes and was utilized to estimate the seismic hazard to the site during this investigation.

PROBABILISTIC HAZARD ANALYSIS:

The probabilistic analysis of seismic hazard is a statistical analysis of seismicity of all known regional faults attenuated to a particular geographic location. The results of a probabilistic seismic hazard analysis are presented as the annual probability of exceedance of a given strong motion parameter for a particular exposure time (Johnson and others, 1992).

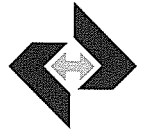

For this report, the seismic hazard analysis computer program EZFRISK, Version 7.22 (Risk Engineering, 2007) was used to analyze the location of the site under the criteria for rock sites. The estimated value for the peak ground acceleration was calculated as the average of the accelerations computed using the attenuation relations of Boore et al. (1997), Sadigh et al. (1997), and Abrahamson and Silva (1997), in relation to seismogenic faults within a 93-mile (150-km) radius of the site. The EZFRISK program considers seismicity from mappable seismogenic faults and background sources (those earthquakes not associated with a mapped fault source) and assumes that the occurrence rate of earthquakes on a fault is proportional to the estimated slip rate of that fault. Potential earthquake magnitudes are correlated to expected seismic sources, and the resultant maximum ground acceleration at the site is computed.

Based on the site-specific PSHA performed for the site, the estimated peak horizontal ground acceleration of 0.62g has a 10 percent probability of exceedance in 50 years (statistical return period of 475 years). This corresponds to the Design Basis Earthquake as defined in the 2001 California Building Code (CBC).

SEISMIC ZONE:

The site is included within Seismic Zone 4. Table 16-I of the 2001 (CBC) assigns a Seismic Zone Factor "Z" of 0.4 to Seismic Zone 4.

SOIL PROFILE CHARACTERIZATION:

Based on review of the boring logs, the anticipated grading, and the geologic setting, a soil profile type S_c , very dense soil and soft rock, is appropriate for the site.

NEAR-SOURCE EFFECTS:

The San Jacinto fault is classified as a Type "B" fault by the State of California. For the Type "B" classified San Jacinto fault, at a surface distance of approximately 6 miles (9 1/2 kilometers), the near-source acceleration factor N_A , as defined in the 2001 CBC, is 1.00, and the near-source velocity factor N_V is 1.02.

GROUNDWATER AND LIQUEFACTION

Liquefaction is a process in which strong ground shaking causes saturated soils to lose their strength and behave as a fluid (Matti and Carson, 1991). Ground failure associated with liquefaction can result in



severe damage to structures. The geologic conditions for increased susceptibility to liquefaction are 1) shallow groundwater (generally less than 50 feet in depth), 2) presence of unconsolidated sandy alluvium, typically Holocene in age, and 3) strong ground shaking. All three of these conditions must be present for liquefaction to occur.

The site is underlain at shallow depths by dense to very dense granitic bedrock. Due to the presence of shallow bedrock and the absence of shallow groundwater, liquefaction is not considered to be a hazard at this site.

Groundwater was not encountered within the exploratory borings. There is a potential for perched, seasonal groundwater along the bedrock/alluvium interface due to the presence of relatively impermeable shallow bedrock overlain by more permeable alluvium.

FLOODING AND EROSION


No evidence of recent significant flooding of the site was observed during the geologic field reconnaissance or on the aerial photographs reviewed.

The upper soils encountered within the site consist of silty sands that are moderately susceptible to erosion by wind and water. Positive drainage should be provided and water should not be allowed to pond anywhere on the site. Water should not be allowed to flow over any graded or natural areas in such a way as to cause erosion.

A shallow stream channel traverses the site. Surface flow was not visible in the channel at the time of our investigation.

SLOPE STABILITY

Current site topography consists of rolling hills with approximately 60 feet of elevation difference across the site. Based on review of the proposed development, slopes up to 20 feet are likely. Geologic mapping conducted by Morton and Cox (2001) show regional jointing dipping moderately to the northeast. The bedrock outcrops at the site are highly weathered and did not exhibit preferred jointing orientations.

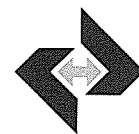

The term "landslide", as used in this report, refers to deep-seated slope failures at least 15 feet deep. Landslides are typically related to the underlying structure of the parent material. Surficial failures refer to shallow failures that affect the upper weathered horizon of the parent material. No evidence for deep-seated landsliding was observed during the field reconnaissance or on the aerial photographs reviewed.

The susceptibility of a geologic unit to landsliding is dependent upon various factors, primarily: 1) the presence and orientation of weak structures, such as fractures, faults and joints; 2) the height and steepness of the pertinent natural or cut slope; 3) the presence and quantity of groundwater; and 4) the occurrence of strong seismic shaking. No adversely-oriented structures were observed. Groundwater is not expected within any of the potential cut slopes.

Cut slopes up to 30 feet in height constructed entirely within the bedrock unit are considered to be stable against gross failure at inclinations no steeper than 2 horizontal to 1 vertical [2(h):1(v)].

Fill slopes constructed to a maximum of 30 feet and at inclinations no steeper than 2(h):1(v) are considered stable.

RIPPABILITY AND ROCK DISPOSAL

A seismic refraction survey was conducted by Terra Geosciences to analyze the rippability of the underlying bedrock. The results of the survey are summarized below and discussed in more detail in the attached report (Appendix "E"). Additionally, Exploratory Boring Nos. 4, 5, 10, and 11 were placed along the seismic lines to compare refusal depths with measured velocities of the seismic refraction survey. Based on comparison of the boring logs and the tomographic velocity models, refusal generally occurred at velocities ranging from 4,000 to 5,000 feet per second.

Measured seismic velocities at the site were varied. In general, rock with higher velocities was encountered at shallower depths in the southern portion of the site. No grading plans were available during the preparation of this report. Based on the anticipated grading, specialized excavation methods (such as blasting) may be required.

The seismic velocity can be utilized to estimate the rippability of subsurface materials. A chart included in the Caterpillar Performance Handbook (1992) correlates seismic velocity of different rock types to



rippability by D8L or D9N bulldozers utilizing single- or multi-shank rippers. This chart indicates granitic rock, such as that which underlies the site, is rippable to a velocity up to 6,800 feet per second (fps). Granitic rock of between 6,800 and 8,000 fps is considered to be marginally rippable, and velocities of greater than 8,000 fps are considered to be non-rippable. Our experiences with similar sites of this type indicate that the velocities in the Caterpillar Performance Handbook (1992) are approximately 1,500 fps too fast for reasonable production rates.

No published data are available to relate the seismic velocity of rock with its excavation potential ("trenchability") for backhoes. A large excavator, such as a Cat 235, is typically used for larger utility trenching projects. A smaller rubber-tired backhoe, such as a Case 580, is typically used for smaller projects, such as residential utility lines and foundation trenching. Based upon our experience with granitic bedrock, a Cat 235 excavator can excavate granitic rock with velocities up to approximately 4,300 fps. A Case 580 backhoe can excavate granitic rock with velocities up to approximately 3,300 fps. Bedrock that is not trenchable with a backhoe will generally require blasting, jackhammering, or use of a chain trencher for excavation.

ROCK DISPOSAL:

Grading of the site may result in the generation of rock with dimensions greater than 12 inches. No rock greater than 12 inches in dimension may be buried or placed in fills, within 10 feet of final grade. If it is necessary to dispose of such material on-site, the boulders should not be placed in site fills except in areas designated as "rock disposal areas". Such "rock disposal areas" should be non-buildable areas or areas below the depth of 10 feet.

In order to properly compact soils in "rock disposal areas", the rock should be placed in windrows, in such a manner as to avoid nesting and to allow access for compaction equipment. The oversized material should be placed in lifts, alternating with lifts of soil without oversized material. Continuous observation by the geotechnical engineer should be provided to confirm that adequate compaction is achieved in such areas. A typical rock disposal detailed is included in Appendix "D".

Again, these recommendations are preliminary. Additional recommendations can be provided once the proposed grading is known. In any case, it is crucial that the geotechnical engineer be present to observe these operations. Further recommendations may be made in the field depending on the actual conditions encountered.



CONCLUSIONS

On the basis of our field and laboratory investigations, it is the opinion of this firm that the proposed construction is feasible from a geotechnical engineering standpoint, provided the recommendations contained in this report are implemented during grading and construction.


Based upon our field investigation and test data, it is our opinion that the undocumented fill, native soils and granitic bedrock will not, in their present condition, provide uniform or adequate support for the proposed structures and infrastructures. Our blowcount and density testing indicated variable in-situ conditions of these materials ranging from loose to very dense states. The soil profile at the site extends to depths of up to 17 feet, at which depth the soil is underlain by granitic bedrock. In other areas of the site, bedrock is exposed at the surface. These conditions may cause unacceptable differential and/or overall settlement upon application of the anticipated foundation loads. Site clearing can be expected to further aggravate the settlement-prone conditions.

Based on the anticipated grading, non-rippable bedrock may be encountered. To obtain finish grade elevations and/or the recommended criteria described below, specialized excavation methods such as fill mat blasting may be necessary.

Due to the elevation difference across the site and the varying depth of bedrock, it does not appear feasible for the foundations of the proposed structure to bear entirely in undisturbed bedrock. The foundations of the structures should not be permitted to span from soil to bedrock. To provide adequate support for the proposed structures, it is our recommendation that they be provided with a compacted fill mat beneath all footings and slabs. A compacted fill mat will provide a dense, uniform, high-strength soil layer to distribute the foundation loads over the underlying soils. Conventional spread foundations, either individual spread footings and/or continuous wall footings, may be utilized in conjunction with a compacted fill mat.

The construction of this compacted fill mat should include, at a minimum, the mandatory removal and replacement of the upper 18 inches of existing soils. Additional removals of both the soil and bedrock may be necessary to provide the recommended fill mat.

The bottom of this excavation should be observed by the engineering geologist prior to scarification to verify the complete removal of any undocumented fill material or disturbed native soils. This required

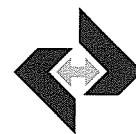

removal, and subsequent scarification and recompaction, will facilitate the densification of the upper soils. It will also assist in the identification of undocumented fill soils.

Severe seismic shaking of the site can be expected during the lifetime of the proposed structures.

Groundwater was not encountered within any of our exploratory borings.

Native soils encountered below a depth of approximately 2 feet were generally in medium dense to dense state and are underlain by dense to very dense granitic bedrock. The hydroconsolidation potential at the site is considered to be very low.

Undocumented fill was encountered in Exploratory Boring No. 16 to a depth of approximately 11 feet below the ground surface. Below the fill, native soils were encountered to a depth of 17 feet bgs.

All of our exploratory borings experienced slight caving upon removal of the drilling augers.

Due to the shallow bedrock and the depth to groundwater beneath the site, liquefaction and other shallow groundwater hazards are not anticipated.

No evidence of recent significant flooding of the site was observed during the geologic field reconnaissance or on the aerial photographs reviewed.

The on-site soils are generally granular and are considered to be non-critically expansive. Expansion testing (UBC 18-2) performed on a sample of clay bearing soils indicated a "very low" expansion potential.

RECOMMENDATIONS

SEISMIC DESIGN CONSIDERATIONS:

Moderate seismic shaking of the site can be expected during the lifetime of the proposed structures. Therefore, the proposed structures should be designed accordingly.

A soil profile type S_C , very dense soil and soft rock, is appropriate for the site.



The site is subject to near-source acceleration and velocity factors (N_A and N_V) of 1.00 and 1.02, respectively, as defined in the 2001 (CBC).

CUT SLOPE CONSTRUCTION:

Cut slopes up to 30 feet in height should be constructed no steeper than 2(h): 1(v). Cut slopes higher than 30 feet, if proposed, should be evaluated by the engineering geologist and geotechnical engineer prior to and during construction.

FILL SLOPE CONSTRUCTION:

Fill slopes should be constructed no steeper than 2(h):1(v) up to approximately 30 feet in height. Fill slopes should be overfilled during construction and then cut back to expose fully-compacted soil. A suitable alternative would be to compact the slopes during construction and then roll the final slopes to provide dense, erosion-resistant surfaces.

Where fills are to be placed against existing slopes steeper than 5(h):1(v), the existing slopes should be benched into competent native materials to provide a series of level benches to seat the fill and to remove the compressive and permeable top soils. The benches should be a minimum of 8 feet in width, constructed at approximately 4-foot vertical intervals. In addition, a shear key should be constructed across the toe of the slope. The shear key should be a minimum of 15 feet wide and should penetrate a minimum of 2 feet beneath the toe of the slope into firm competent soils. A Typical Benching Detail is included in Appendix "D".

SITE DRAINAGE:

Site drainage should be designed to accommodate local runoff. Increasing pavement surface with local development should be considered in the design of drainage systems.

GENERAL SITE GRADING:

It is imperative that no clearing and/or grading operations be performed without the presence of a representative of the geotechnical engineer. An on-site pre-job meeting with the developer, the contractor, and the geotechnical engineer should occur prior to all grading-related operations. Operations undertaken at the site without the geotechnical engineer present may result in exclusions of affected areas from the final compaction report for the project.



Grading of the subject site should be performed, at a minimum, in accordance with these recommendations and with applicable portions of the CBC. The following recommendations are presented for your assistance in establishing proper grading criteria.

INITIAL SITE PREPARATION:

All areas to be graded should be stripped of significant vegetation, and other deleterious materials. These materials should be removed from the site for disposal. Any existing utility lines and/or other underground structures should be traced, removed, and rerouted from the grading areas.

All fill encountered during this investigation and any existing undocumented fill or loose disturbed soils encountered during construction should be completely removed, cleaned of significant deleterious materials, and may be reused as compacted fill. Deleterious materials encountered at this time should be removed and replaced with compacted fill.

To assist in undocumented fill identification and removal, it is our opinion that a minimum depth of 18 inches of existing soil below the existing ground surface within the building areas and other areas to be graded should be completely removed and cleaned of significant deleterious materials.

The removed soils may be reused as compacted fill. Deeper fills and/or deeper disturbed native soils requiring complete removal are expected to exist and should be anticipated. The bottom of this excavation should be observed by the engineering geologist to verify the complete removal of undocumented fill material and disturbed native soils. Following approval, the bottom soils should be scarified to a depth of approximately 12 inches, brought to between optimum moisture content and 2 percent above, and recompact to at least 95 percent relative compaction (ASTM D 1557) prior to refilling the excavation to grade as properly compacted fill.

Cavities created by removal of subsurface obstructions such as utility lines should be thoroughly cleaned of loose soil, organic matter, and other deleterious materials, shaped to provide access for construction equipment, and backfilled as recommended for site fill. A lean sand cement slurry may be considered to fill void areas difficult to compact.



PREPARATION OF FILL AREAS:

Prior to placing fill and after the mandatory subexcavation operation, observation, and approval by the engineering geologist, the surface of all soil areas to receive fill should be scarified to a depth of approximately 12 inches. The scarified soils should be brought to between optimum moisture content and 2 percent above and recompacted to a relative compaction of at least 95 percent in accordance with ASTM D 1557.

PREPARATION OF FOOTING AREAS:

All footings should either rest upon at least 18 inches of properly compacted fill material. Foundations should not be permitted to span from soil to bedrock.

In areas where the required thickness of compacted fill is not accomplished by the mandatory subexcavation operation, the footing areas should be subexcavated to a depth of at least 18 inches below the proposed footing base grade. The subexcavation should horizontally extend beyond the footing lines a minimum distance of 5 feet at the base of the excavation. The soils in the bottom of this excavation should then be scarified to a depth of at least 12 inches, brought to between optimum moisture content and 2 percent above, and recompacted to at least 95 percent relative compaction in accordance with ASTM D 1557 prior to refilling the excavation to grade as properly compacted fill.


ROCK DISPOSAL:

Current building codes require that rocks or other irreducible material greater than 12 inches in maximum dimension not be placed in fill within 10 feet of final grade. Boulders greater than 12 inches in dimension should not be placed in site fills except in areas designated as "rock disposal areas". Such "rock disposal areas" should be non-buildable areas below the depth of 10 feet.

In order to properly compact soils in "rock disposal areas", the rock should be placed in windrows, in such a manner as to avoid nesting and to allow access for compaction equipment. The oversized material should be placed in lifts, alternating with lifts of soil without oversized material. Continuous observation by the geotechnical engineer should be provided to confirm that adequate compaction is achieved in such areas. A typical rock disposal detailed is included in Appendix "D".

COMPACTED FILLS:

The on-site soils should provide adequate quality fill material provided they are free from roots, other organic matter, and deleterious materials. Unless approved by the geotechnical engineer, rock or similar

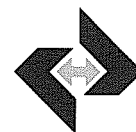

irreducible material with a maximum dimension greater than 12 inches should not be buried or placed in fills.

Although not anticipated, import fill should be inorganic, non-expansive granular soil free from rocks or lumps greater than 6 inches in maximum dimension. Sources for import fill should be observed and approved by the geotechnical engineer prior to their use.

Fill should be spread in near-horizontal layers, approximately 8 inches in thickness. Thicker lifts may be approved by the geotechnical engineer if testing indicates that the grading procedures are adequate to achieve the required compaction. Each lift should be spread evenly, thoroughly mixed during spreading to attain uniformity of the material and moisture in each layer, brought to between optimum moisture content and 2 percent above, and compacted to a minimum relative compaction of 95 percent in accordance with ASTM D 1557.


Based upon the relative compaction of the soils tested during this investigation, the relative compaction anticipated for compacted fill soils, we estimate a compaction shrinkage of approximately 5 to 10 percent. Therefore, 1.05 to 1.10 cubic yards of in-place soil material would be necessary to yield 1 cubic yard of properly compacted fill material. In addition, we would anticipate subsidence of approximately 0.1 foot. These values are exclusive of losses due to stripping, or the removal of other subsurface obstructions, if encountered, and may vary due to differing conditions within the project boundaries and the limitations of this investigation.

Shrinkage is not anticipated for the granitic bedrock material when utilized as fill. The bedrock, when excavated and used as for fill material, is anticipated to have a bulking effect on the order of 5 percent.

The values presented for shrinkage and subsidence are estimates only. Final grades should be adjusted, and/or contingency plans to import or export material should be made to accommodate possible variations in actual quantities during site grading.

SUBDRAINAGE:

Since a potential for shallow, perched groundwater exists on the site, the need for subdrains should be evaluated by the geotechnical engineer during grading.

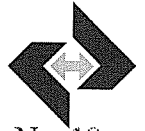

EXPANSIVE SOILS:

Since most of the upper materials encountered during this investigation were generally granular and considered to be non-critical expansive, and clay bearing soils tested for expansion (UBC 18.2) indicated a "very low" potential, specialized construction procedures to specifically resist expansive soil forces are not anticipated at this time. Additional evaluation of soils for expansion potential should be conducted by the geotechnical engineer during the construction operation.

FOUNDATION DESIGN:


If the site is prepared as recommended, the proposed structures may be safely founded on conventional spread foundations, either individual spread footings and/or continuous wall footings, bearing on a minimum of 18 inches of compacted fill or embedded into competent bedrock. Footings should be a minimum of 12 inches wide and should be established at a minimum depth of 12 inches below lowest adjacent final subgrade level. For the minimum width and depth, footings may be designed for a maximum safe soil bearing pressure of 2,300 pounds per square foot for dead plus live loads. This allowable bearing pressure may be increased by 200 psf for each additional foot of width and by 500 psf for each additional foot of depth to a maximum safe soil bearing pressure of 3,500 psf for dead plus live loads. These bearing values may be increased by one-third for wind or seismic loading.

For footings thus designed and constructed, we would anticipate a maximum settlement of less than 1 inch. Differential settlement between similarly loaded adjacent footings is expected to be approximately half the total settlement.

LATERAL LOADING:

Resistance to lateral loads will be provided by passive earth pressure and base friction. For footings bearing against compacted fill or approved native soils, passive earth pressure may be considered to be developed at a rate of 375 psf per foot of depth. Base friction may be computed at 0.35 times the normal load. Base friction and passive earth pressure may be combined without reduction.

For preliminary retaining wall or shoring design purposes, a lateral active earth pressure developed at a rate of 35 psf per foot of depth should be utilized for unrestrained conditions. For restrained conditions, an at-rest earth pressure of 60 psf per foot of depth should be utilized. Surcharge can be treated as additional height of backfill. Assume one additional foot for every 125 psf of areal surcharge. These values should be verified prior to construction when the backfill materials and conditions have

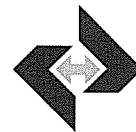

been determined and are applicable only to level properly drained backfill with no additional surcharge loadings. If inclined backfills are proposed, this firm should be contacted to develop appropriate active earth pressure parameters.

Foundation concrete should be placed in neat excavations with vertical sides, or the concrete should be formed and the excavations properly backfilled as recommended for site fill.

SLABS-ON-GRADE:

To provide adequate support, concrete slabs-on-grade should bear on a minimum of 18 inches of compacted soil. The soil should be compacted to 90 percent relative compaction. The final pad surfaces should be rolled to provide smooth, dense surfaces upon which to place the aggregate or gravel.

Slabs to receive moisture-sensitive coverings should be provided with a moisture vapor retarder. We recommend that a vapor retarder be designed and constructed according to the American Concrete Institute (ACI) 302.1R, Guide for Concrete Floor and Slab Construction, which addresses moisture vapor retarder construction. At a minimum, the vapor retarder should comply with ASTM E 1745 and have a nominal thickness of at least 10 mils. The vapor retarder should be properly sealed per the manufacturers recommendations and protected from punctures and other damage. One inch of sand under the vapor retarder may assist in reducing punctures.

If heavy slab loading such as materials storage and/or forklift traffic is anticipated, building slabs should be designed by a Registered Civil Engineer competent in concrete design.

POTENTIAL EROSION:

The potential for erosion should be mitigated by proper drainage design. Water should not be allowed to flow over graded areas or natural areas so as to cause erosion. Graded areas should be protected from erosion by wind or water.

PRELIMINARY PAVEMENT DESIGN:

As a part of this investigation, samples of probable pavement subgrade soils were returned to the laboratory for analysis. An R-value test was performed on a representative sample. Based on the results of the testing, we are providing preliminary recommendations for asphalt concrete (AC) and Portland cement concrete (PCC) pavement structural section design.



PRELIMINARY ASPHALT PAVEMENT DESIGN:

<u>Street</u>	<u>T.I.</u>	<u>Recommended Street Section</u>
Parking Areas	5.0	0.25' AC/0.45' AB
Truck Parking and Drive Traffic Areas	8.0	0.40' AC/0.85' AB

The above structural sections are predicated upon proper compaction of the utility trench backfills and the subgrade soils, with the upper 6 inches of subgrade soils and all aggregate base material brought to a relative compaction of at least 95 percent (ASTM D 1557) prior to paving. The aggregate base should meet Caltrans requirements for Class 2 base.

PRELIMINARY CONCRETE PAVEMENT DESIGN:

Based upon an R-value of 31, which correlates to a modulus of subgrade reaction of approximately 140 pounds per square inch per inch (k), we recommend the following PCC pavement designs. This design is based upon the American Concrete Institute (ACI) Guide for Design and Construction of Concrete Parking Lots (ACI 330R-01).

<u>Design Area</u>	<u>Recommended Section</u>
Car Parking and Access Lanes ADTT = 0 (Category A)	4.0" PCC/Compacted Soil
Truck Parking Areas Multiple Units ADTT = 100 (Category C)	7.0" PCC/Compacted Soil

The above recommended concrete sections are based on a design life of 20 years, with integral curbs or thickened edges. In addition, the above structural sections are predicated upon proper compaction of the utility trench backfills and the subgrade soils, with the upper 12 inches of subgrade soils brought to a uniform relative compaction of 95 percent (ASTM 1557).

Thickened edges or integral curbs should be utilized to strengthen the edges of the slabs to enhance load-carrying capacity. Thickened edges should be thickened 2 inches at the outside edge and tapered to 36 inches back from the edge. Typical details are given in the referenced ACI publication. Thickened edges



should only be necessary in areas where vehicles are allowed to travel from the new pavement to an existing slab, or from the new slab to soil, or asphalt concrete pavement.

The concrete sections may be placed directly over a compacted subgrade prepared as described above. The concrete to be utilized for the concrete pavement should have a minimum modulus of rupture of 550 pounds per square inch. This approximates a 28-day compressive strength of approximately 3,650 pounds per square inch. However, the design strength should be based upon the flexural strength (M_R) and not the compressive strength. Contraction joints should be sawcut in the pavement at maximum spacing of 30 times the thickness of the slab, up to a maximum of 15 feet. Sawcutting in the pavement should be performed within 12 hours of concrete placement, or preferably sooner. Sawcut depths should be equal to approximately one-quarter of the slab thickness for conventional saws or 1 inch when early-entry saws are utilized on slabs 9 inches thick or less. The use of plastic strips for formation of jointing is not recommended. The use of expansion joints is not recommended, except where the pavement will adjoin structures. Construction joints should be placed such that adjacent sections butt directly against each other and are keyed into each other or the joints are properly doweled with smooth dowels. It should be noted that distributed steel reinforcement (welded wire fabric) is not necessary, nor will any decrease in section thickness result from its inclusion.

The above pavement designs are based upon the results of preliminary sampling and testing, and should be verified by additional sampling and testing during construction when the actual pavement subgrade soils are exposed. In addition, if different ADTTs, traffic categories or concrete strengths are to be utilized, this firm should be contacted in order to provide revised recommendations.

C.H.J., Incorporated does not practice traffic engineering. The ADTTs used to develop the recommended PCC pavement sections are typical for projects of this type. We recommend that the ADTTs used be reviewed by the project civil engineer or traffic engineer to verify that they are appropriate for this project.

CHEMICAL/CORROSIVITY TESTS:

A selected sample of material was delivered to our corrosion consultant, Anaheim Test Laboratory. Laboratory testing consisted of pH, resistivity, and major soluble salts commonly found in soils. The results of the laboratory tests appear in Appendix "C". These tests have been performed in order to provide a preliminary screening of the site for potentially corrosive soils.



Values obtained indicate that the soils tested are considered potentially moderately corrosive to corrosive to ferrous metals.

Results of the soluble sulfate testing indicate a "negligible" anticipated exposure to sulfate attack, as indicated in Appendix "C". Based upon the criteria from Table 4.3.4. of the American Concrete Institute Manual of Concrete Practice (2000), no special measures, such as specific cement types, water-cement ratios, etc., will be needed for this "negligible" exposure to sulfate attack.

Soluble chloride content of soil was not at levels high enough to be of concern with respect to corrosion of reinforcing steel. The results should be considered in combination with the soluble chloride content of the hardened concrete in determining the effect of chloride on the corrosion of reinforcing steel.


C.H.J., Incorporated does not practice corrosion engineering. If further information concerning the corrosion characteristics, or interpretation of the results submitted herein, are required, then a competent corrosion engineer could be consulted.

CONSTRUCTION OBSERVATION:

All grading operations, including site clearing and stripping, should be observed by a representative of the geotechnical engineer. The presence of the geotechnical engineer's field representative will be for the purpose of providing observation and field testing, and will not include any supervising or directing of the actual work of the contractor, his employees, or agents. Neither the presence of the geotechnical engineer's field representative nor the observations and testing by the geotechnical engineer shall excuse the contractor in any way for defects discovered in his work. It is understood that the geotechnical engineer will not be responsible for job or site safety on this project, which will be the sole responsibility of the contractor.

LIMITATIONS

C.H.J., Incorporated has striven to perform our services within the limits prescribed by our client, and in a manner consistent with the usual thoroughness and competence of reputable geotechnical engineers and engineering geologists practicing under similar circumstances. No other representation, express or implied, and no warranty or guarantee is included or intended by virtue of the services performed or reports, opinion, documents, or otherwise supplied.

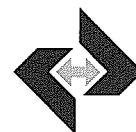

This report reflects the testing conducted on the site as the site existed during the investigation, which is the subject of this report. However, changes in the conditions of a property can occur with the passage of time, due to natural processes or the works of man on this or adjacent properties. Changes in applicable or appropriate standards may also occur whether as a result of legislation, application, or the broadening of knowledge. Therefore, this report is indicative of only those conditions tested at the time of the subject investigation, and the findings of this report may be invalidated fully or partially by changes outside of the control of C.H.J., Incorporated. This report is therefore subject to review and should not be relied upon after a period of one year.

The conclusions and recommendations in this report are based upon observations performed and data collected at separate locations, and interpolation between these locations, carried out for the project and the scope of services described. It is assumed and expected that the conditions between locations observed and/or sampled are similar to those encountered at the individual locations where observation and sampling were performed. However, conditions between these locations may vary significantly. Should conditions be encountered in the field, by the client or any firm performing services for the client or the client's assign, that appears different from those described herein, this firm should be contacted immediately in order that we might evaluate their effect.

If this report or portions thereof are provided to contractors or included in specifications, it should be understood by all parties that they are provided for information only and should be used as such.

The report and its contents resulting from this investigation are not intended or represented to be suitable for reuse on extensions or modifications of the project, or for use on any other project.





CLOSURE

We appreciate this opportunity to be of service and trust this report provides the information desired at this time. Should questions arise, please do not hesitate to contact this office at your convenience.

Respectfully submitted,
C.H.J., INCORPORATED


Ben Williams, P.G. 7542
Senior Staff Geologist

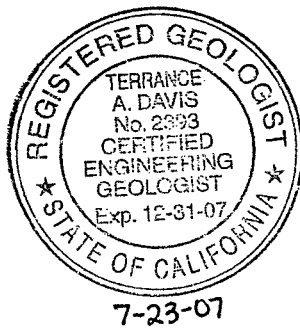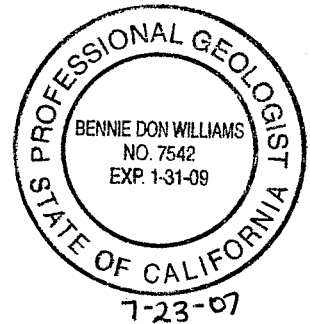

Terrance A. Davis, E.G. 2393
Project Geologist

Allen D. Evans, G.E. 2060
Vice President



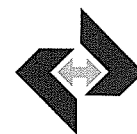

REFERENCES

- American Concrete Institute, 2000, Manual of Concrete Practice, Part 3, Table 4.3.1.
- American Concrete Institute Guide for Design and Construction of Concrete Parking Lots (ACI 330R-92).
- Abrahamson, N.A., and Silva, W. J., Empirical response spectral attenuation relations for shallow crustal earthquakes, *Seismological Research Letters*, 68(1).
- Boore, D.M., Joyner, W.B., and Fumal, T.E., 1997, Equations for estimating horizontal response spectra and peak acceleration from western North American earthquakes: A summary of recent work: *Seismological Research Letters*, v. 68, no. 1, January/February 1997, p. 128-153.
- Caterpillar Tractor Company, 1992, Caterpillar Performance Handbook, 23rd Edition.
- Dickinson, W. R., 1996, Kinematics of transrotational tectonism in the California Transverse Ranges and its contribution to cumulative slip along the San Andreas transform fault system: *Geological Society of America Special Paper* 305.
- Epi Software, 2000, Epicenter Plotting Program.
- Fumal, T.E., Pezzopane, S.K., Weldon, R.J., and Schwartz, D.P., 1993, A 100-year average recurrence interval for the San Andreas fault at Wrightwood, California: *Science*, v. 259, p. 199-203.
- International Conference of Building Officials, 2001, California Building Code, 2001 Edition: Whittier, California.
- Jacoby, J.C., Sheppard, P.R., and Sieh, K.E., 1987, Irregular recurrence of large earthquakes along the San Andreas fault: Evidence from trees, *in Earthquake geology, San Andreas fault system, Palm Springs to Palmdale: Association of Engineering Geologists, Southern California Section, 35th Annual Meeting, Guidebook and Reprint Volume.*
- Johnson, J.A., Blake, T.F., Schmid, B.L., and Slosson, J.E., 1992, Earthquake site analysis and critical facility siting: Short Course, Association of Engineering Geologists, Annual Meeting, October 2-9, 1992.
- Matti, J.C., and Carson, S.E., 1991, Liquefaction susceptibility in the San Bernardino Valley and vicinity, southern California - A regional evaluation: *U.S. Geological Survey Bulletin* 1898.
- Matti, J.C., Morton, D.M., and Cox, B.F., 1992, The San Andreas fault system in the vicinity of the central Transverse Ranges province, Southern California: *U.S. Geological Survey Open File Report* 92-354.
- Mitchell, J.K., and Katti, R.I., 1981, Soil Improvement State of the Art Report: Proceedings, Tenth International Conference of Soil Mechanics and Foundation Engineering, Stockholm, General Reports, p. 264.
- Morton, D.M. 1978, Geologic map of the San Bernardino South Quadrangle, San Bernardino and Riverside Counties, California. *U.S. Geological Survey Open-File Report* 78-20. Scale: 1:24,000.



REFERENCES

Morton, D.M., 1999, Preliminary Geologic Map of the Santa Ana 30 minute by 60 minute Quadrangle, California, U.S. Geological Survey Open-File Report 99-172. Scale: 1:100,000.

Morton, D.M., and Cox, B.F., 2001, Geologic Map of the Riverside East Quadrangle, Riverside County, California: U.S. Geological Survey Open-File Report 01-452. Scale 1:24,000.

Morton, D.M. and Matti, J.C., 1993, Extension and contraction within an evolving divergent strike slip fault complex: The San Andreas and San Jacinto fault zones at their convergence in Southern California: *in* Powell, R.E. and others, The San Andreas Fault System: Palinspastic Reconstruction, and Geologic Evolution: Geological Society of America Memoir 178.

Petersen, M.D., Bryant, W.A., Cramer, C.H., Cao, T., Reichle, M.S., Frankel, A.D., Leinkaemper, J.J., McCrory, P.A., and Schwartz, D.P., 1996, Probabilistic seismic hazard assessment for the State of California: California Division of Mines and Geology Open-File Report 96-08.

Risk Engineering, 2007, EZFRISK computer program, v.7.22.

Rockwell, T.K., McElwain, R.S., Millman, D.E., and Lamar, D.L., 1986, Recurrent Late Holocene faulting on the Glen Ivy North strand of the Elsinore fault at Glen Ivy marsh, *in* Ehlig, P.L., ed., Neotectonics and Faulting in Southern California, Guidebook and Volume, 82nd Annual Meeting, Cordilleran Section, Geological Society of America.

Rogers, T.H., 1966, Geologic map of California, Olaf P. Jenkins edition, Santa Ana Sheet: California Division of Mines and Geology. Scale: 1:250,000.

Sadigh, K., Chang, C.-Y., Egan, J. A., Makdisi, F., and Youngs, R. R., 1997, Attenuation relations for shallow crustal earthquakes based on California strong motion data, *Seismological Research Letters*, 68(1).

Saul, R., 1978, Elsinore Fault Zone (South Riverside County Segment) with Description of the Murrieta Hot Springs Fault: California Division of Mines and Geology Fault Evaluation Report 76.

Stone, E.L., Grant, L.B., and Arrowsmith, J.R., 2002, Recent rupture history of the San Andreas fault southeast of Cholame in the northern Carrizo Plain, California: *Seismological Society of America Bulletin*, v. 92, no. 3, pp. 983-997.

Terzaghi, K., and Peck, R.B., 1967, *Soil Mechanics in Engineering Practice*: John Wiley, New York, 729 p., p. 347.

Weber, F.H., 1977, Seismic hazards related to geologic factors, Elsinore and Chino fault zones, northwestern Riverside County, California: California Division of Mines and Geology Open-File Report 77-04. Scale: 1:24,000.

Wills, C.J., 1988, Ground Cracks in Wolf and Temecula Valleys, Riverside County: California Division of Mines and Geology Fault Evaluation Report 195.

Woodford, A.O., Shelton, F.S., Doehring, D.O., and Morton, R.K., 1971, Pliocene - Pleistocene history of the Perris block, southern California: *Geological Society of America Bulletin*, v. 82, p. 3421-3448.



REFERENCES

Working Group on California Earthquake Probabilities, 1988, Probabilities of large earthquakes occurring in California on the San Andreas fault: U.S. Geological Survey Open-File Report 88-398.

Working Group on California Earthquake Probabilities, 1995, Seismic hazards in southern California: Probable earthquakes, 1994 to 2024: Bulletin of the Seismological Society of America, v. 85, no. 2, p. 379-439.



AERIAL PHOTOGRAPHS REVIEWED

Riverside County Flood Control and Water Conservation District, January 28, 1962, Black and White Aerial Photograph Numbers 1-100 and 1-101.

Riverside County Flood Control and Water Conservation District, May 24, 1974, Black and White Aerial Photograph Numbers 160, and 161.




Riverside County Flood Control and Water Conservation District, February 7, 1984, Black and White Aerial Photograph Numbers 1522 and 1523.

Riverside County Flood Control and Water Conservation District, January 23, 1990, Black and White Aerial Photograph Numbers 5-24 and 5-25.

Riverside County Flood Control and Water Conservation District, January 28, 1995, Black and White Aerial Photograph Numbers 4-21 and 4-22.




APPENDIX "A"
GEOTECHNICAL MAPS

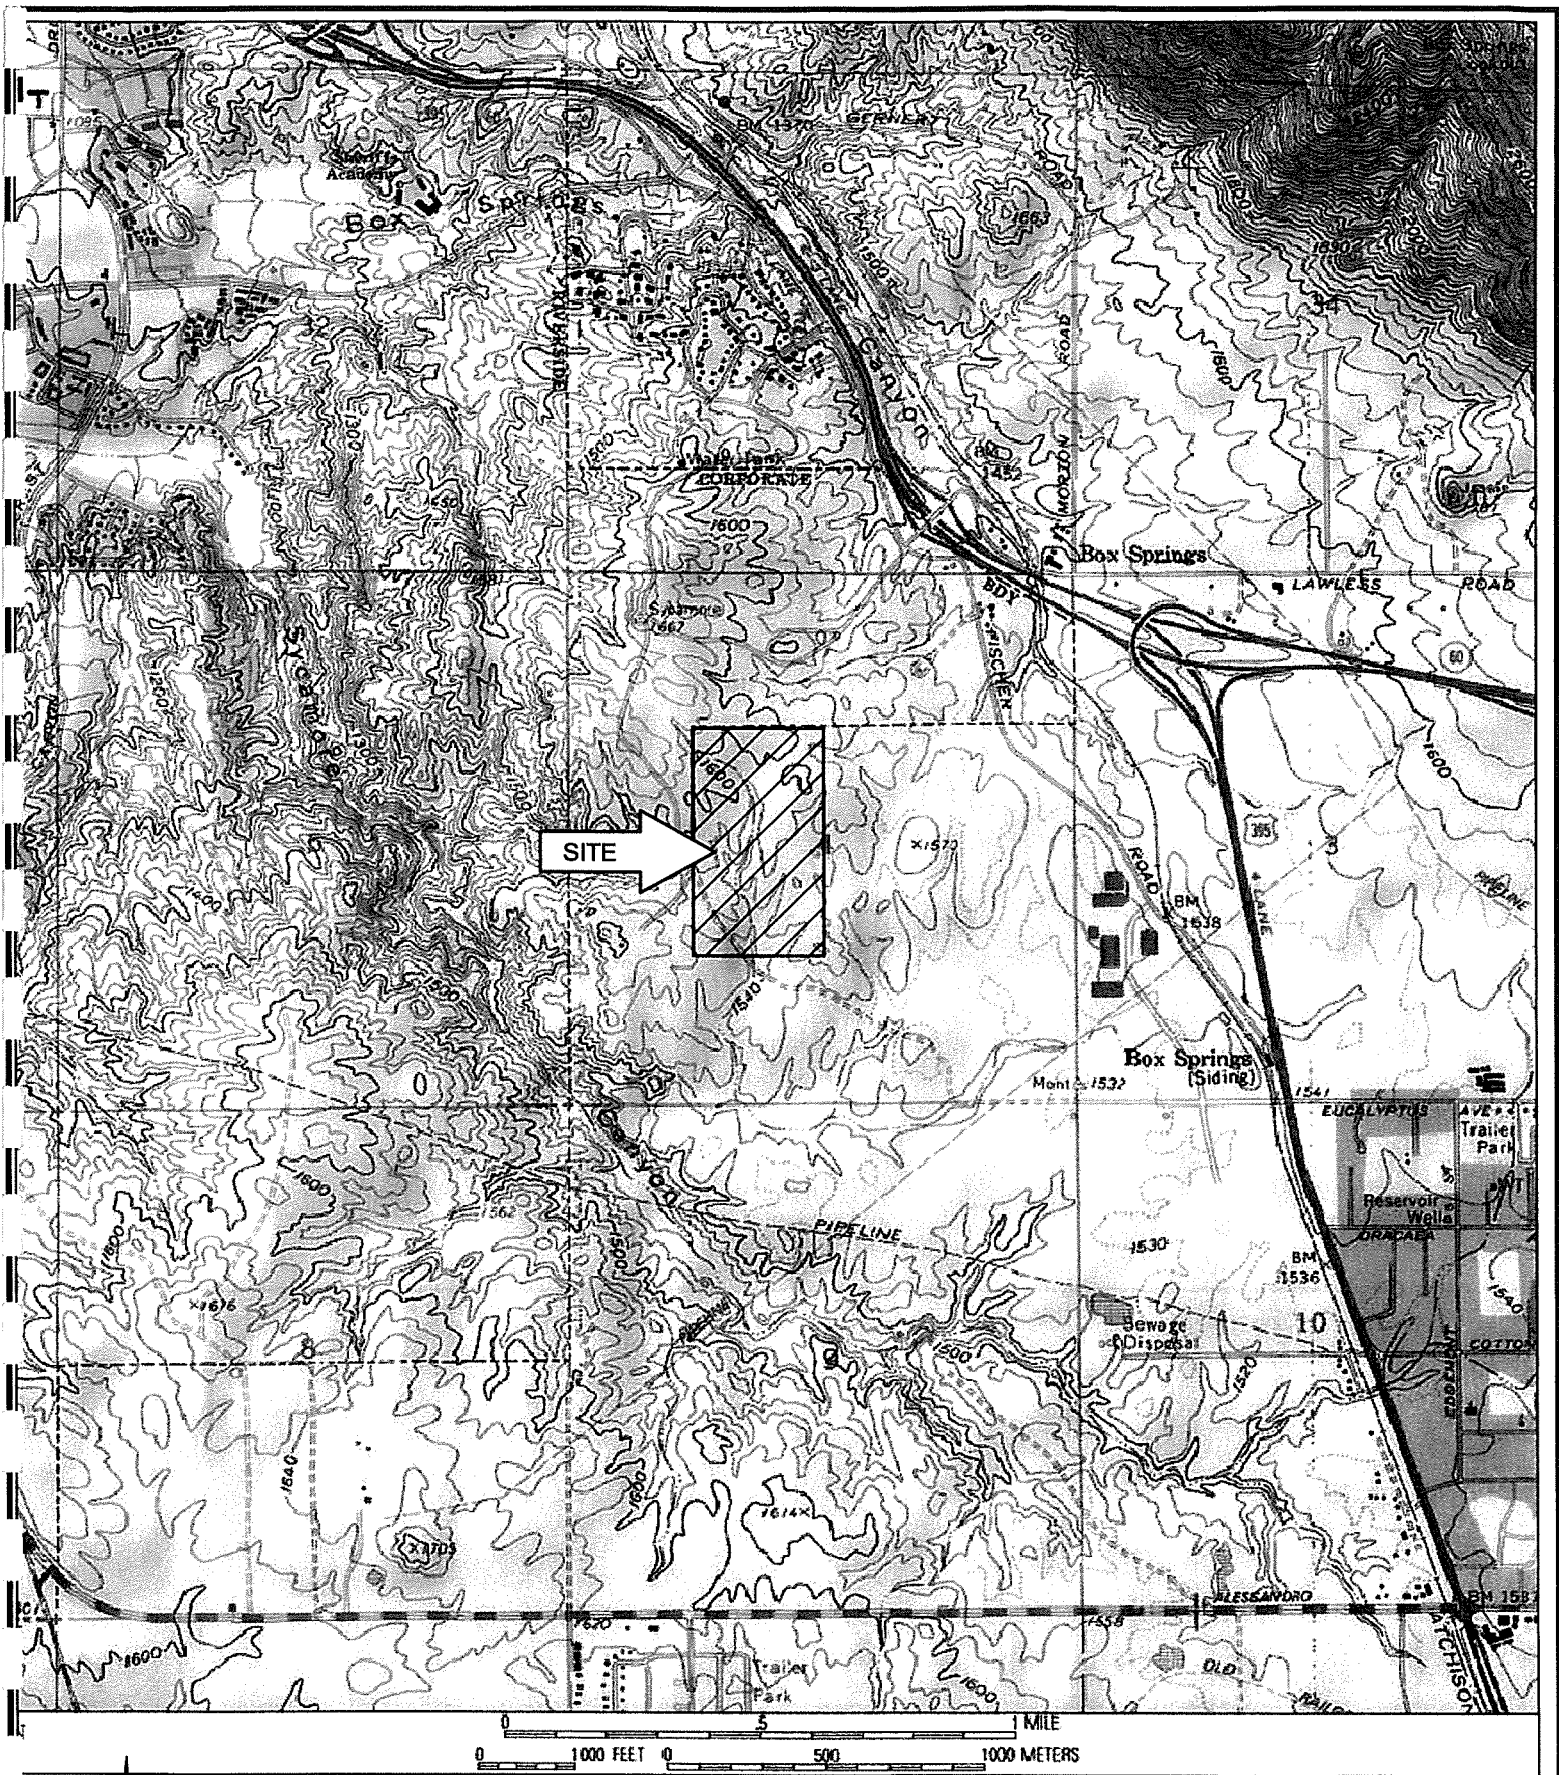

SCALE: 1" = 2,000'

INDEX MAP		
FOR: THE MAGNON COMPANIES	PROPOSED INDUSTRIAL DEVELOPMENT NORTHWEST OF INTERSECTION OF LANCE DRIVE AND SIERRA RIDGE DRIVE RIVERSIDE, CALIFORNIA	ENCLOSURE "A-1"
DATE: JULY 2007		JOB NUMBER 07489-3

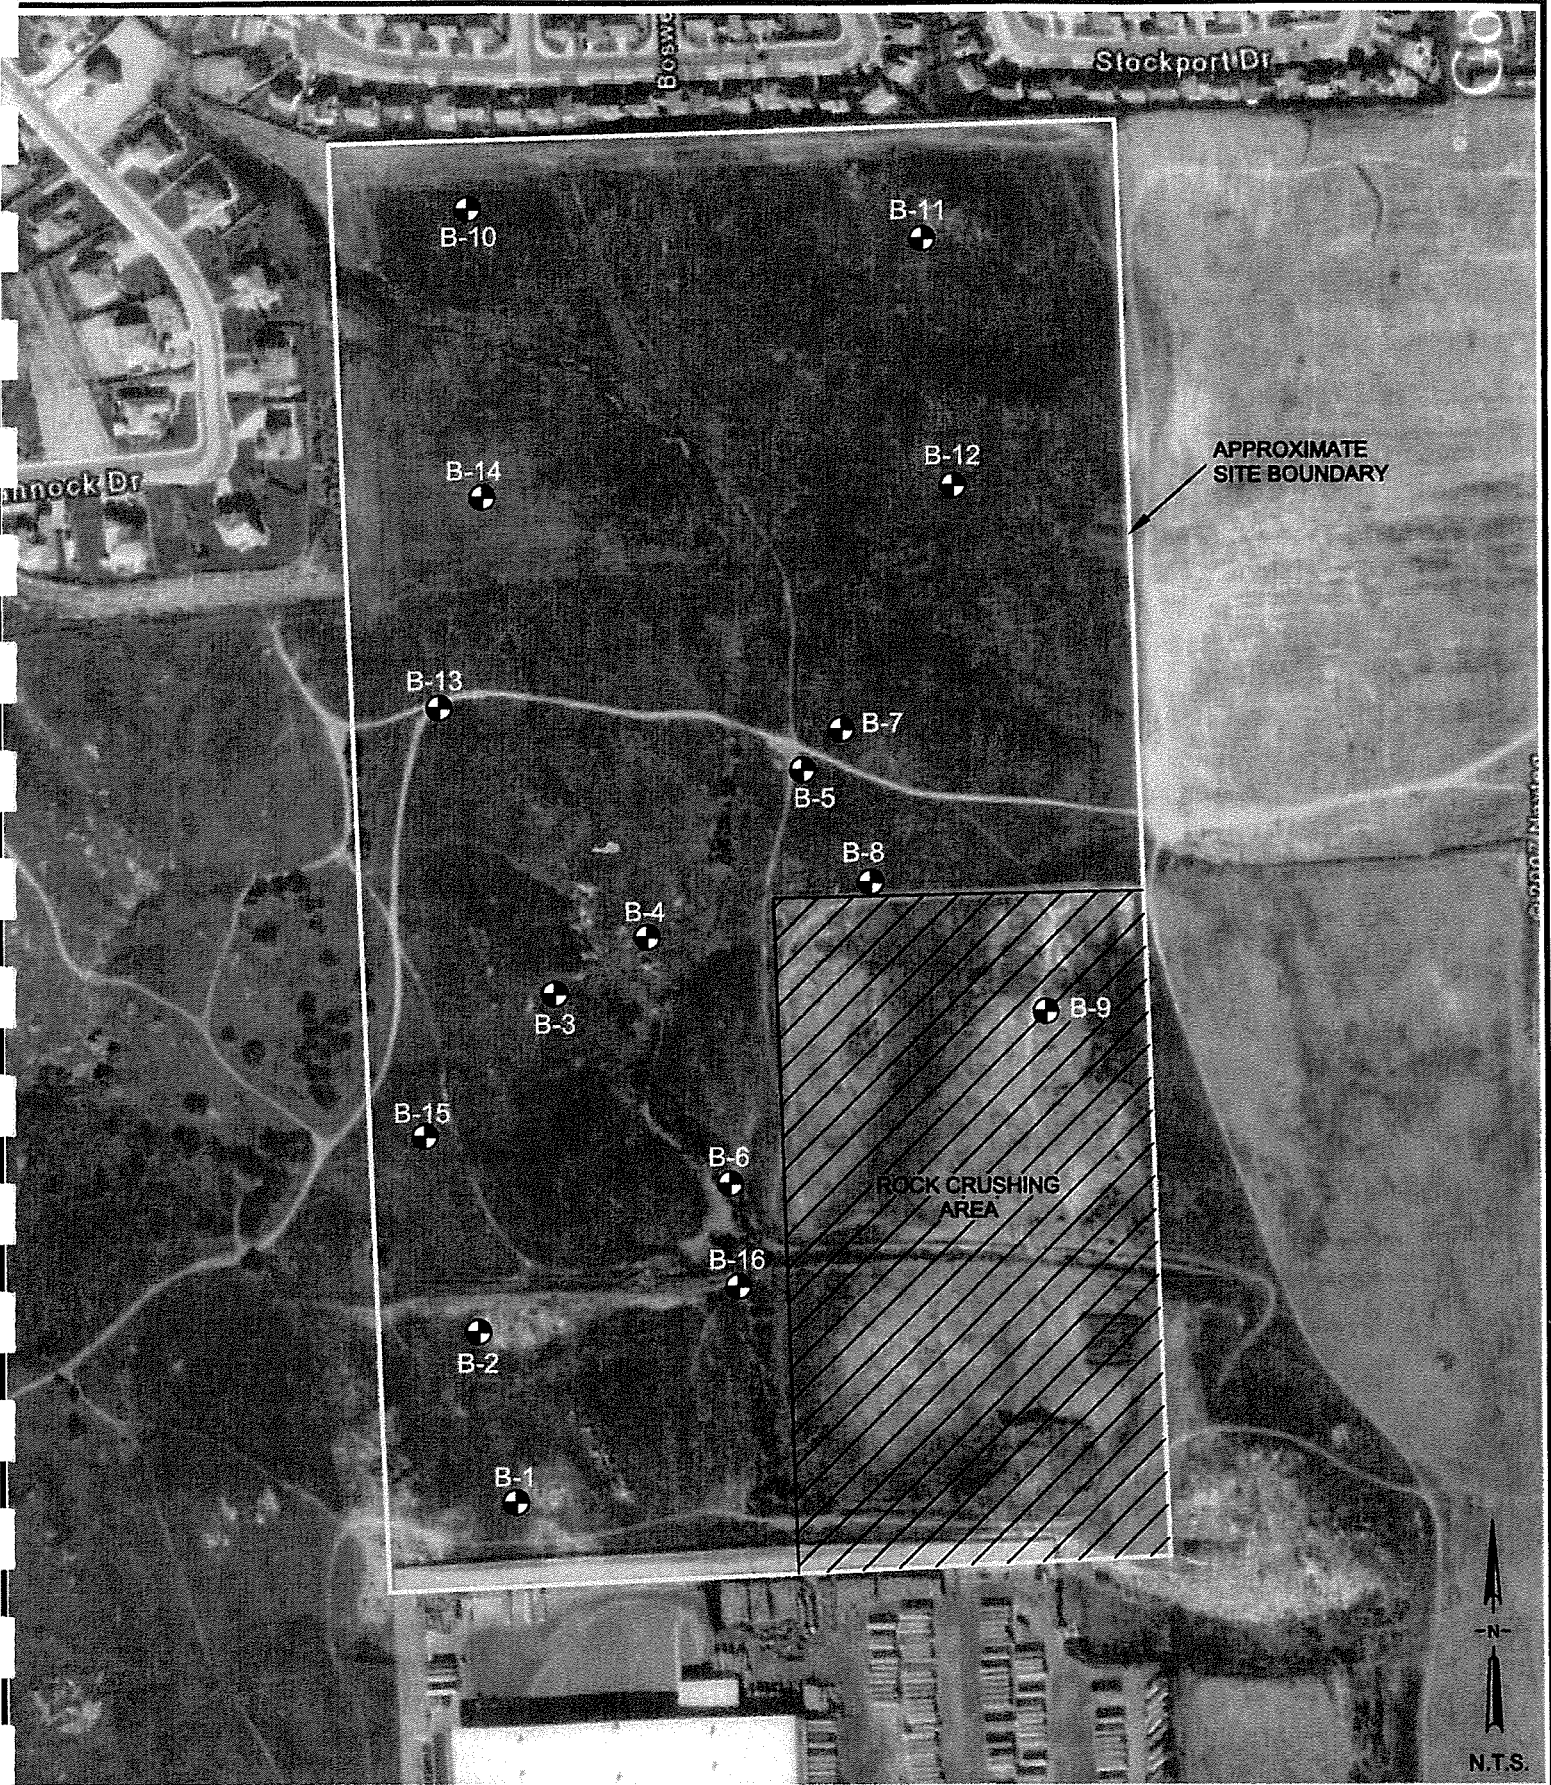

LEGEND:


B-16  APPROXIMATE LOCATION OF EXPLORATORY BORING

PLAT

FOR:
THE MAGNON COMPANIES
 DATE:
 JULY 2007

PROPOSED INDUSTRIAL DEVELOPMENT
 NORTHWEST OF INTERSECTION OF LANCE DRIVE
 AND SIERRA RIDGE DRIVE
 RIVERSIDE, CALIFORNIA


ENCLOSURE
"A-2"
 JOB NUMBER
 07489-3

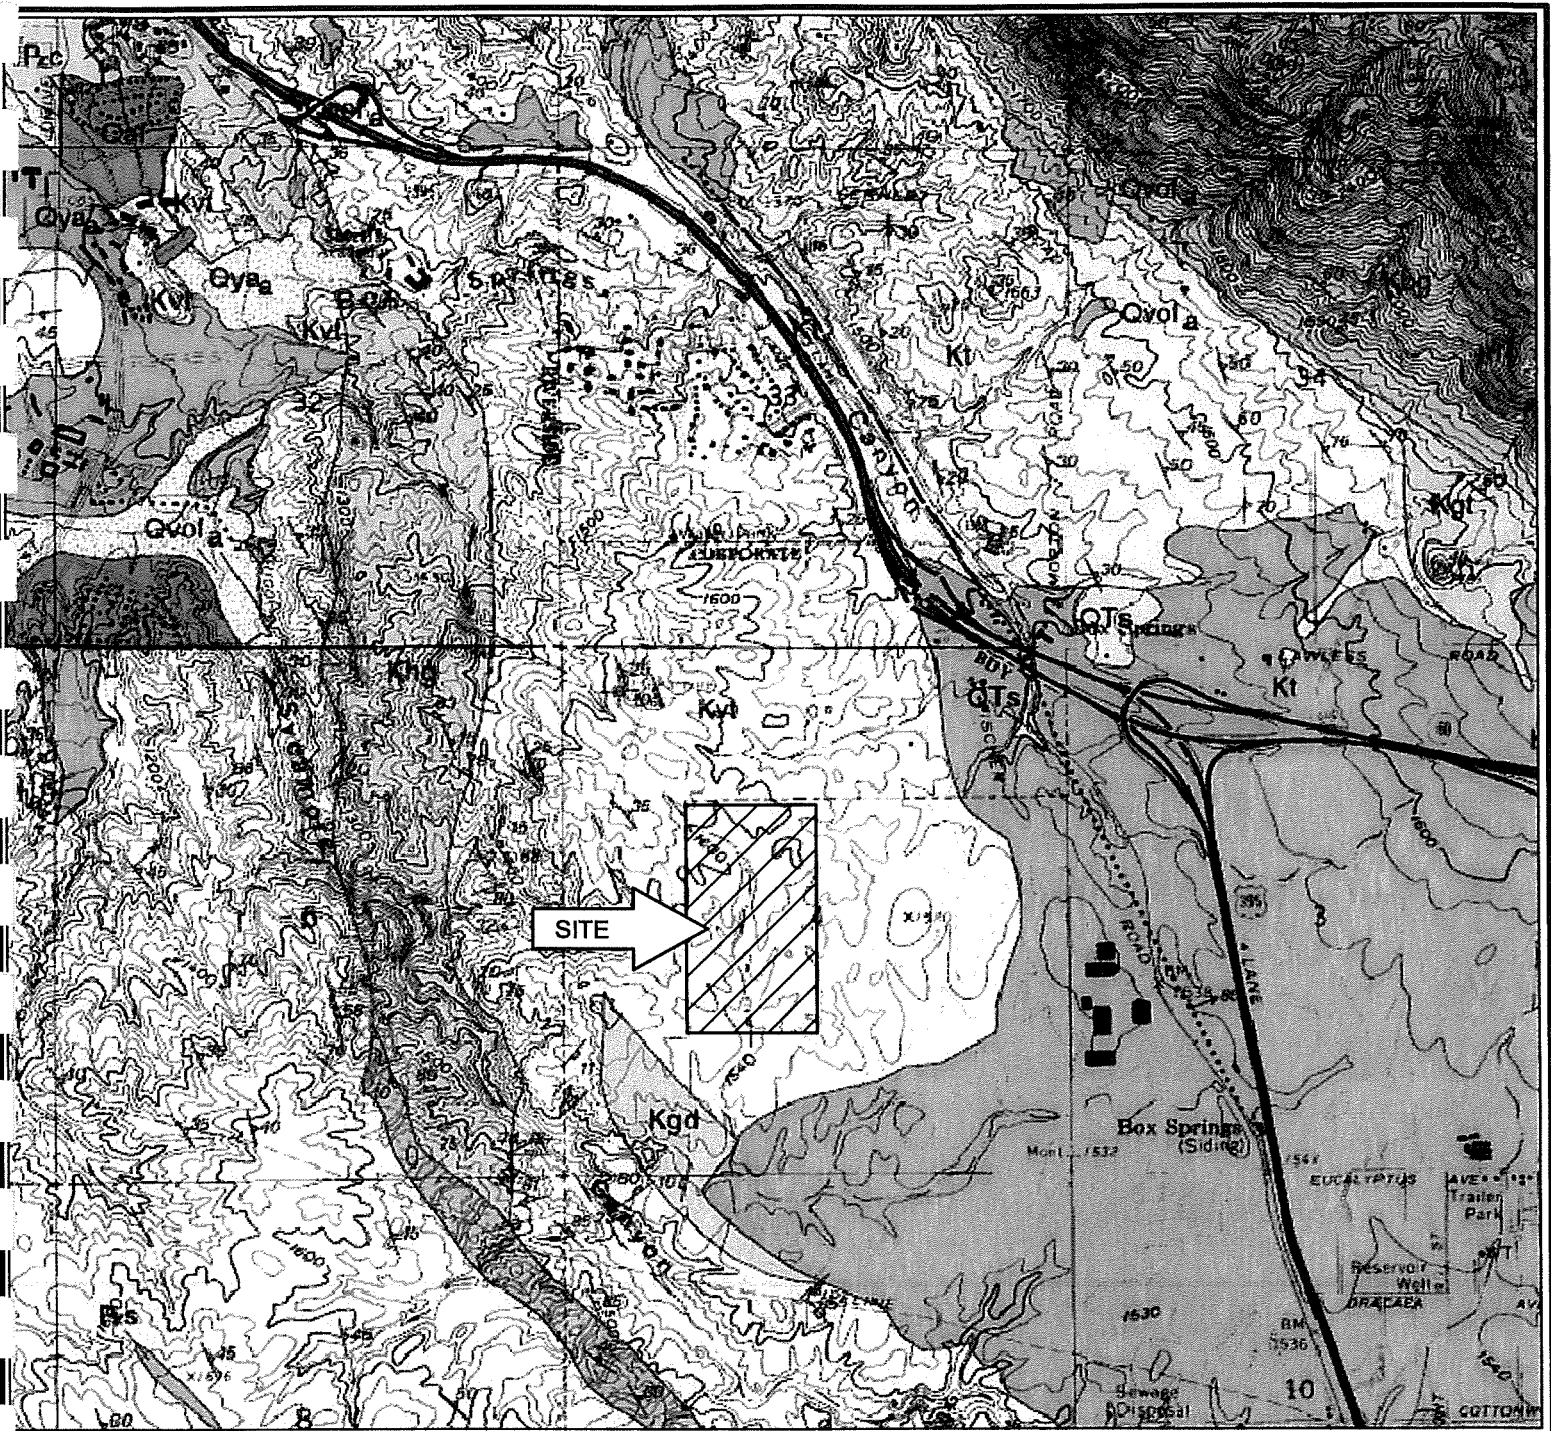

GEOLOGIC UNITS:


- Qvol - Very old alluvial fan deposits (early Pleistocene)
- Kvt - Val Verde tonalite (Cretaceous)
- Kgd - Granodiorite, undifferentiated (Cretaceous)
- Khg - Heterogeneous granitic rocks (Cretaceous)

~~~~~ geologic contact



SCALE: 1" = 2,000'

| <b>GEOLOGIC INDEX MAP</b>           |                                                                                                                                |                              |
|-------------------------------------|--------------------------------------------------------------------------------------------------------------------------------|------------------------------|
| FOR:<br><b>THE MAGNON COMPANIES</b> | PROPOSED INDUSTRIAL DEVELOPMENT<br>NORTHWEST OF INTERSECTION OF LANCE DRIVE<br>AND SIERRA RIDGE DRIVE<br>RIVERSIDE, CALIFORNIA | ENCLOSURE<br><b>"A-3"</b>    |
| DATE:<br><b>JULY 2007</b>           |                                                                                                                                | JOB NUMBER<br><b>07489-3</b> |
|                                     |                                                                                                                                | <b>C.H.J. Incorporated</b>   |

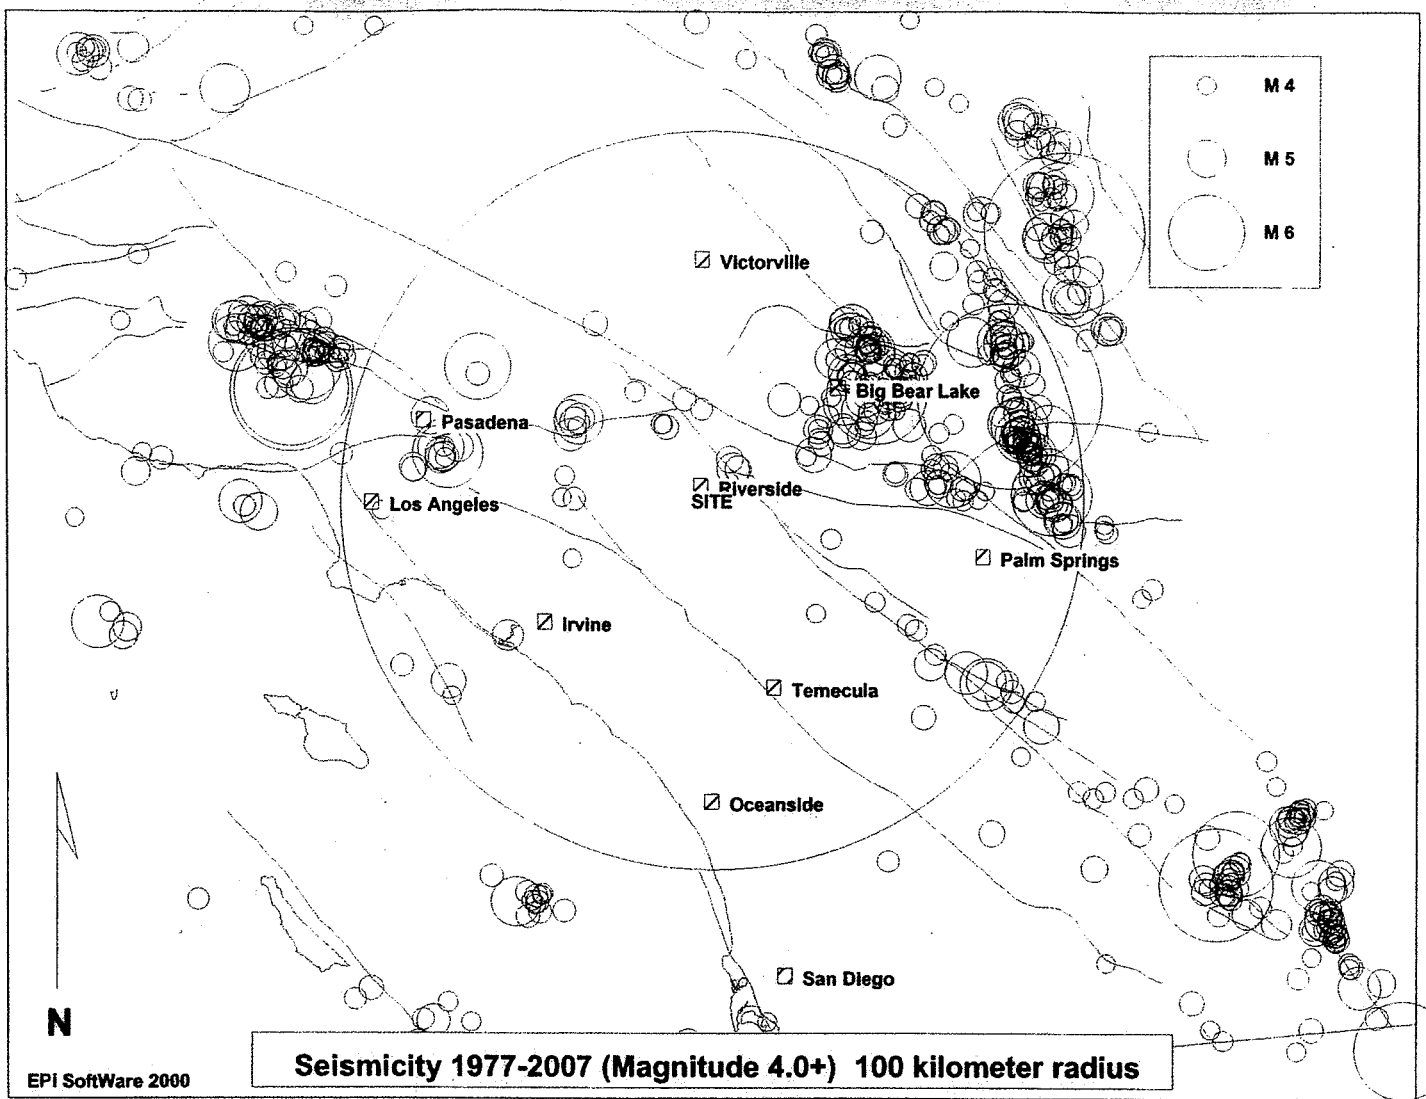

**SITE LOCATION: 33.944 LAT. -117.306 LONG.**

**MINIMUM LOCATION QUALITY: C**

**TOTAL # OF EVENTS ON PLOT: 602**

**TOTAL # OF EVENTS WITHIN SEARCH RADIUS 281**


**MAGNITUDE DISTRIBUTION OF SEARCH RADIUS EVENTS:**

4.0-4.9: 248  
 5.0-5.9: 30  
 6.0-6.9: 2  
 7.0-7.9: 1  
 8.0-8.9: 0

**CLOSEST EVENT: 4.8 ON WEDNESDAY, OCTOBER 02, 1985 LOCATED APPROX 10 KILOMETERS NORTHEAST OF THE SITE**

**LARGEST 5 EVENTS:**

7.3 ON SUNDAY, JUNE 28, 1992 LOCATED APPROX. 84 KILOMETERS EAST OF THE SITE  
 6.4 ON SUNDAY, JUNE 28, 1992 LOCATED APPROX. 52 KILOMETERS NORTHEAST OF THE SITE  
 6.1 ON THURSDAY, APRIL 23, 1992 LOCATED APPROX 91 KILOMETERS EAST OF THE SITE  
 5.9 ON THURSDAY, OCTOBER 01, 1987 LOCATED APPROX 72 KILOMETERS WEST OF THE SITE  
 5.8 ON FRIDAY, JUNE 28, 1991 LOCATED APPROX 72 KILOMETERS NORTHWEST OF THE SITE




## EARTHQUAKE EPICENTER MAP

|                                     |                                                                                                                                |                              |
|-------------------------------------|--------------------------------------------------------------------------------------------------------------------------------|------------------------------|
| FOR:<br><b>THE MAGNON COMPANIES</b> | PROPOSED INDUSTRIAL DEVELOPMENT<br>NORTHWEST OF INTERSECTION OF LANCE DRIVE<br>AND SIERRA RIDGE DRIVE<br>RIVERSIDE, CALIFORNIA | ENCLOSURE<br><b>"A-4"</b>    |
| DATE:<br><b>JULY 2007</b>           |                                                                                                                                | JOB NUMBER<br><b>07489-3</b> |
|                                     |                                                                                                                                |                              |



**APPENDIX "B"**  
**EXPLORATORY LOGS**



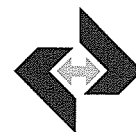

Enclosure "B" (1 of 2)  
Job No. 07489-3

### KEY TO LOGS

#### LEGEND OF LAB/FIELD TESTS:

- Bulk Indicates Disturbed or Bulk Sample
- Cor. Chemical/Corrosivity Tests
- Dist. Indicates Disturbed Sample
- DS Direct Shear Test (ASTM D 3080)
- MDC Maximum Density Optimum Moisture Determination (ASTM D 1557)
- Ring Indicates Undisturbed Ring Sample. Undisturbed Ring Samples are obtained with a ring sampler (3.25" O.D. and 2.42" I.D.) driven with a 140-pound weight falling 30 inches. The blows per foot are converted to equivalent SPT values.
- SA Sieve Analysis (ASTM C 136)
- SE Sand Equivalent (ASTM D 2419)
- SPT Indicates Standard Penetration Test sampler utilized. The SPT N-value is the number of blows required to drive an SPT sampler 12 inches using a 140 pound weight falling 30 inches. The SPT sampler is 2" O.D. and 1-3/8" I.D.

# SOIL CLASSIFICATION CHART

| MAJOR DIVISIONS                                              | GRAPH SYMBOL | LETTER SYMBOL | TYPICAL DESCRIPTIONS                                                                                               |
|--------------------------------------------------------------|--------------|---------------|--------------------------------------------------------------------------------------------------------------------|
| GRAVEL AND GRAVELLY SOILS                                    |              | GW            | WELL-GRADED GRAVELS, GRAVEL-SAND MIXTURES, LITTLE OR NO FINES                                                      |
|                                                              |              | GP            | POORLY-GRADED GRAVELS, GRAVEL-SAND MIXTURES, LITTLE OR NO FINES                                                    |
| SAND AND SANDY SOILS                                         |              | GM            | SILTY GRAVELS, GRAVEL-SAND-SILT MIXTURES                                                                           |
|                                                              |              | GC            | CLAYEY GRAVELS, GRAVEL-SAND-CLAY MIXTURES                                                                          |
| CLEAN SAND (LITTLE OR NO FINES)                              |              | SW            | WELL-GRADED SANDS, GRAVELLY SANDS, LITTLE OR NO FINES                                                              |
|                                                              |              | SP            | POORLY-GRADED SANDS, GRAVELLY SANDS, LITTLE OR NO FINES                                                            |
| SANDS WITH FINES (APPRECIABLE AMOUNT OF FINES)               |              | SM            | SILTY SANDS, SAND-SILT MIXTURES                                                                                    |
|                                                              |              | SC            | CLAYEY SANDS, SAND-CLAY MIXTURES                                                                                   |
| SILTS AND CLAYS                                              |              | ML            | INORGANIC SILTS AND VERY FINE SANDS, ROCK FLOUR, SILTY OR CLAYEY FINE SANDS OR CLAYEY SILTS WITH SLIGHT PLASTICITY |
|                                                              |              | CL            | INORGANIC CLAYS OF LOW TO MEDIUM PLASTICITY, GRAVELLY CLAYS, SANDY CLAYS, SILTY CLAYS, LEAN CLAYS                  |
| HIGHLY ORGANIC SOILS                                         |              | OL            | ORGANIC SILTS AND ORGANIC SILTY CLAYS OF LOW PLASTICITY                                                            |
|                                                              |              | MH            | INORGANIC SILTY, MICACEOUS OR DIATOMACEOUS FINE SAND OR SILTY SOILS                                                |
| FINE GRAINED SOILS                                           |              | CH            | INORGANIC CLAYS OF HIGH PLASTICITY, FAT CLAYS                                                                      |
|                                                              |              | OH            | ORGANIC CLAYS OF MEDIUM TO HIGH PLASTICITY, ORGANIC SILTS                                                          |
| MORE THAN 50% OF MATERIAL IS SMALLER THAN NO. 200 SIEVE SIZE |              | PT            | PEAT, HUMUS, SWAMP SOILS WITH HIGH ORGANIC CONTENTS                                                                |


## GRADATION CHART

| MATERIAL SIZE                    | PARTICLE SIZE |            |             |            |
|----------------------------------|---------------|------------|-------------|------------|
|                                  | LOWER LIMIT   |            | UPPER LIMIT |            |
|                                  | MILLIMETERS   | SIEVE SIZE | MILLIMETERS | SIEVE SIZE |
| SAND<br>FINE<br>MEDIUM<br>COARSE | 0.75          | #200x      | 0.42        | #40 x      |
|                                  | 0.42          | #40 x      | 2.00        | #10 x      |
|                                  | 200           | #10 x      | 4.76        | #4 x       |
| GRAVEL<br>FINE<br>COARSE         | 4.76          | #4 X       | 191         | 3/4" •     |
|                                  | 191           | 3/4" •     | 76.2        | 3" •       |
| COBBLES<br>BOULDERS              | 76.2          | 3"         | 304.8       | 12"        |
|                                  | 304.8         | 12         | 914.4       | 36"        |

• CLEAR SQUARE OPENINGS

x US STANDARD

## PLASTICITY CHART

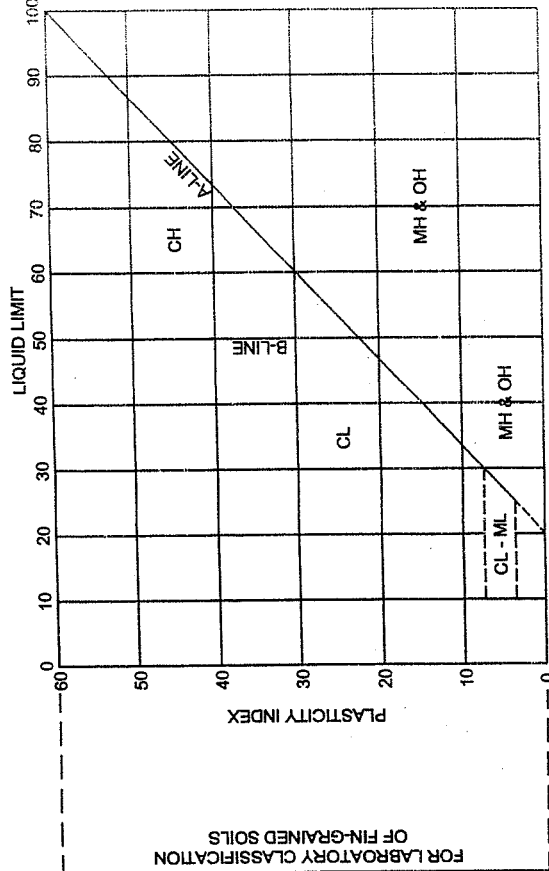

UNIFIED SOIL CLASSIFICATION SYSTEM



# EXPLORATORY BORING NO. 1

Date Drilled: 7/5/07

Client: The Magnon Companies

Equipment: CME 55 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation (Ft.): 1556.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                              | REMARKS        | SAMPLES |      | BLOWS/FOOT<br>(Equiv. SPT) | FIELD<br>MOISTURE (%) | DRY UNIT WT.<br>(pcf) | LAB/FIELD<br>TESTS |
|------------|-------------|------------------------------------------------------------------------------------|----------------|---------|------|----------------------------|-----------------------|-----------------------|--------------------|
|            |             |                                                                                    |                | DRIVE   | BULK |                            |                       |                       |                    |
|            |             | (SM) Silty Sand, fine to coarse, light brown                                       | Native Bedrock |         |      | 50/2"                      | 0.9                   | dist.                 | Bulk Ring          |
| 5          |             | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         |                |         |      | 50/2"                      | N.R.                  | N.R.                  | Ring               |
| 10         |             |                                                                                    |                |         |      |                            |                       |                       |                    |
| 15         |             |                                                                                    |                |         |      |                            |                       |                       | Bulk               |
| 20         |             |                                                                                    |                |         |      |                            |                       |                       |                    |
| 25         |             |                                                                                    |                |         |      |                            |                       |                       |                    |
| 30         |             |                                                                                    |                |         |      |                            |                       |                       |                    |
| 35         |             |                                                                                    |                |         |      |                            |                       |                       |                    |
|            |             | END OF BORING                                                                      | Refusal        |         |      |                            |                       |                       |                    |
| 40         |             | BEDROCK AT 0.5', REFUSAL AT 37.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |                |         |      |                            |                       |                       |                    |
| 45         |             |                                                                                    |                |         |      |                            |                       |                       |                    |

BORING LOG 50 FT. 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No. 07489-3

Enclosure  
**B-1**

# EXPLORATORY BORING NO. 2

Date Drilled: 7/5/07

Client: The Magnon Companies




Equipment: CME 55 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1566.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG                                                                        | VISUAL CLASSIFICATION                                                              | REMARKS        | SAMPLES                                                                             |                                                                                       | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|------------------------------------------------------------------------------------|------------------------------------------------------------------------------------|----------------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|-------------|--------------------|--------------------|-----------------|
|            |                                                                                    |                                                                                    |                | DRIVE                                                                               | BULK                                                                                  |             |                    |                    |                 |
|            |                                                                                    | (SM) Silty Sand, fine to coarse, light brown                                       | Native Bedrock |                                                                                     |                                                                                       |             |                    |                    | Bulk            |
| 5          |  | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         |                |                                                                                     |                                                                                       | 50/2"       | 0.9                | 117                | Ring            |
| 10         |                                                                                    |                                                                                    |                |  |                                                                                       | 50          | N.R.               | N.R.               | Ring            |
| 15         |                                                                                    |                                                                                    |                |                                                                                     |  |             |                    |                    | Bulk            |
| 20         |                                                                                    | END OF BORING                                                                      | Refusal        |                                                                                     |                                                                                       |             |                    |                    |                 |
| 25         |                                                                                    | BEDROCK AT 0.5', REFUSAL AT 19.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |                |                                                                                     |                                                                                       |             |                    |                    |                 |
| 30         |                                                                                    |                                                                                    |                |                                                                                     |                                                                                       |             |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No. 07489-3  
Enclosure B-2

# EXPLORATORY BORING NO. 3

Date Drilled: 7/5/07

Client: The Magnon Companies

Equipment: CME 55 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1576.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG                                                                       | VISUAL CLASSIFICATION | REMARKS | SAMPLES |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS              |
|------------|-----------------------------------------------------------------------------------|-----------------------|---------|---------|------|-------------|--------------------|--------------------|------------------------------|
|            |                                                                                   |                       |         | DRIVE   | BULK |             |                    |                    |                              |
|            | (SM) Silty Sand, fine to medium with coarse, red brown                            |                       | Native  | X       | X    |             |                    |                    |                              |
|            | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown        |                       | Bedrock | X       |      | 15<br>50    | 2.8                | 125                | Bulk, SA,<br>MDC, DS<br>Ring |
| 5          | END OF BORING                                                                     |                       | Refusal |         |      | 50/2"       | N.R.               | N.R.               | Ring                         |
| 10         | BEDROCK AT 1.5', REFUSAL AT 6.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |                       |         |         |      |             |                    |                    |                              |
| 15         |                                                                                   |                       |         |         |      |             |                    |                    |                              |
| 20         |                                                                                   |                       |         |         |      |             |                    |                    |                              |
| 25         |                                                                                   |                       |         |         |      |             |                    |                    |                              |
| 30         |                                                                                   |                       |         |         |      |             |                    |                    |                              |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.      Enclosure  
07489-3      B-3

# EXPLORATORY BORING NO. 4

Date Drilled: 7/5/07

Client: The Magnon Companies


Equipment: CME 55 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1569.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG                                                                       | VISUAL CLASSIFICATION                                                         | REMARKS                      | SAMPLES |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-----------------------------------------------------------------------------------|-------------------------------------------------------------------------------|------------------------------|---------|------|-------------|--------------------|--------------------|-----------------|
|            |                                                                                   |                                                                               |                              | DRIVE   | BULK |             |                    |                    |                 |
|            |  | (SM) Silty Sand, fine to coarse, light brown                                  | Native<br>Bedrock<br>Refusal |         |      |             |                    |                    |                 |
|            |                                                                                   | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown    |                              |         |      |             |                    |                    |                 |
|            |                                                                                   | END OF BORING                                                                 |                              |         |      |             |                    |                    |                 |
| 5          |                                                                                   | BEDROCK AT 0.5', REFUSAL AT 1.0'<br>NO FILL, NO CAVING<br>NO FREE GROUNDWATER |                              |         |      |             |                    |                    |                 |
| 10         |                                                                                   |                                                                               |                              |         |      |             |                    |                    |                 |
| 15         |                                                                                   |                                                                               |                              |         |      |             |                    |                    |                 |
| 20         |                                                                                   |                                                                               |                              |         |      |             |                    |                    |                 |
| 25         |                                                                                   |                                                                               |                              |         |      |             |                    |                    |                 |
| 30         |                                                                                   |                                                                               |                              |         |      |             |                    |                    |                 |

BORING LOG - NO ECUIV & BLOW PER 6 IN. 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-4

# EXPLORATORY BORING NO. 5

Date Drilled: 7/5/07

Client: The Magnon Companies

Equipment: CME 55 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1585.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG                                                                | VISUAL CLASSIFICATION                                                              | REMARKS | SAMPLES |      | BLOWS/6 IN.    | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS              |
|------------|----------------------------------------------------------------------------|------------------------------------------------------------------------------------|---------|---------|------|----------------|--------------------|--------------------|------------------------------|
|            |                                                                            |                                                                                    |         | DRIVE   | BULK |                |                    |                    |                              |
|            | (SM) Silty Sand, fine to medium with coarse and clay, red brown            |                                                                                    | Native  | X       | X    | 21<br>35<br>50 | 4.2<br>6.7         | 128                | Bulk, SA, Exp., Cor.<br>Ring |
| 5          | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown |                                                                                    | Bedrock | X       | X    | 50/3"          | 3.0<br>4.0         | dist.              | Bulk<br>Ring                 |
| 10         |                                                                            |                                                                                    |         |         |      |                |                    |                    |                              |
| 15         |                                                                            |                                                                                    |         |         |      |                | 2.5                |                    | Bulk                         |
| 20         |                                                                            |                                                                                    |         |         |      |                |                    |                    |                              |
| 25         |                                                                            | END OF BORING                                                                      | Refusal |         |      |                |                    |                    |                              |
| 30         |                                                                            | BEDROCK AT 4.0', REFUSAL AT 25.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |         |         |      |                |                    |                    |                              |

BORING LOG - NO EQUIV & BLOW PER 6 IN. 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-5

# EXPLORATORY BORING NO. 6

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1559.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                              | REMARKS | SAMPLES |      | BLOWS/6 IN.  | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------|------------------------------------------------------------------------------------|---------|---------|------|--------------|--------------------|--------------------|-----------------|
|            |             |                                                                                    |         | DRIVE   | BULK |              |                    |                    |                 |
|            |             | (SM) Silty Sand, fine to medium with coarse, brown                                 | Native  |         |      |              | 3.1                |                    | Bulk            |
|            |             | (SM) Silty Sand, fine to coarse, brown                                             |         |         |      | 7<br>9<br>13 | 2.9<br>3.2         | 116                | Ring<br>Bulk    |
| 5          |             | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, brown               | Bedrock |         |      | 50/2"        | N.R.               | N.R.               | Ring            |
| 10         |             | END OF BORING                                                                      | Refusal |         |      |              | 2.9                |                    | Bulk            |
|            |             | BEDROCK AT 5.0', REFUSAL AT 10.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |         |         |      |              |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHI.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No. 07489-3

Enclosure B-6



# EXPLORATORY BORING NO. 7

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1588.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                              | REMARKS | SAMPLES |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------|------------------------------------------------------------------------------------|---------|---------|------|-------------|--------------------|--------------------|-----------------|
|            |             |                                                                                    |         | DRIVE   | BULK |             |                    |                    |                 |
|            |             | (SM) Silty Sand, fine to medium with coarse, brown                                 | Native  |         |      |             | 2.5                |                    | Bulk            |
|            |             | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         | Bedrock |         |      | 50/5"       | 2.0                | 118                | Ring            |
| 5          |             |                                                                                    |         |         |      |             | 2.7                |                    | Bulk            |
|            |             |                                                                                    |         |         |      | 50/3"       | 2.4                | dist.              | Ring            |
| 10         |             |                                                                                    |         |         |      |             |                    |                    |                 |
| 15         |             |                                                                                    |         |         |      |             | 3.5                |                    | Bulk            |
| 20         |             |                                                                                    |         |         |      |             |                    |                    |                 |
| 25         |             |                                                                                    |         |         |      |             |                    |                    |                 |
| 30         |             |                                                                                    |         |         |      |             |                    |                    |                 |
|            |             | BEDROCK AT 1.0', REFUSAL AT 33.5'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |         |         |      |             |                    |                    |                 |
|            |             | END OF BORING                                                                      | Refusal |         |      |             |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-7

# EXPLORATORY BORING NO. 8

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1582.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG       | VISUAL CLASSIFICATION                                                              | REMARKS | SAMPLES           |                   | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS         |
|------------|-------------------|------------------------------------------------------------------------------------|---------|-------------------|-------------------|-------------|--------------------|--------------------|-------------------------|
|            |                   |                                                                                    |         | DRIVE             | BULK              |             |                    |                    |                         |
|            | [Hatched Pattern] | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         | Bedrock | [Hatched Pattern] | [Hatched Pattern] |             | 9.3                |                    | Bulk, SA, MDC, DS, Cor. |
| 5          |                   |                                                                                    |         | [Hatched Pattern] | [Hatched Pattern] | 50/3"       | 7.3                | dist.              | Ring                    |
|            |                   |                                                                                    |         | [Hatched Pattern] | [Hatched Pattern] |             | 4.6                |                    | Bulk                    |
|            |                   |                                                                                    |         | [Hatched Pattern] | [Hatched Pattern] | 50/3"       | 2.4                | dist.              | Ring                    |
| 10         |                   |                                                                                    |         | [Hatched Pattern] | [Hatched Pattern] |             | 2.4                |                    | Bulk                    |
| 15         |                   | END OF BORING                                                                      | Refusal |                   |                   |             |                    |                    |                         |
|            |                   | BEDROCK AT 0.0', REFUSAL AT 13.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |         |                   |                   |             |                    |                    |                         |
| 20         |                   |                                                                                    |         |                   |                   |             |                    |                    |                         |
| 25         |                   |                                                                                    |         |                   |                   |             |                    |                    |                         |
| 30         |                   |                                                                                    |         |                   |                   |             |                    |                    |                         |

BORING LOG - NO EQUIV & BLOW PER 6 IN. 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.      Enclosure  
07489-3      B-8

# EXPLORATORY BORING NO. 9

Date Drilled: 7/6/07

Client: The Magnon Companies




Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1576.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG                                                                       | VISUAL CLASSIFICATION                                                                                                                             | REMARKS | SAMPLES                                                                             |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-----------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|---------|-------------------------------------------------------------------------------------|------|-------------|--------------------|--------------------|-----------------|
|            |                                                                                   |                                                                                                                                                   |         | DRIVE                                                                               | BULK |             |                    |                    |                 |
| 5          |  | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown                                                                        | Bedrock |  |      |             | 0.9                |                    | Bulk            |
| 10         |                                                                                   | <p style="text-align: center;">END OF BORING</p> <p>BEDROCK AT 0.0', REFUSAL AT 6.0'</p> <p>NO FILL, SLIGHT CAVING</p> <p>NO FREE GROUNDWATER</p> | Refusal |  |      |             | 1.2                |                    | Bulk            |
| 15         |                                                                                   |                                                                                                                                                   |         |                                                                                     |      |             |                    |                    |                 |
| 20         |                                                                                   |                                                                                                                                                   |         |                                                                                     |      |             |                    |                    |                 |
| 25         |                                                                                   |                                                                                                                                                   |         |                                                                                     |      |             |                    |                    |                 |
| 30         |                                                                                   |                                                                                                                                                   |         |                                                                                     |      |             |                    |                    |                 |

BORING LOG - NO. EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-9

# EXPLORATORY BORING NO. 10

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1610.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                              | REMARKS | SAMPLES |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------|------------------------------------------------------------------------------------|---------|---------|------|-------------|--------------------|--------------------|-----------------|
|            |             |                                                                                    |         | DRIVE   | BULK |             |                    |                    |                 |
|            |             | (SM) Silty Sand, fine to medium with coarse, light brown                           | Native  |         | XXXX |             | 2.0                |                    | Bulk            |
|            |             | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         | Bedrock |         |      | 50/3"       | 1.8                | 115                | Ring            |
| 5          | XXXX        |                                                                                    |         |         | XXXX |             | 1.6                |                    | Bulk            |
|            |             |                                                                                    |         |         |      | 50/2"       | 1.8                | dist.              | Ring            |
| 10         | XXXX        |                                                                                    |         |         |      |             |                    |                    |                 |
| 15         | XXXX        |                                                                                    |         |         | XXXX |             |                    |                    | Bulk            |
| 20         | XXXX        |                                                                                    |         |         |      |             |                    |                    |                 |
|            |             | END OF BORING                                                                      | Refusal |         |      |             |                    |                    |                 |
| 25         |             | BEDROCK AT 1.0', REFUSAL AT 22.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |         |         |      |             |                    |                    |                 |
| 30         |             |                                                                                    |         |         |      |             |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-10

# EXPLORATORY BORING NO. 11

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1604.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG             | VISUAL CLASSIFICATION                                                      | REMARKS | SAMPLES                 |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------------------|----------------------------------------------------------------------------|---------|-------------------------|------|-------------|--------------------|--------------------|-----------------|
|            |                         |                                                                            |         | DRIVE                   | BULK |             |                    |                    |                 |
| 5          | [Cross-hatched pattern] | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown | Bedrock | [Cross-hatched pattern] |      |             | 0.9                |                    | Bulk            |
| 10         | [Cross-hatched pattern] |                                                                            |         |                         |      |             |                    |                    |                 |
| 15         | [Cross-hatched pattern] |                                                                            |         | [Cross-hatched pattern] |      |             | 1.9                |                    | Bulk            |
| 20         |                         | END OF BORING                                                              | Refusal |                         |      |             |                    |                    |                 |
|            |                         | BEDROCK AT 0.0', REFUSAL AT 17.0'                                          |         |                         |      |             |                    |                    |                 |
|            |                         | NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER                              |         |                         |      |             |                    |                    |                 |
| 25         |                         |                                                                            |         |                         |      |             |                    |                    |                 |
| 30         |                         |                                                                            |         |                         |      |             |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-11

# EXPLORATORY BORING NO. 12

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1600.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                              | REMARKS        | SAMPLES  |          | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------|------------------------------------------------------------------------------------|----------------|----------|----------|-------------|--------------------|--------------------|-----------------|
|            |             |                                                                                    |                | DRIVE    | BULK     |             |                    |                    |                 |
|            |             | (SM) Silty Sand, fine to coarse, light brown                                       | Native Bedrock | [Symbol] | [Symbol] | 50/3"       | 2.0                |                    | Bulk Ring       |
|            |             | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         |                | [Symbol] | [Symbol] | 50/3"       | 1.8                |                    |                 |
| 5          | [Symbol]    |                                                                                    |                | [Symbol] | [Symbol] | 50/3"       | 2.5                | dist.              | Ring            |
| 10         | [Symbol]    |                                                                                    |                | [Symbol] | [Symbol] |             |                    |                    |                 |
| 15         | [Symbol]    |                                                                                    |                | [Symbol] | [Symbol] |             | 3.3                |                    | Bulk            |
| 20         | [Symbol]    |                                                                                    |                | [Symbol] | [Symbol] |             |                    |                    |                 |
| 25         | [Symbol]    | END OF BORING                                                                      | Refusal        | [Symbol] | [Symbol] |             | 2.9                |                    | Bulk            |
| 30         | [Symbol]    | BEDROCK AT 0.0', REFUSAL AT 25.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |                |          |          |             |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-12

# EXPLORATORY BORING NO. 13

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1598.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG             | VISUAL CLASSIFICATION                                                              | REMARKS | SAMPLES |      | BLOWS/6 IN.    | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------------------|------------------------------------------------------------------------------------|---------|---------|------|----------------|--------------------|--------------------|-----------------|
|            |                         |                                                                                    |         | DRIVE   | BULK |                |                    |                    |                 |
|            |                         | (SM) Silty Sand, fine to medium with coarse, brown                                 | Native  | X       | X    |                | 3.5                |                    | Bulk            |
| 5          |                         |                                                                                    |         | X       | X    | 14<br>25<br>30 | 3.8                | 111                | Ring            |
|            |                         |                                                                                    |         | X       | X    | 50             | 6.4                | dist.              | Ring            |
| 10         | [Cross-hatched pattern] | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, olive brown         | Bedrock | X       | X    | 18<br>50/4"    | 10.3               | 119                | Ring            |
|            |                         |                                                                                    |         | X       | X    | 9.0            | 9.0                |                    | Bulk            |
| 15         |                         | END OF BORING                                                                      | Refusal |         |      |                |                    |                    |                 |
|            |                         | BEDROCK AT 8.0', REFUSAL AT 14.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |         |         |      |                |                    |                    |                 |
| 20         |                         |                                                                                    |         |         |      |                |                    |                    |                 |
| 25         |                         |                                                                                    |         |         |      |                |                    |                    |                 |
| 30         |                         |                                                                                    |         |         |      |                |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ/GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-13

# EXPLORATORY BORING NO. 14

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1607.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG       | VISUAL CLASSIFICATION                                                              | REMARKS        | SAMPLES |      | BLOWS/6 IN. | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------------|------------------------------------------------------------------------------------|----------------|---------|------|-------------|--------------------|--------------------|-----------------|
|            |                   |                                                                                    |                | DRIVE   | BULK |             |                    |                    |                 |
|            |                   | (SM) Silty Sand, fine to coarse, light brown                                       | Native Bedrock |         |      |             | 2.3                |                    | Bulk            |
|            |                   | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown         |                | X       |      | 40<br>50/3" | 1.8                | 114                | Ring            |
| 5          | [Hatched Pattern] |                                                                                    |                | X       |      | 50/4"       | 3.9                | dist.              | Ring            |
| 10         | [Hatched Pattern] |                                                                                    |                |         | X    |             | 3.3                |                    | Bulk            |
|            |                   | END OF BORING                                                                      | Refusal        |         |      |             |                    |                    |                 |
| 15         |                   | BEDROCK AT 0.5', REFUSAL AT 11.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |                |         |      |             |                    |                    |                 |
| 20         |                   |                                                                                    |                |         |      |             |                    |                    |                 |
| 25         |                   |                                                                                    |                |         |      |             |                    |                    |                 |
| 30         |                   |                                                                                    |                |         |      |             |                    |                    |                 |

BCRING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No. 07489-3

Enclosure B-14



# EXPLORATORY BORING NO. 15

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1574.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                              | REMARKS        | SAMPLES |      | BLOWS/6 IN.       | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------|------------------------------------------------------------------------------------|----------------|---------|------|-------------------|--------------------|--------------------|-----------------|
|            |             |                                                                                    |                | DRIVE   | BULK |                   |                    |                    |                 |
|            |             | (SM) Silty Sand, fine to coarse, light brown                                       | Native Bedrock | X       | X    |                   | 2.2                |                    | Bulk            |
|            |             | Granitic Bedrock, recovered as (SM) Silty Sand, fine to coarse, light brown        |                | X       | X    | 25<br>38<br>50/4" | 2.1                | dist.              | Ring            |
| 5          |             |                                                                                    |                | X       | X    | 50                | 7.1                | 119                | Ring            |
| 10         |             |                                                                                    |                |         | X    |                   | 2.0                |                    | Bulk            |
| 15         |             | END OF BORING                                                                      | Refusal        |         |      |                   |                    |                    |                 |
|            |             | BEDROCK AT 0.5', REFUSAL AT 15.0'<br>NO FILL, SLIGHT CAVING<br>NO FREE GROUNDWATER |                |         |      |                   |                    |                    |                 |
| 20         |             |                                                                                    |                |         |      |                   |                    |                    |                 |
| 25         |             |                                                                                    |                |         |      |                   |                    |                    |                 |
| 30         |             |                                                                                    |                |         |      |                   |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA

Job No.  
07489-3

Enclosure  
B-15

# EXPLORATORY BORING NO. 16

Date Drilled: 7/6/07

Client: The Magnon Companies

Equipment: CME 55/75 Drill Rig

Driving Weight / Drop: 140 lbs./30 in.

Surface Elevation(ft): 1563.0

Logged by: JMZ

Measured Depth to Water(ft): N/A

| DEPTH (ft) | GRAPHIC LOG | VISUAL CLASSIFICATION                                                                     | REMARKS | SAMPLES |      | BLOWS/6 IN.       | FIELD MOISTURE (%) | DRY UNIT WT. (pcf) | LAB/FIELD TESTS |
|------------|-------------|-------------------------------------------------------------------------------------------|---------|---------|------|-------------------|--------------------|--------------------|-----------------|
|            |             |                                                                                           |         | DRIVE   | BULK |                   |                    |                    |                 |
| 5          |             | (SM) Silty Sand, fine to coarse, light brown                                              | Fill    |         |      |                   | 1.2                |                    | Bulk            |
|            |             |                                                                                           |         |         |      | 11<br>19<br>30    | 1.4                | 124                | Ring            |
|            |             |                                                                                           |         |         |      | 9<br>10<br>12     | 4.3                | 124                | Ring            |
| 10         |             | (SM) Silty Sand, fine to coarse, light brown                                              | Native  |         |      |                   | 5.9                |                    | Bulk            |
|            |             |                                                                                           |         |         |      | 6<br>8<br>10      | 7.1                | 119                | Ring            |
| 20         |             | Granitic Bedrock recovered as (SM) Silty Sand, fine to coarse, light brown                | Bedrock |         |      | 12<br>15<br>50/4" | 8.1                | 131                | Ring            |
|            |             |                                                                                           |         |         |      | 50/1"             | N.R.               | N.R.               | N.R.            |
| 25         |             | END OF BORING                                                                             | Refusal |         |      |                   |                    |                    |                 |
| 30         |             | BEDROCK AT 17.5', REFUSAL AT 23.0'<br>FILL TO 11.0', SLIGHT CAVING<br>NO FREE GROUNDWATER |         |         |      |                   |                    |                    |                 |

BORING LOG - NO EQUIV & BLOW PER 6 IN. 07489-3.GPJ CHJ.GDT 7/23/07



**C.H.J.**

PROPOSED INDUSTRIAL DEVELOPMENT  
LANCE AND SIERRA RIDGE DRIVES, RIVERSIDE, CA


Job No.  
07489-3

Enclosure  
B-16



**APPENDIX "C"**  
**LABORATORY TESTING**


Sieve Sizes - U.S.A. Standard Series (ASTM C136)

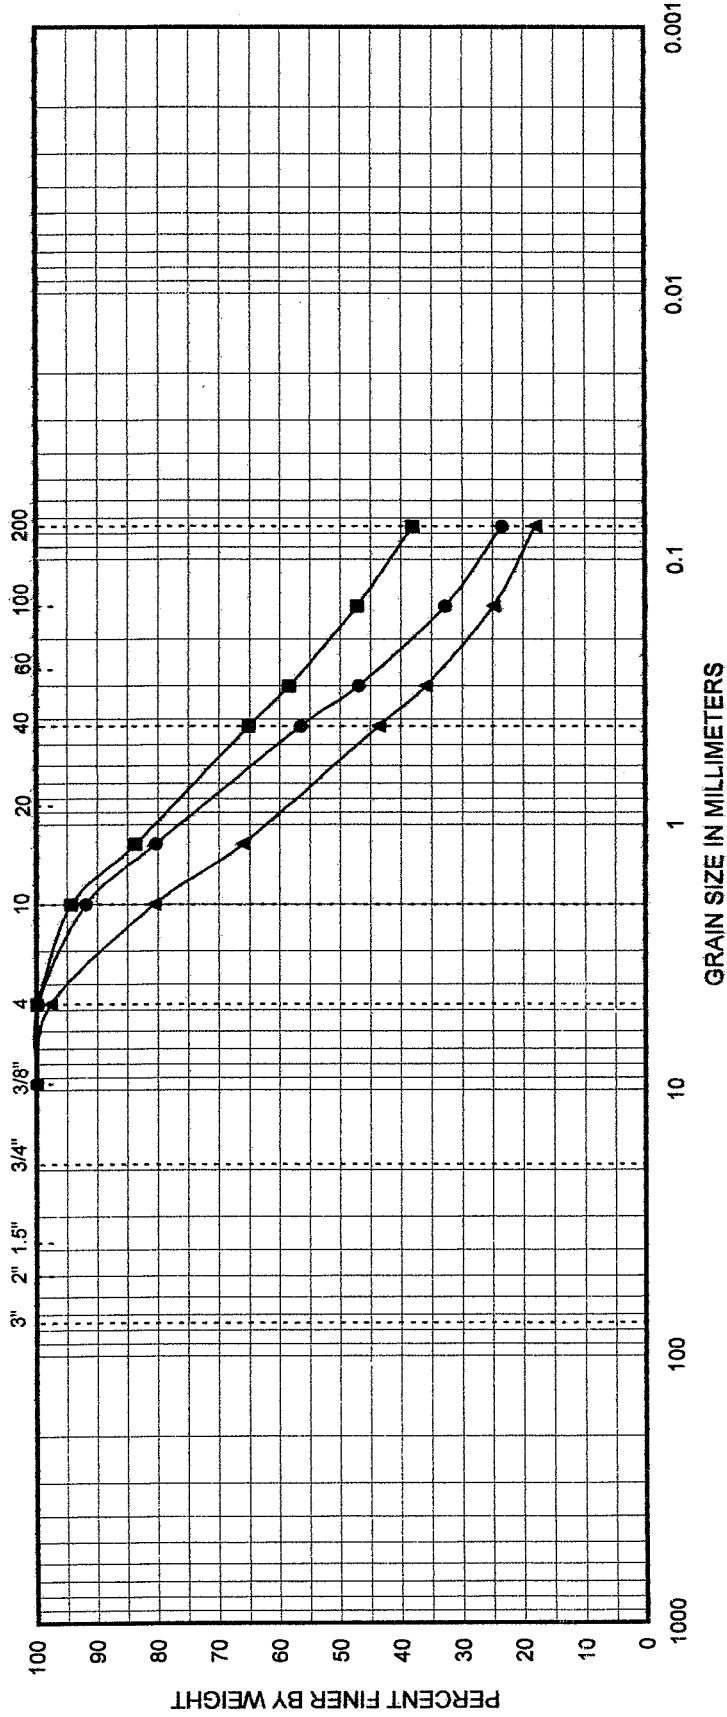


| Symbol | Boring No. | Depth (ft) | Classification                              | Gravel |      |  | Sand   |        |      | Silt                 |                      |                      | Clay                 |                |                |  |  |  |  |
|--------|------------|------------|---------------------------------------------|--------|------|--|--------|--------|------|----------------------|----------------------|----------------------|----------------------|----------------|----------------|--|--|--|--|
|        |            |            |                                             | Coarse | Fine |  | Coarse | Medium | Fine | D <sub>10</sub> (mm) | D <sub>30</sub> (mm) | D <sub>60</sub> (mm) | D <sub>90</sub> (mm) | C <sub>u</sub> | C <sub>c</sub> |  |  |  |  |
| ●      | 3          | 0.5        | (SM) Silty Sand, fine to medium with coarse |        |      |  |        |        |      | 0.122                | 0.335                | 0.494                |                      |                |                |  |  |  |  |
| ■      | 5          | 0.5        | (SM) Silty Sand, fine to medium with coarse |        |      |  |        |        |      |                      | 0.178                | 0.326                |                      |                |                |  |  |  |  |
| ▲      | 8          | 0.5        | (SC) Clayey Sand, fine to coarse            |        |      |  |        |        |      | 0.207                | 0.568                | 0.896                |                      |                |                |  |  |  |  |

**GRAIN SIZE DISTRIBUTION**

|             |                                                |
|-------------|------------------------------------------------|
| Project:    | Industrial Development                         |
| Location:   | NW of Lance and Sierra Ridge Drives, Riverside |
| Job Number: | 07489-3                                        |
| Enclosure:  | C-1                                            |

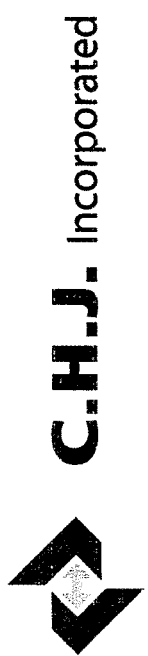

Optimum Moisture - Maximum Density Determination Test (ASTM D 1557)

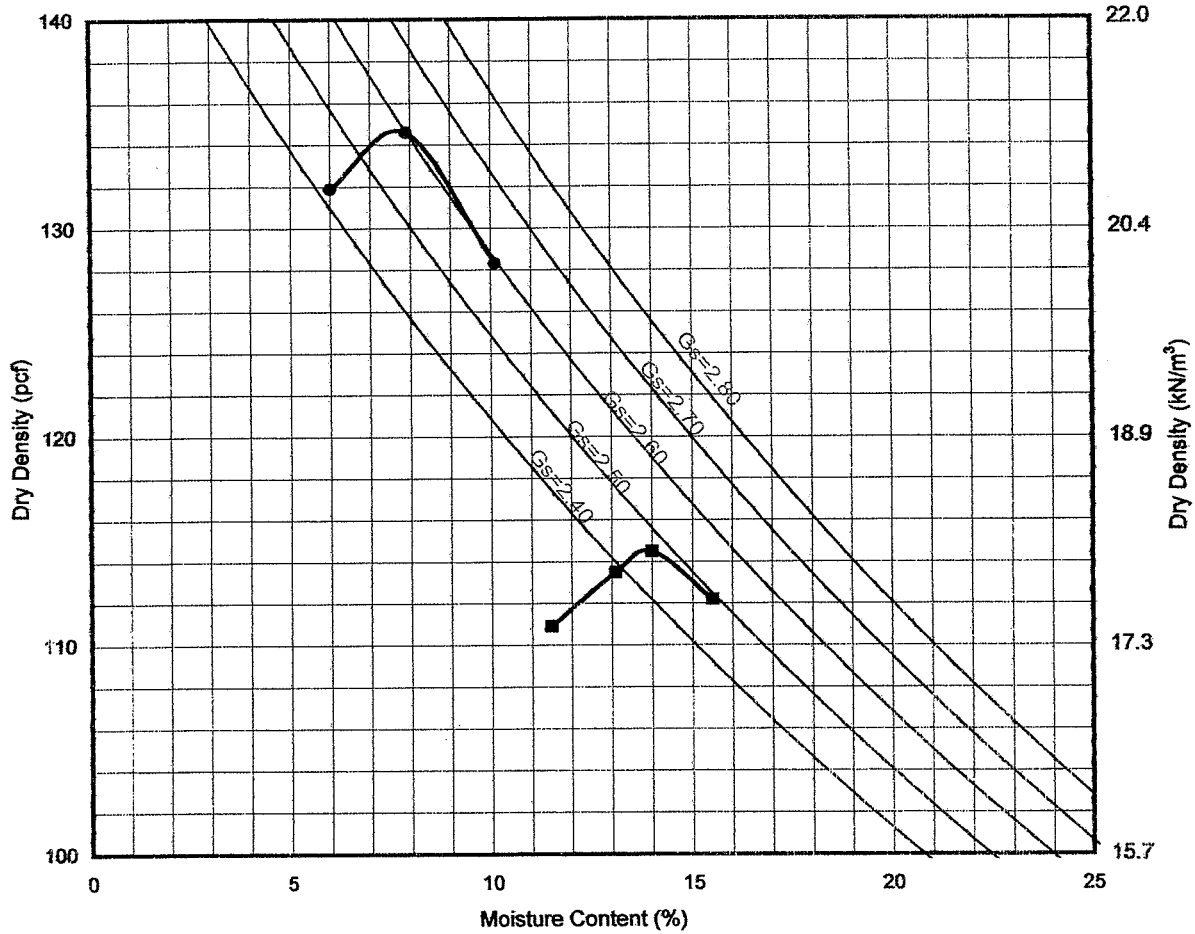

| Boring No. | Depth (ft) | Soil/Sample Type                            | $\gamma_{max}$ (pcf) | $W_{opt}$ (%) |
|------------|------------|---------------------------------------------|----------------------|---------------|
| • 5        | 0.5        | (SM) Silty Sand, fine to medium with coarse | 134.5                | 8.0           |
| ■ 8        | 0.5        | (SC) Clayey Sand, fine to coarse            | 114.5                | 14.0          |
|            |            |                                             |                      |               |
|            |            |                                             |                      |               |




**C.H.J.** Incorporated

**MOISTURE-DENSITY RELATIONSHIP**

|           |                                                |            |     |
|-----------|------------------------------------------------|------------|-----|
| Project:  | Industrial Development                         |            |     |
| Location: | NW of Lance and Sierra Ridge Drives, Riverside |            |     |
| Job No.:  | 07489-3                                        | Enclosure: | C-2 |

Direct Shear Test (ASTM D 3080)

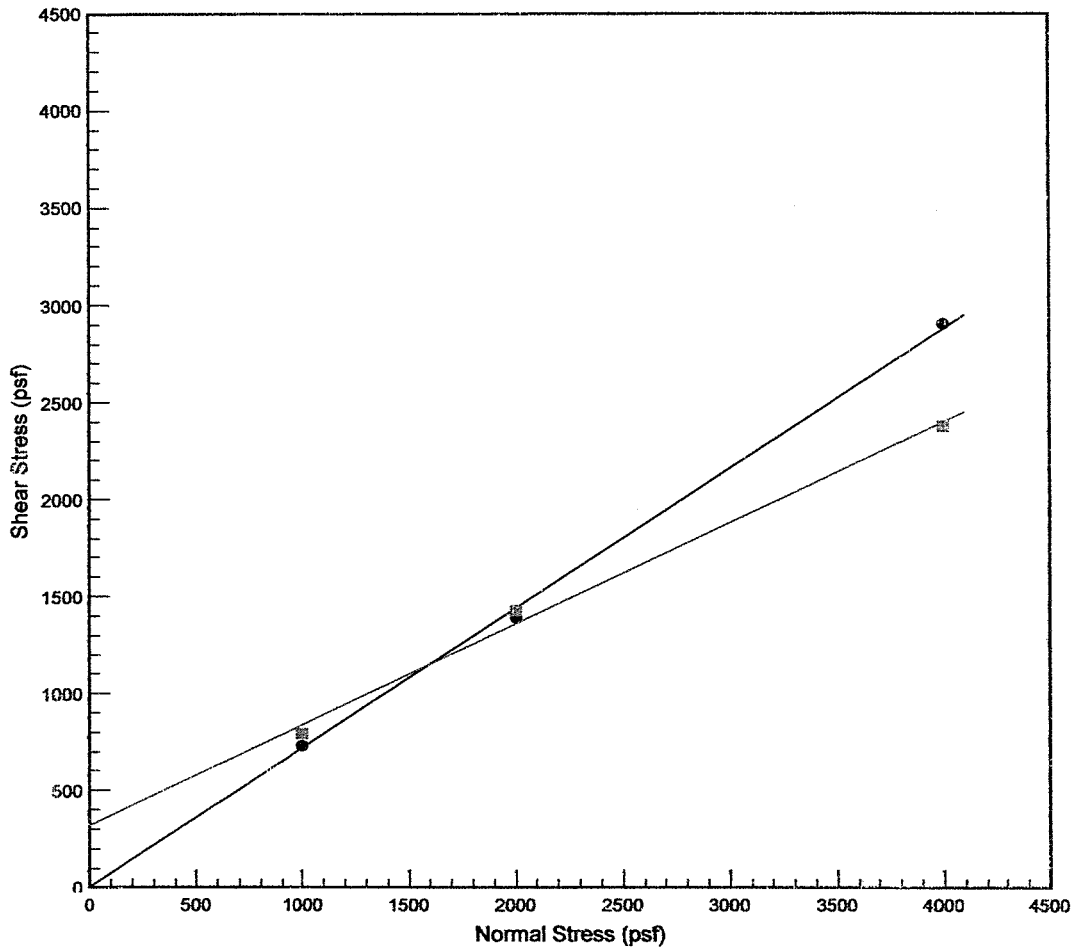

| Boring No. | Depth (ft) | Soil/Sample Type                            | $\gamma_d$ (pcf) | MC(%) | C (psf) | $\phi$ (°) |
|------------|------------|---------------------------------------------|------------------|-------|---------|------------|
| 3          | 0.5        | (SM) Silty Sand, fine to medium with coarse | 121              | 8.0   | 0       | 35.8       |
| 8          | 0.5        | (SC) Clayey Sand, fine to coarse            | 103              | 14.0  | 318     | 27.5       |
|            |            |                                             |                  |       |         |            |
|            |            |                                             |                  |       |         |            |



**C.H.J.** Incorporated

**DIRECT SHEAR TEST**

|           |                                                |            |     |
|-----------|------------------------------------------------|------------|-----|
| Project:  | Industrial Development                         |            |     |
| Location: | NW of Lance and Sierra Ridge Drives, Riverside |            |     |
| Job No.:  | 07489-3                                        | Enclosure: | C-3 |



Enclosure "C-4"  
Job No. 07489-3

**EXPANSION INDEX SUMMARY**

**EXPANSION INDEX:**

Uniform Building Code Standard Test Method 18-2

| <u>Boring<br/>No.</u> | <u>Depth of<br/>Sample<br/>(ft.)</u> | <u>Initial<br/>Moisture<br/>(%)</u> | <u>Final<br/>Moisture<br/>(%)</u> | <u>Degree of<br/>Saturation<br/>(%)</u> | <u>Expansion<br/>Index</u> | <u>Expansion<br/>Potential</u> |
|-----------------------|--------------------------------------|-------------------------------------|-----------------------------------|-----------------------------------------|----------------------------|--------------------------------|
| 5                     | 0.5                                  | 9.0                                 | 12.9                              | 50                                      | 10                         | "very low"                     |


**LABORATORY RECORD OF TESTS MADE ON  
BASE, SUBBASE, AND BASEMENT SOILS**

Job No. **07489-3**  
 LOCATION; **Sycamore Canyon, Riverside**  
 Project: **Magnon Warehouse**  
 R-VALUE # : 7A&13A  
 T.I. : **5.5**

COMPACTOR AIR PRESSURE P.S.I.  
 INITIAL MOISTURE %  
 WATER ADDED, ML  
 WATER ADDED %  
 MOISTURE AT COMPACTION %  
 HEIGHT OF BRIQUETTE  
 WET WEIGHT OF BRIQUETTE  
 DENSITY LB. PER CU.FT.  
 STABILOMETER PH AT 1000 LBS.  
                                   2000 LBS.  
 DISPLACEMENT  
 R-VALUE  
 EXUDATION PRESSURE  
 THICK. INDICATED BY STAB.  
 EXPANSION PRESSURE  
 THICK. INDICATED BY E.P.

|                               | A     | B     | C     | D |
|-------------------------------|-------|-------|-------|---|
| COMPACTOR AIR PRESSURE P.S.I. | 100   | 200   | 350   |   |
| INITIAL MOISTURE %            | 3.3   | 3.3   | 3.3   |   |
| WATER ADDED, ML               | 80    | 75    | 70    |   |
| WATER ADDED %                 | 6.9   | 6.5   | 6.0   |   |
| MOISTURE AT COMPACTION %      | 10.2  | 9.8   | 9.3   |   |
| HEIGHT OF BRIQUETTE           | 2.47  | 2.47  | 2.45  |   |
| WET WEIGHT OF BRIQUETTE       | 1160  | 1160  | 1150  |   |
| DENSITY LB. PER CU.FT.        | 129.1 | 129.7 | 130.1 |   |
| STABILOMETER PH AT 1000 LBS.  | 51    | 39    | 32    |   |
| 2000 LBS.                     | 114   | 79    | 63    |   |
| DISPLACEMENT                  | 5.30  | 5.00  | 4.90  |   |
| R-VALUE                       | 16    | 34    | 44    |   |
| EXUDATION PRESSURE            | 240   | 320   | 500   |   |
| THICK. INDICATED BY STAB.     | 1.48  | 1.16  | 0.99  |   |
| EXPANSION PRESSURE            | 3     | 8     | 16    |   |
| THICK. INDICATED BY E.P.      | 0.10  | 0.27  | 0.53  |   |

EXUDATION CHART

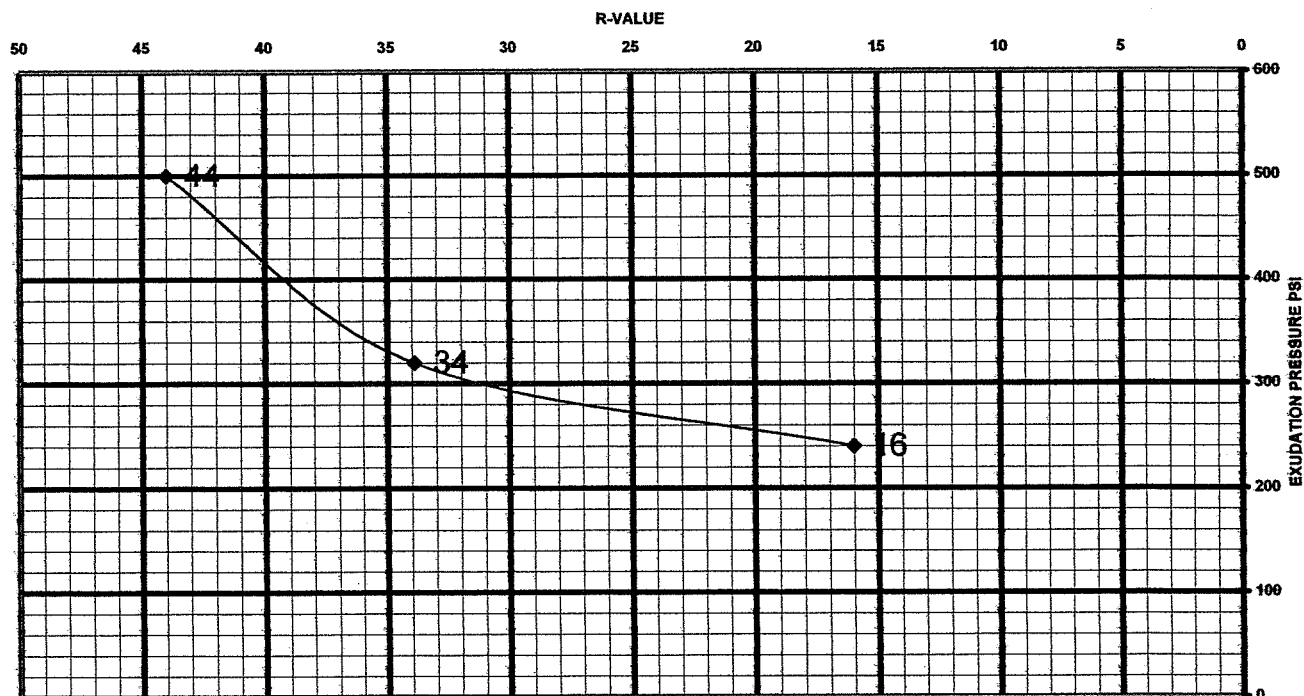

R-Value: **31**



# ANAHEIM TEST LABORATORY

3008 S. ORANGE AVENUE  
SANTA ANA, CALIFORNIA 92707  
PHONE (714) 549-7267

C.H.J., INC:  
1355 COOLEY DRIVE  
COLTON, CA. 92324

ATTN: JAMES M.

DATE: 7/16/07

P.O. No. LETTER

Shipment No.

Lab. No. B-1041

Specification:

Material: SOIL

PROJECT: #07489-3

MAGNON WAREHOUSE.


## ANALYTICAL REPORT

### CORROSION SERIES SUMMARY OF DATA




|                 | pH  | SOLUBLE SULFATES<br>per CA. 417<br>ppm | SOLUBLE CHLORIDES<br>per CA. 422<br>ppm | MIN. RESISTIVITY<br>per CA. 643<br>ohm-cm |
|-----------------|-----|----------------------------------------|-----------------------------------------|-------------------------------------------|
| #1 5A @<br>0.5' | 7.1 | 33                                     | 25                                      | 3,1796                                    |
| #2 8A @<br>0.5' | 7.1 | 40                                     | 20                                      | 1,752                                     |

RESPECTFULLY SUBMITTED

  
POPPY BRIDGER Chief Chemist

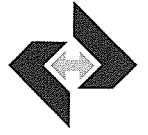

**APPENDIX "D"**  
**GEOTECHNICAL DETAILS**

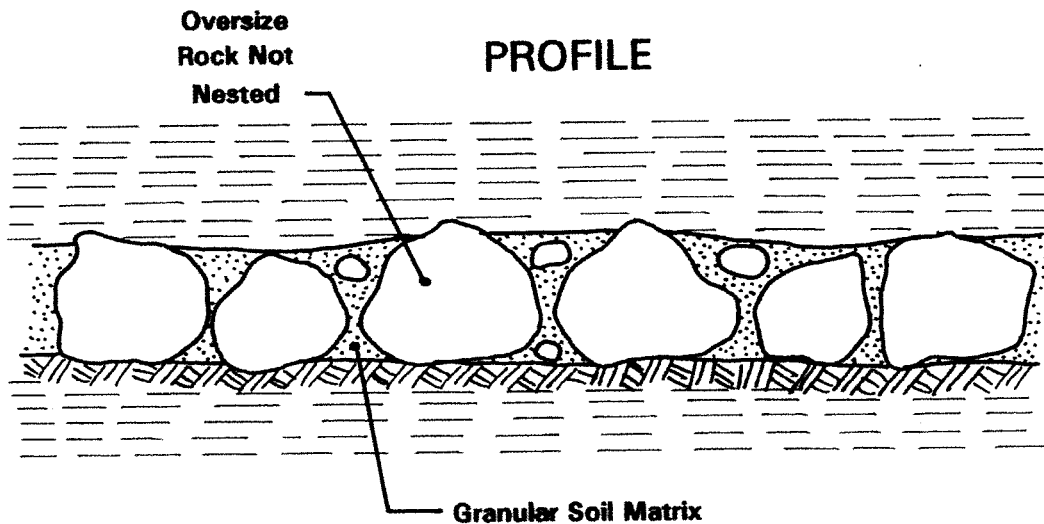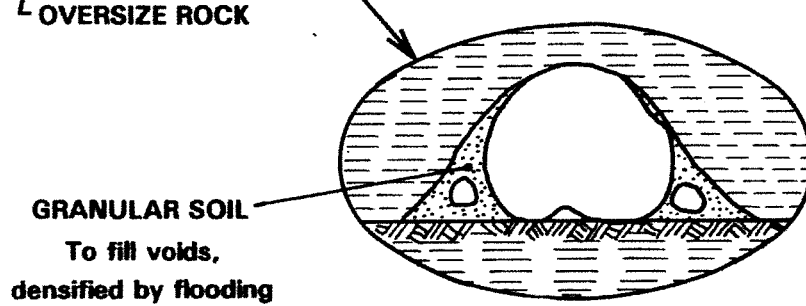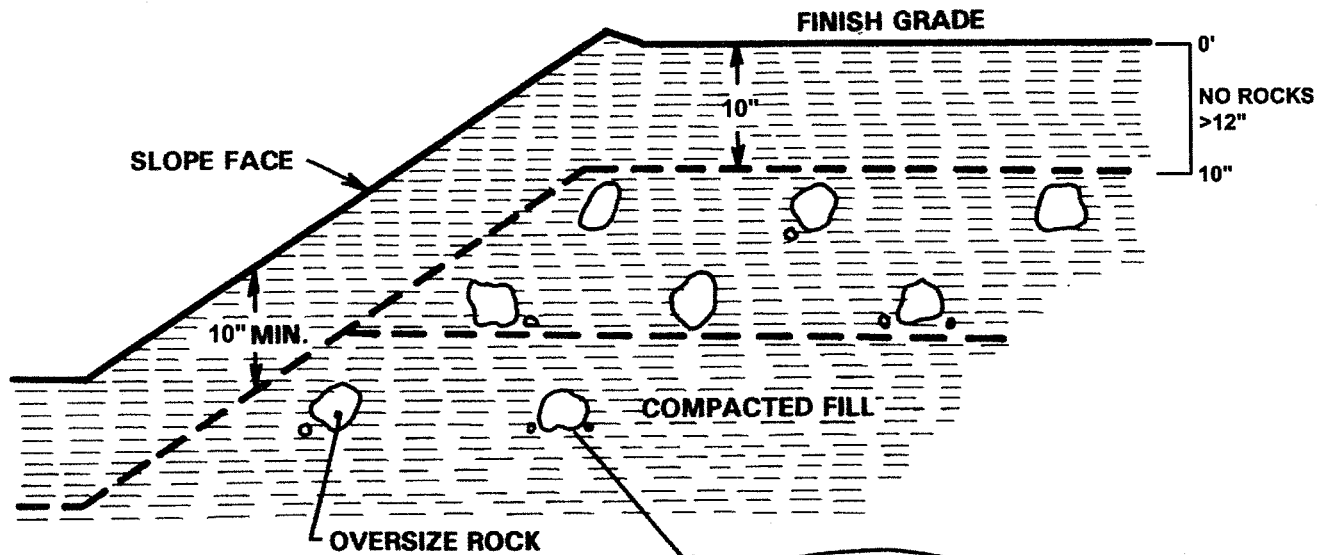

| ROCK DISPOSAL DETAIL                |                                                                                                                                |                       |
|-------------------------------------|--------------------------------------------------------------------------------------------------------------------------------|-----------------------|
| FOR:<br><b>THE MAGNON COMPANIES</b> | PROPOSED INDUSTRIAL DEVELOPMENT<br>NORTHWEST OF INTERSECTION OF LANCE DRIVE<br>AND SIERRA RIDGE DRIVE<br>RIVERSIDE, CALIFORNIA | ENCLOSURE<br>"D-1"    |
| DATE:<br>JULY 2007                  |                                                                                                                                | JOB NUMBER<br>07489-3 |
|                                     |                                                                                                                                |                       |



**APPENDIX "E"**  
**SEISMIC REFRACTION SURVEY**



**SEISMIC REFRACTION SURVEY  
SYCAMORE V PROJECT  
CITY OF RIVERSIDE, CALIFORNIA**

Project No. 272224-1

July 6, 2007

**Prepared for:**

CHJ, Inc.  
1355 E. Cooley Drive  
Colton, CA 92324

CHJ, Inc.  
1355 E. Cooley Drive  
Colton, CA 92324

Attention: Mr. Terry Davis, Project Geologist

Regarding: Seismic Refraction Survey  
Sycamore V Project  
City of Riverside, California  
CHJ Project Number 07489-3

### INTRODUCTION

As requested, this firm has performed a geophysical survey using the seismic refraction method for the above-referenced site along twelve selected areas as delineated by you. The purpose of this investigation was to assess the general seismic velocity characteristics of the underlying earth materials and to aid in evaluating whether high velocity earth materials (non-rippable) are present along local areas which could possibly indicate areas of potential excavation difficulties. The bedrock materials locally have been mapped by Morton and Cox (2001) to consist predominantly of Cretaceous age granitic rock classified as gray-weathering, relatively homogeneous, massive to well-foliated, medium- to coarse-grained biotite-hornblende tonalite, locally referred to as the Val Verde Tonalite.

Our field work began on June 26, 2007, but due to the extreme "noisy" site conditions, the field survey was completed on Saturday, June 30, 2007, as the rock crushing and related construction equipment was not in operation at that time. This allowed us to obtain the best data possible as the site conditions were relatively "quiet." Since a topographic map was not available for our use, the locations of the seismic survey lines have been approximated on an aerial photograph which is presented on Plate 1. As authorized by you, the following services were performed during this study:

- **Review of available published and unpublished geologic/geophysical data in our files pertinent to the site.**
- **Performing a seismic refraction survey by a State of California Professional Geophysicist, to include 12 traverses along selected portions of the subject site.**
- **Preparation of this report, presenting the results of our findings and conclusions with respect to the velocity characteristics and the expected rippability potentials of the subsurface earth materials.**

### Accompanying Map and Appendices

- Plate 1 - Seismic Line Location Map
- Appendix A - Layer Velocity Profiles
- Appendix B - Tomographic Models
- Appendix C - Excavation Considerations
- Appendix D - References

## SEISMIC REFRACTION SURVEY

### Methodology

The seismic refraction method consists of measuring (at known points along the surface of the ground) the travel times of compressional waves generated by an impulsive energy source and can be used to estimate the layering, structure, and seismic acoustic velocities of subsurface horizons. Seismic waves travel down and through the soils and rocks, and when the wave encounters a contact between two earth materials having different velocities, some of the wave's energy travels along the contact at the velocity of the lower layer. The fundamental assumption is that each successively deeper layer has a velocity greater than the layer immediately above it. As the wave travels along the contact, some of the wave's energy is refracted toward the surface where it is detected by a series of motion-sensitive transducers (geophones). The arrival time of the seismic wave at the geophone locations can be related to the relative seismic velocities of the subsurface layers in feet per second (fps), which can then be used to aid in interpreting both the depth and type of materials encountered.

### Field Procedures

Twelve seismic refraction survey lines were performed each being 156-feet in length, with a target depth of around 30±-feet. A 16-pound sledge-hammer was used as an energy source to produce the seismic waves and twelve, 14-Hz geophones (with 70% damping), were spaced at 12-foot intervals along the traverse lines to detect both the direct and refracted waves. The seismic wave arrivals were digitally recorded in SEG-2 format on a Geometrics StrataVisor™ NX model signal enhancement refraction seismograph. Seven shot points were utilized along each seismic line spread using forward, reverse, and intermediate locations, in order to obtain sufficient data for velocity analysis and depth modeling purposes. The data was acquired using a sampling rate of 0.25 milliseconds with a record length of 0.064 seconds. No acquisition filters were used. Each geophone and shot location was surveyed using a hand level and ruler for relative topographic correction. During acquisition, the seismograph provides both a hard copy and screen display of the seismic wave arrivals, of which are digitally recorded on the in-board seismograph computer.

### Data Reduction

The data on the paper record and/or display screen were used to analyze the arrival time of the primary seismic "P"-waves at each geophone station, in the form of a wiggle trace, or wave travel-time curve, for quality control purposes in the field. All of the recorded data was subsequently transferred to our office computer for further processing, analyzing, and printing purposes, using the computer programs **SIP** (Seismic refraction Interpretation Program) developed by Rimrock Geophysics, Inc. (1995), and **Rayfract™** (Intelligent Resources, Inc., 1996-2007). **SIP** is a ray-trace modeling program that evaluates the subsurface using layer assignments based on time-distance curves and is better suited for layered media, using the "Seismic Refraction Modeling by Computer" method (Scott, 1973). In addition, **Rayfract™** was also used for comparative purposes. **Rayfract™** is seismic refraction tomography software that models subsurface refraction, transmission, and diffraction of acoustic waves. Both computer programs perform their analysis using exactly the same input data, which includes first-arrival P-waves and line geometry.

## SUMMARY OF GEOPHYSICAL INTERPRETATION

To begin our discussion, it should be understood that the velocity data obtained during this survey represents an average of seismic velocities within any given layer. For example, high seismic velocity boulders/dikes or local lithologic inconsistencies, may be isolated within a low velocity matrix, thus yielding an average medium velocity for that layer. Therefore, in any given layer, a range of velocities could be anticipated, which can also result in a wide range of excavation characteristics.

It is also important to consider that the seismic velocities obtained within bedrock materials are influenced by the nature and character of the localized major structural discontinuities (foliation, fracturing, etc.). Generally, it is expected that higher (truer) velocities will be obtained when the seismic waves propagate along direction (strike) of the dominant structure, with a damping effect when the seismic waves travel in a perpendicular direction. Therefore, the seismic velocities obtained during our field study and as discussed below, should be considered minimum velocities at this time, as the structure of the bedrock locally is not known.

In general, the site where locally surveyed, was noted to be characterized by three major subsurface layers with respect to seismic velocities. The following velocity layer summaries have been prepared using the **SIP** analysis, with the representative Layer Velocity Profiles for each seismic survey line presented within Appendix A. These profiles generally indicate the respective "weighted average" subsurface velocities in generalized layers.

□ **Velocity Layer V1:**

This uppermost velocity layer (V1) is most likely comprised of topsoil, colluvium, and/or highly weathered or intensely fractured bedrock materials. This layer has an average weighted velocity ranging from 1,747 to 2,687 fps, which is typical for these types of surficial-mantling materials. The V1 layer along Seismic Line S-7 may partially consist of artificial fill materials from the rock crushing operations.

□ **Velocity Layer V2:**

The second velocity layer (V2) yielded a wide range of 3,102 to 5,852 fps, indicating high to moderate degrees of weathering and/or fracturing of the underlying granitic bedrock. These seismic velocities are typical for the near surface weathered zone commonly found in granitic rocks within the southern California region. This range of velocities may be due to the relative spacing of the rock fracture system and/or the possibility of buried fresh large boulders within decomposed rock matrix. Seismic Lines S-4 through S-6 and S-9 were located within cut areas generally exposing weathered bedrock at the surface, thus not having a V1 layer locally.

□ **Velocity Layer V3:**

The third layer (V3) indicates less-weathered harder bedrock, with average weighted velocities of 6,362 to 9,137 fps. This range of seismic velocities indicates the likelihood of scattered buried fresh large boulders and/or dikes within a moderately decomposed matrix or possibly a slightly weathered to fresh intact rock matrix with wide-spaced fracturing.



Using **Rayfract™**, a tomographic model for each seismic line was also prepared and analyzed for comparative purposes, as presented in Appendix B, which generally indicates the relative structure and velocity distribution. The models were prepared to display the same relative color intensities for the respective velocities so that they may be comparable across the site. Although no discrete velocity layers or boundaries are created, these models generally resemble the **SIP** analysis. **Rayfract™** allows imaging of subsurface velocity using first break energy propagation modeling. It can be seen in these tomographic models that the seismic velocity (which generally relates to hardness) of the bedrock gradually increases with depth which is most likely the representative condition of the subsurface materials, along with some lateral variations suggestive of buried corestones and/or dikes. It was also noted that for the most part, the seismic velocities on the Layer Velocity Profiles (Appendix A) appears to generally correlate with the average of the velocity gradients as shown on the Tomographic Models (Appendix B).

### **GENERALIZED RIPPABILITY CHARACTERISTICS OF GRANITIC BEDROCK**

A summary of the generalized rippability characteristics of granitic bedrock based on rippability performance charts prepared by Caterpillar, Inc. (2000 and 2004) has been provided to aid in evaluating potential excavation difficulties with respect to the seismic velocities obtained along the local areas surveyed. The velocity ranges described below are approximate and assume typical, good-working, heavy excavation equipment, such as single shank or D9R dozer, such as described by Caterpillar, Inc. (2000 and 2004); however, different excavating equipment (i.e., trenching equipment) may not correlate well with these velocity ranges. Trenching operations within granitic bedrock materials with seismic velocities generally greater than 3,500 to 4,000±-fps, typically encounter very difficult to non-productable conditions. A summary of excavation considerations has been included in Appendix C in order to provide the client with a better understanding of the complexities of excavation in granitic bedrock materials. These concepts should be understood so that proper planning and excavation techniques can be employed by the selected grading contractor.

□ **Rippable Condition (0 - 4,000 ft/sec):**

This velocity range indicates rippable materials which may consist of alluvial-type deposits and decomposed granitics, with random hardrock floaters. These materials will break down into slightly silty, well-graded sand, whereas floaters will require special disposal. Some areas containing numerous hardrock floaters may present utility trench problems. Large floaters exposed at or near finished grade may present problems for footing or infrastructure trenching.

□ **Marginally Rippable Condition (4,000 - 8,000 ft/sec):**

This range of velocities indicates materials which may consist of slightly weathered granitics or large areas of fresh granitics separated by weathered fractured zones. These materials are generally rippable with difficulty by a Caterpillar D9R or equivalent. Excavations may produce material that will partially break down into a coarse, slightly silty to clean sand, with a high percentage of very coarse sand to pebble-sized material. Less fractured or weathered materials will probably require blasting to facilitate removal.

□ **Non-Rippable Condition (8,000 ft/sec or greater):**

This velocity range includes non-rippable material consisting primarily of moderately fractured granitics at lower velocities and only slightly fractured or unfractured rock at higher velocities. Materials in this velocity range may be marginally rippable, depending upon the degree of fracturing and the skill and experience of the operator. Tooth penetration is often the key to ripping success, regardless of seismic velocity. If the fractures and joints do not allow tooth penetration, the material may not be ripped effectively; however, pre-blasting or "popping" may induce sufficient fracturing to permit tooth entry. In their natural state, materials with these velocities are generally not desirable for building pad grade, due to difficulty in footing and utility trench excavation. Blasting will most likely produce oversized material, requiring special disposal.

### **SUMMARY OF FINDINGS AND CONCLUSIONS**

The raw field data was considered to be of good quality which had only minor amounts of ambient "noise" that was introduced during our survey from distant vehicular traffic and periodic wind sources. Analysis of the data and picking of the primary "P"-wave arrivals was performed with little difficulty and occasional interpolation of data was necessary. Based on the results of our comparative seismic analyses of both **SIP** and **Rayfract™** (of which both software programs use exactly the same input data), the seismic refraction survey lines appear to generally coincide with one another, with some minor variances due to the methods that these programs process and integrate the input data.

The anticipated excavation potentials of the velocity layers encountered locally during our survey are as follows:

□ **Velocity Layer V1:**

No major excavating difficulties are expected within the uppermost, low-velocity layer V1 (velocity range of 1,747 to 2,687 fps). This layer is expected to be comprised of topsoil, colluvium, possible localized artificial fill materials, and/or highly weathered or intensely fractured bedrock materials. However, some fresher boulders should be anticipated to be encountered in this layer based on surface exposures of bedrock, locally.

□ **Velocity Layer V2:**

The second layer V2 is believed to consist of highly- to moderately-weathered granitic bedrock (velocity range of 3,102 to 5,852 fps). These materials are expected to excavate with slight to moderate difficulty, assuming appropriate good-working equipment for the proposed type of excavation. Isolated floaters (i.e., boulders, corestones, etc.) are presumably present within the weathered bedrock layer based on surficial exposures and could produce difficult conditions locally. Placement of infrastructures in this material may also be difficult. Localized blasting in the bedrock materials approaching the higher-end velocities cannot be completely ruled out, due to the presence of any localized fresh bedrock, and/or buried boulders and dikes.

□ **Velocity Layer V3:**

Excavation difficulties within the lower V3 velocity layer (velocity range of 6,362 to 9,137 fps) are anticipated, which consists predominantly of slightly weathered granitic bedrock. Very hard excavating areas consisting of localized boulders, dikes, and/or fresher bedrock with relatively wide-spaced jointing/fracturing will most likely be encountered during both remedial grading and placement of infrastructures, which may require moderate to significant blasting to achieve desired grade.

Based on the Tomographic Models (Appendix B) and typical excavation characteristics that have been observed within granitic bedrock materials of the southern California region, anticipation of gradual increasing hardness with depth along with localized lateral variations, with respect to excavation characteristics, should be anticipated across the site. It may be expected that when ground velocities on the order of  $6,000 \pm$  fps or greater are encountered, increasing difficulties in excavation conditions and rippability will occur with respect to grading production. These increases may result in slower production rates from the cut excavation with an increase in the generation of oversized rock materials. This is also dependent upon the type and operating condition of the excavation equipment used, how hard the contractor is willing to work the equipment, and the structural discontinuities of the rock fabric. The decision for blasting of the rock for excavatability is sometimes made based upon economic production reasons and not solely on the rippability (velocity/hardness) characteristics of the bedrock.

To evaluate whether a particular bedrock material can be ripped or excavated, this geophysical survey should be used in conjunction with the geologic and/or geotechnical report for the subject project (if prepared) which should describe the physical properties of the bedrock. The physical characteristics of bedrock materials that favor ripping generally include the presence of fractures, faults and other structural discontinuities, weathering effects, brittleness or crystalline structure, stratification of lamination, large grain size, moisture permeated clay, and low compressive strength. Unfavorable conditions can include such characteristics as massive and homogeneous formations, non-crystalline structure, absence of planes of weakness, fine-grained materials, and formations of clay origin where moisture makes the material plastic. Use of these physical bedrock conditions along with the subsurface velocity characteristics as presented within this report should aid in properly evaluating the type of equipment necessary and the production levels that can be anticipated for this project.

### **CLOSURE**

This survey was performed using "state of the art" geophysical techniques, computer processing, and equipment, in the localized areas delineated by you. We make no warranty, either expressed or implied. It should be noted that our data was obtained along 12 specific areas; therefore, other local areas within the site beyond the limits of our seismic lines may contain different velocity layers and depths not encountered during our field survey. Estimates of layer velocity boundaries are generally considered to be within  $10 \pm$ -percent of the depth of the contact. It should be understood that when using these theoretical geophysical principles and techniques, sources of error are possible in both the data obtained and in the interpretation.


In summary, the results of this survey are to be considered as an aid to assessing the rippability potentials of the bedrock locally. This information should be carefully reviewed by the grading contractor and representative "test" excavations should be considered, so that they may be correlated with the data presented within this report.

If you should have any questions regarding this report or do not understand the limitations of this survey, please do not hesitate to contact our office.


Respectfully submitted,  
**TERRA GEOSCIENCES**



**Donn C. Schwartzkopf**  
Principal Geophysicist  
PGP 1002

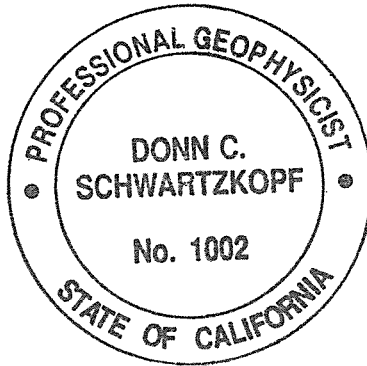



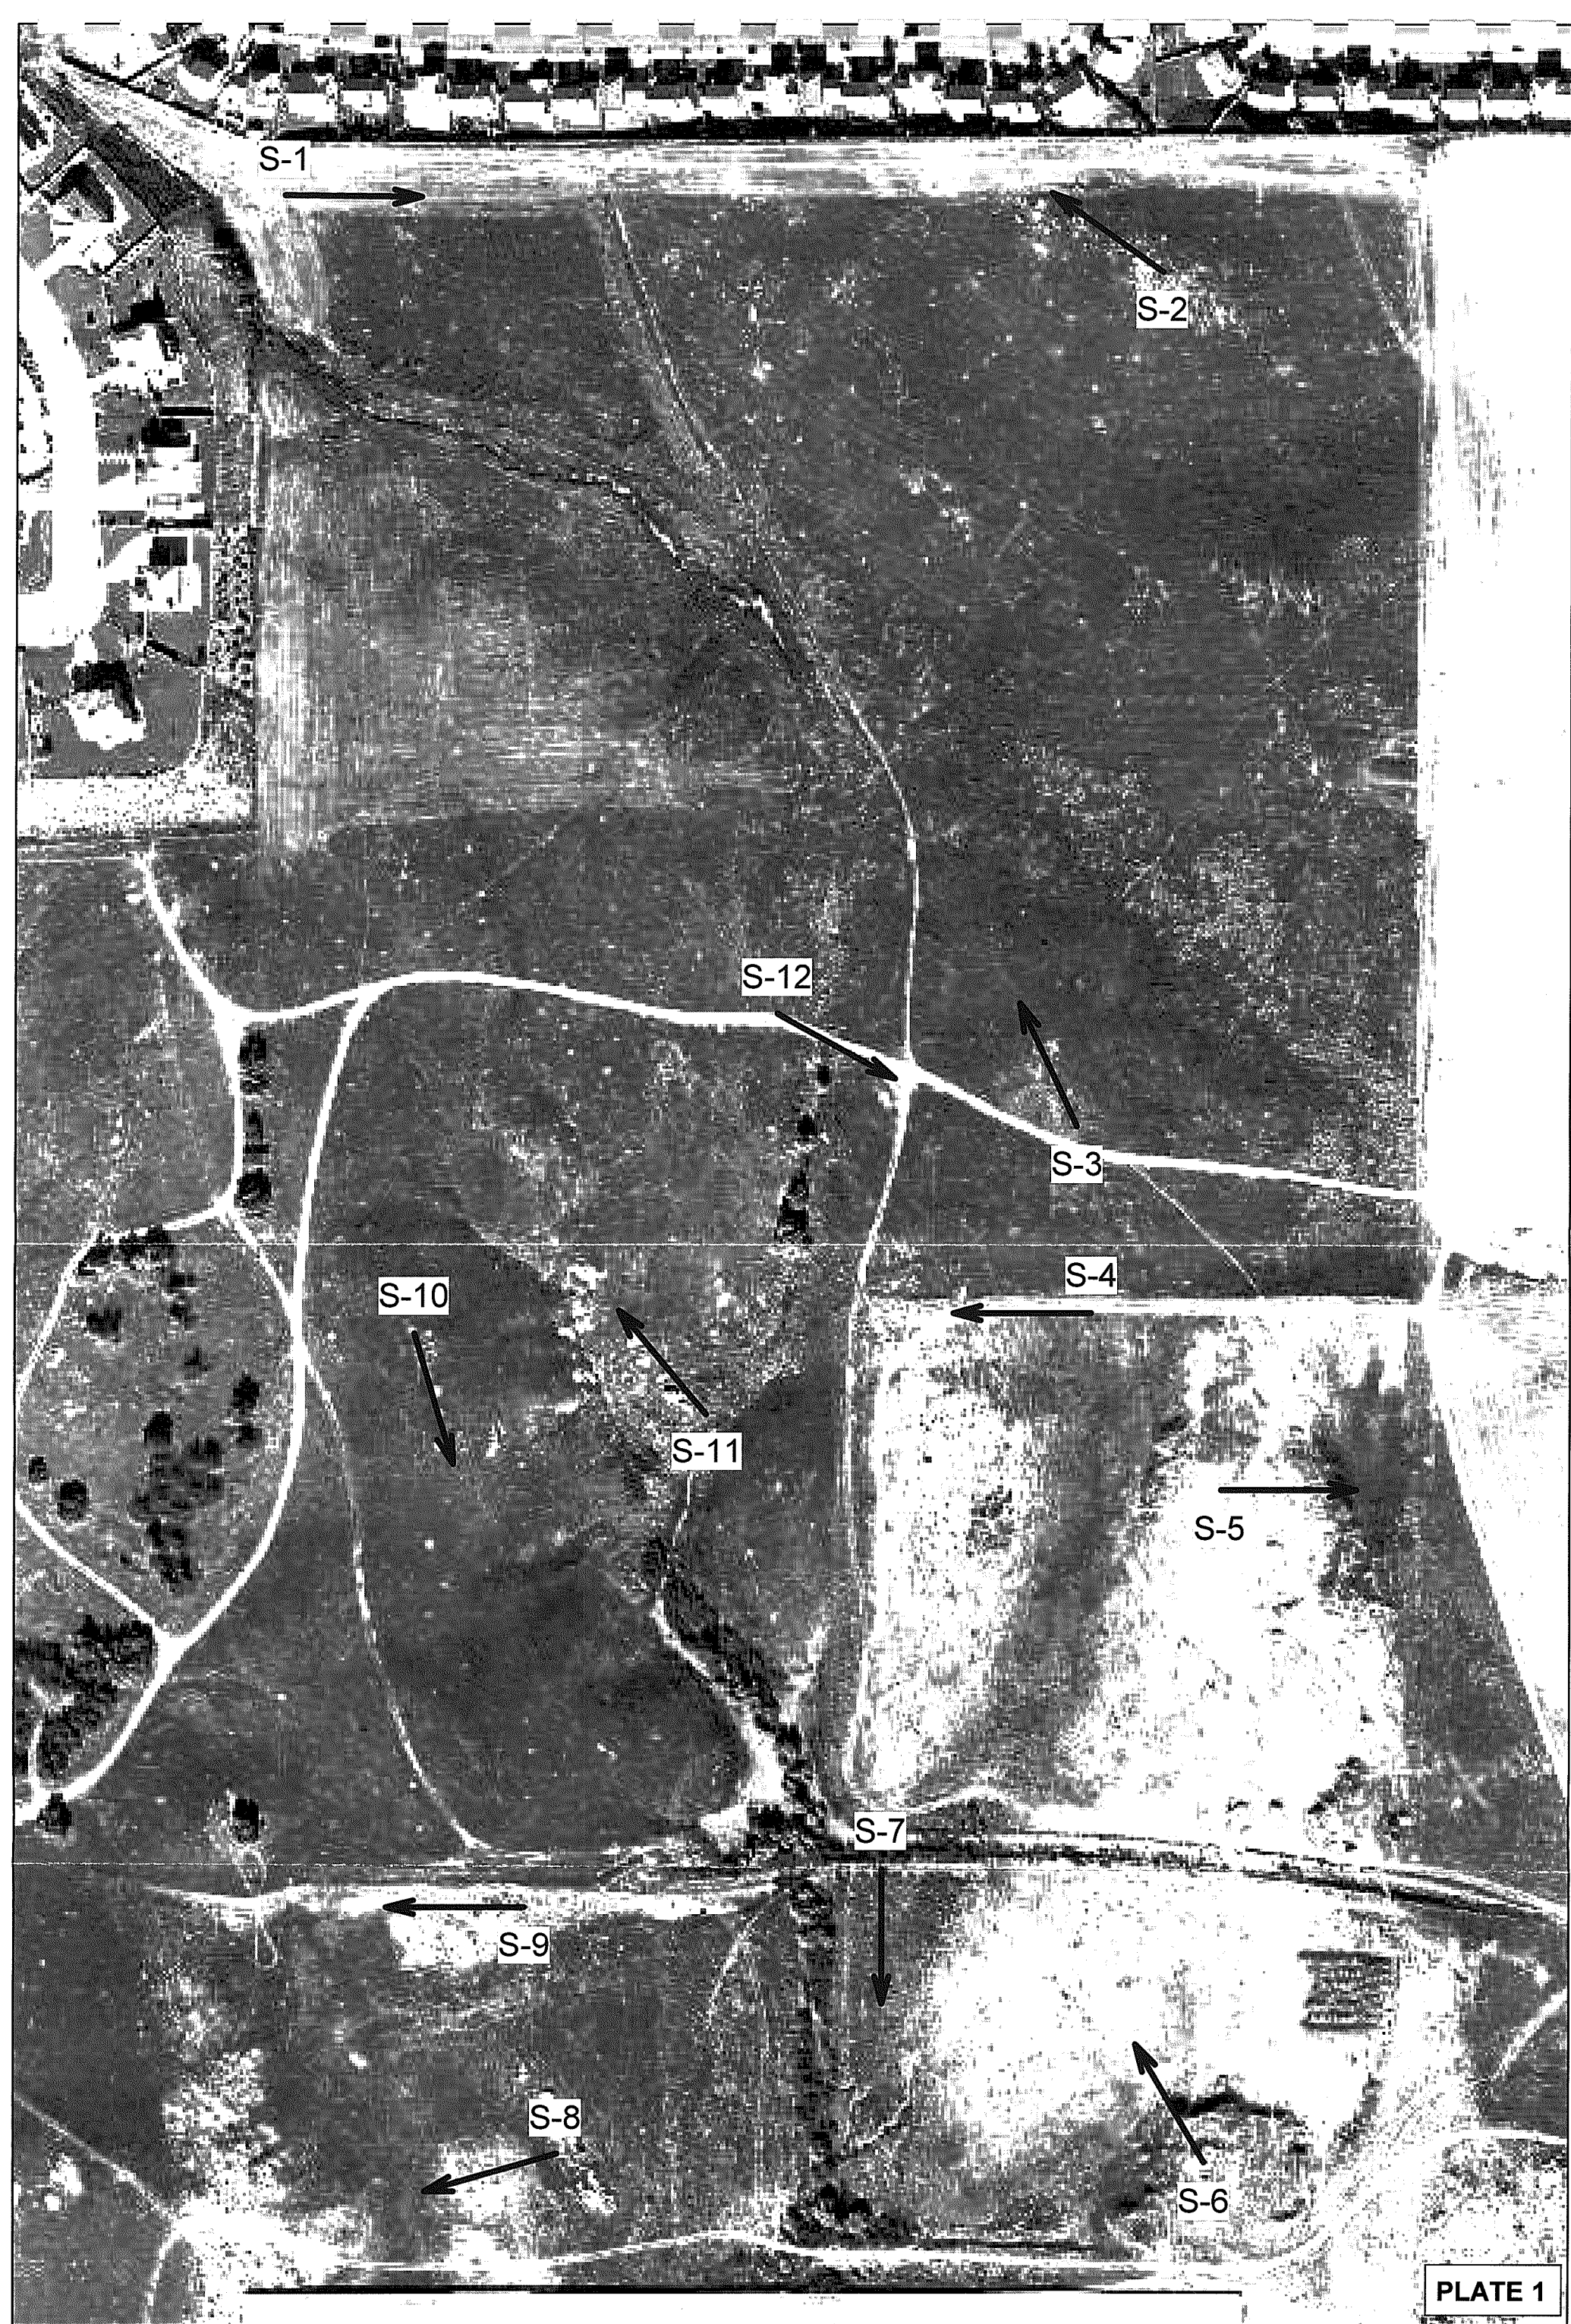

**PLATE 1**

Name: RIVERSIDE EAST NE, CA  
Date: 7/2/2007  
Scale: 1 inch equals 167 feet

Location: 033.9389184° N 117.3075254° W WGS 84  
Caption: SEISMIC LINE LOCATION MAP  
SYCAMORE V PROJECT  
City of Riverside, California




# **APPENDIX A**

---

---

## **LAYER VELOCITY PROFILES**

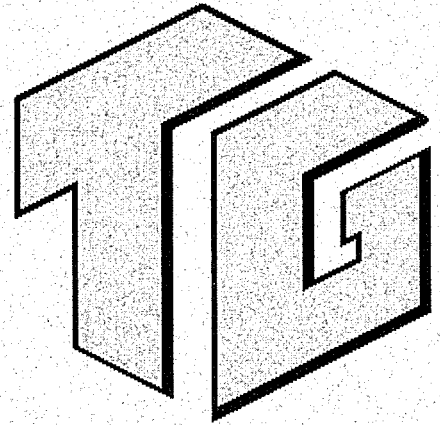


# LAYER VELOCITY PROFILE S-1

← West - East →

FILE 2224-1.SIP  
SEISMIC LINE S-1

SPREAD A

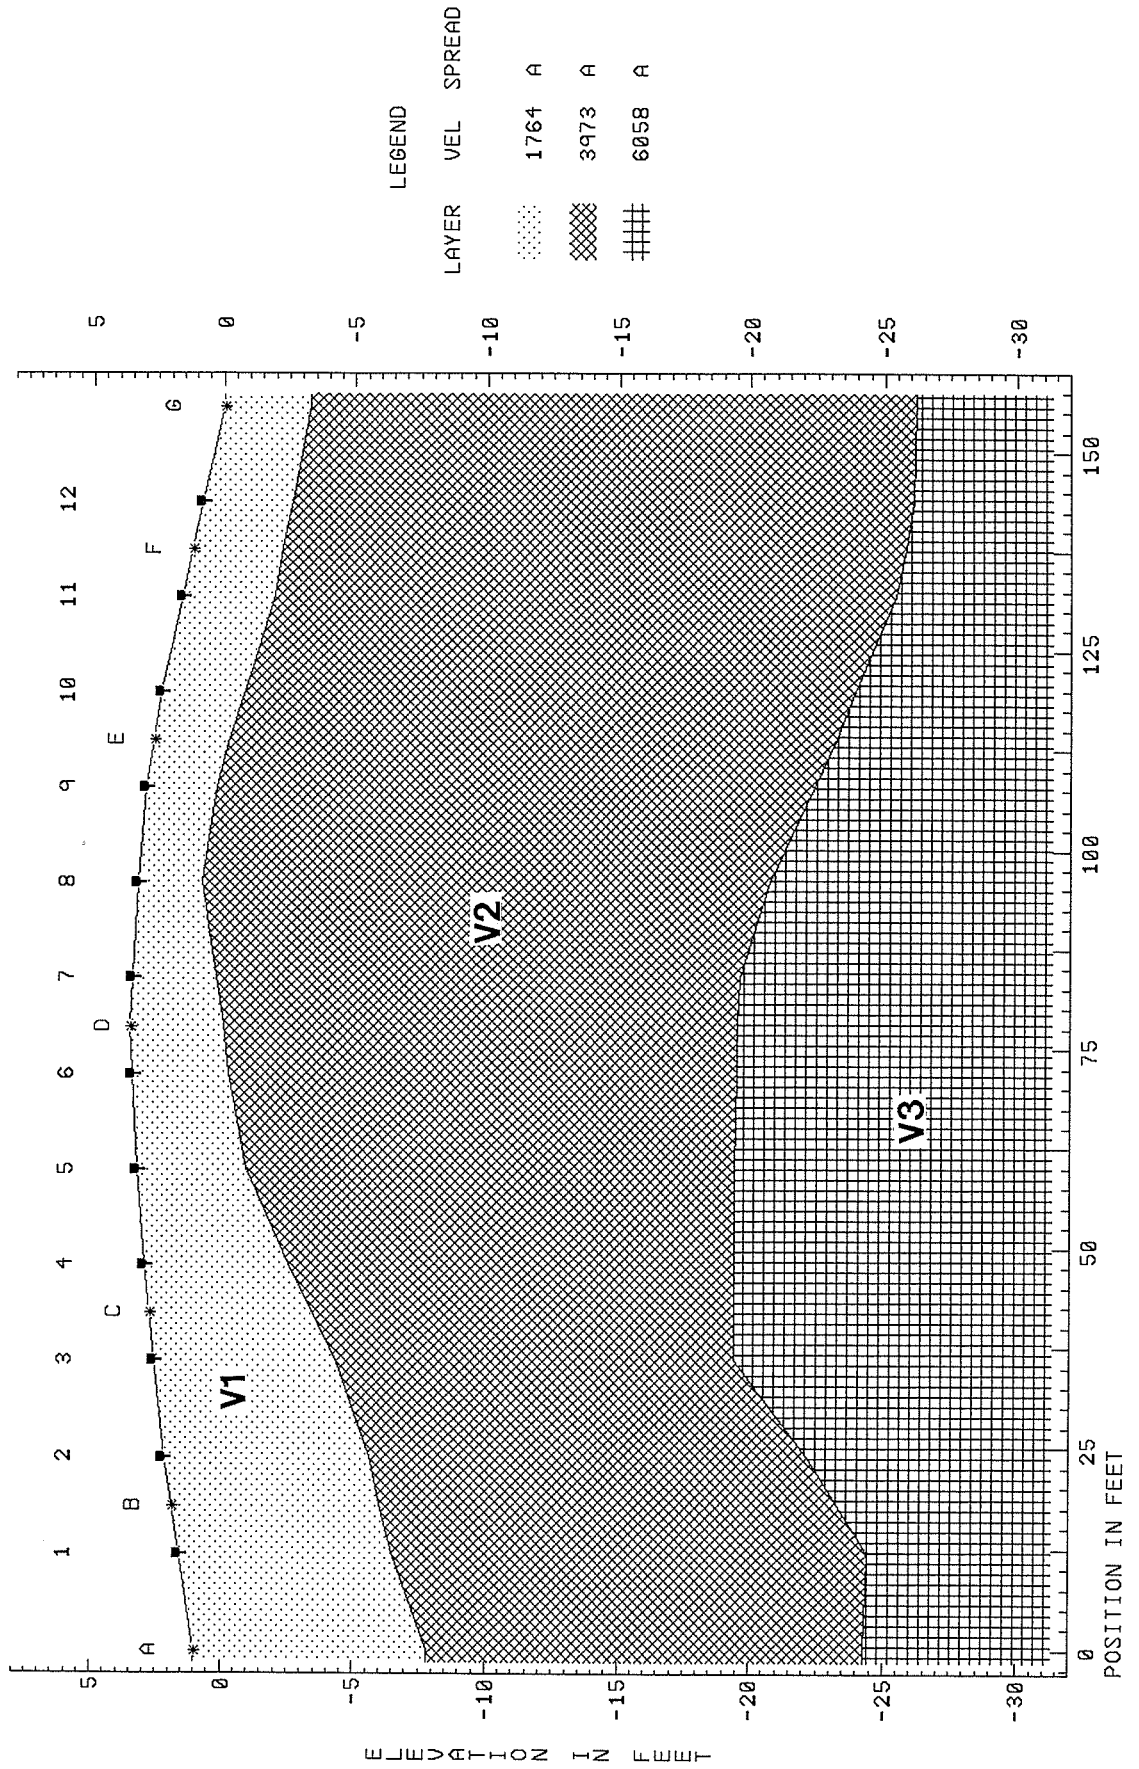


# LAYER VELOCITY PROFILE S-2

North 55° West →

FILE 2224-2.SIP  
SEISMIC LINE S-2

SPREAD A

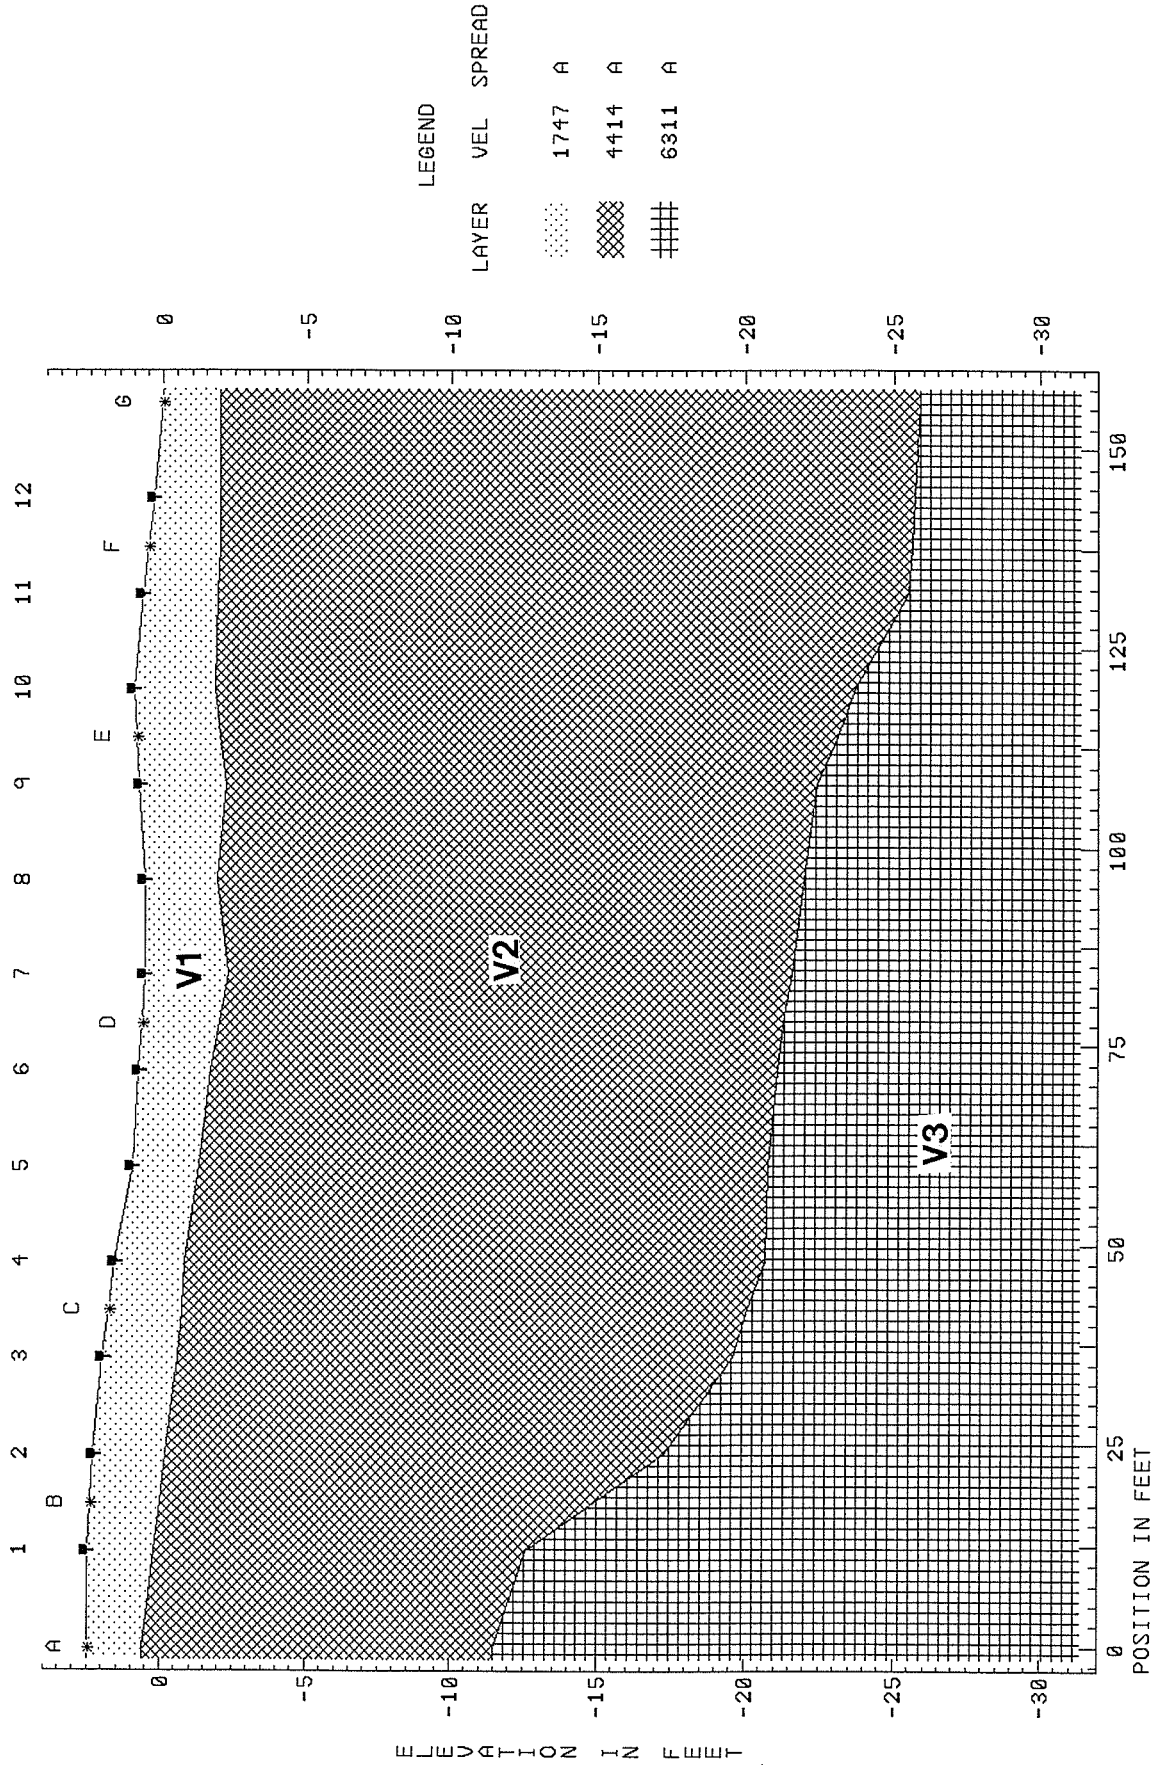




# LAYER VELOCITY PROFILE S-3

North 25° West →

FILE 2224-3.SIP  
SEISMIC LINE S-3

SPREAD A

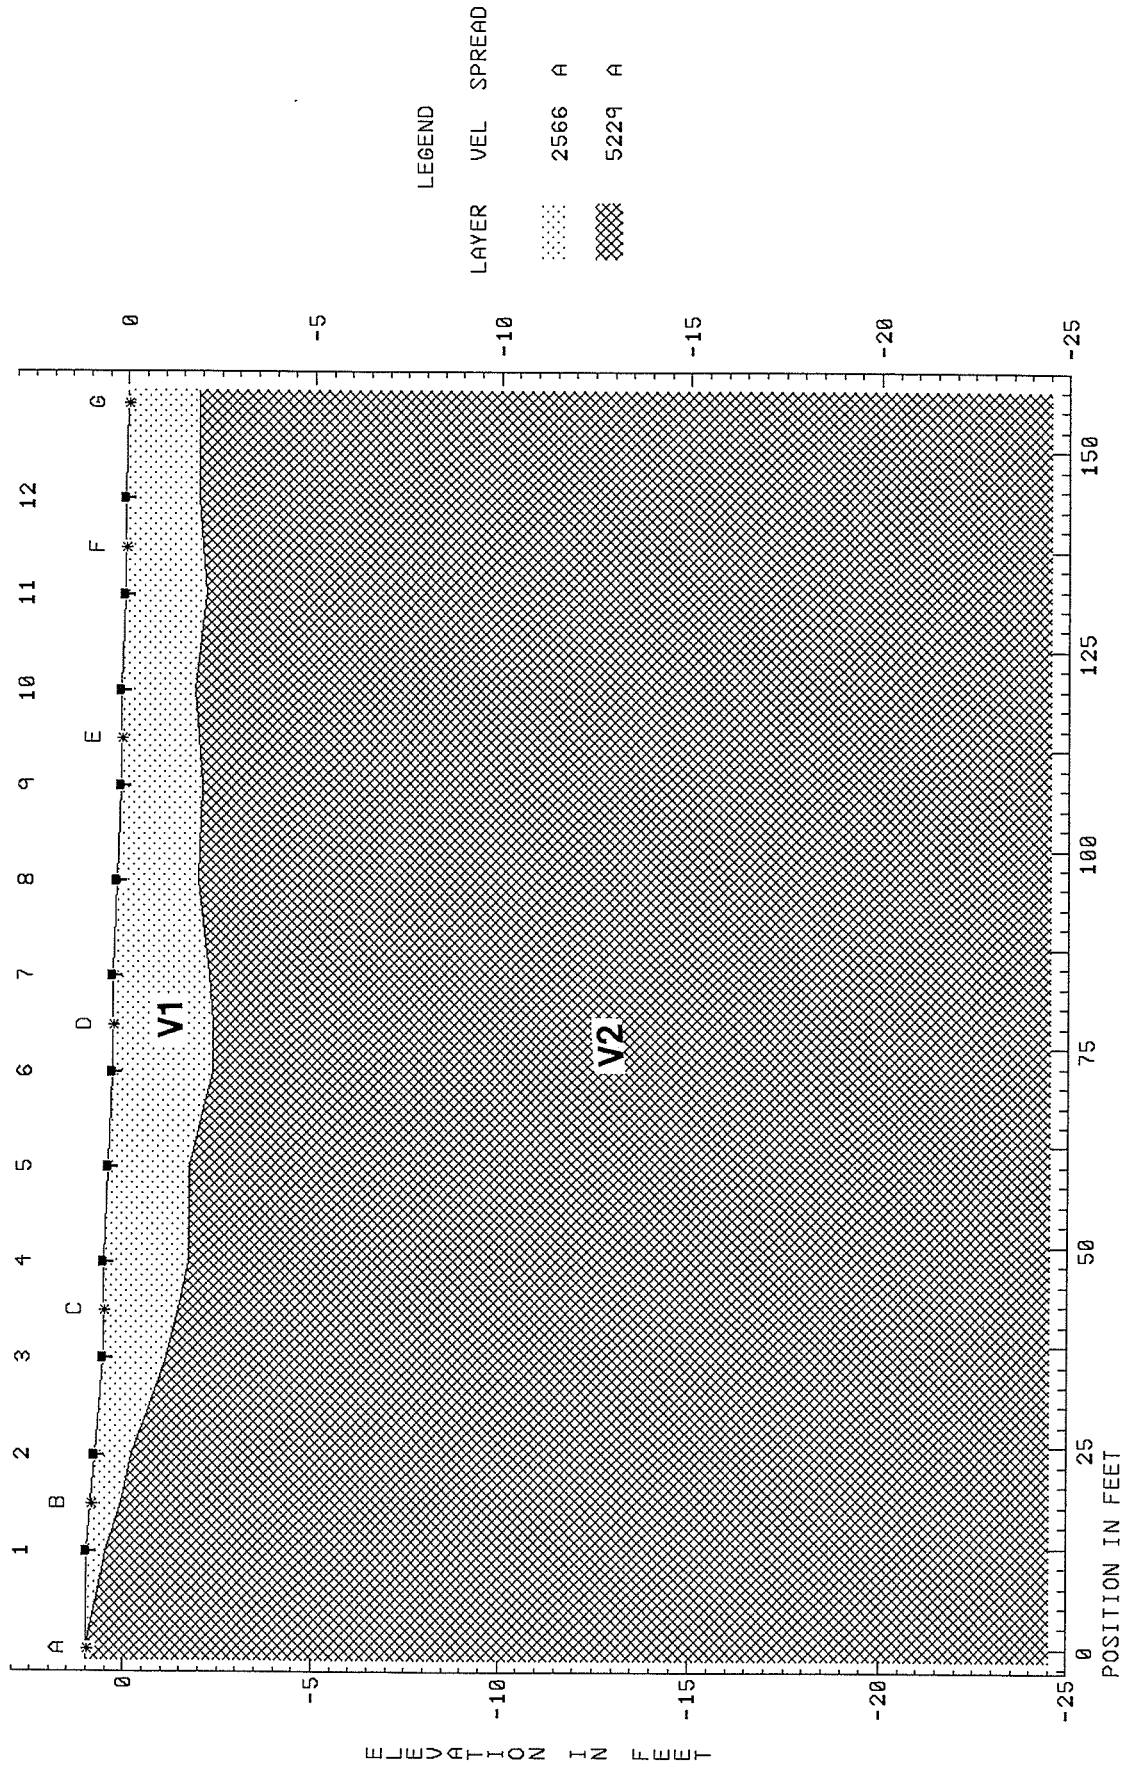


# LAYER VELOCITY PROFILE S-4

← East - West →

FILE 2224-4A.SIP  
SEISMIC LINE S-4

SPREAD A

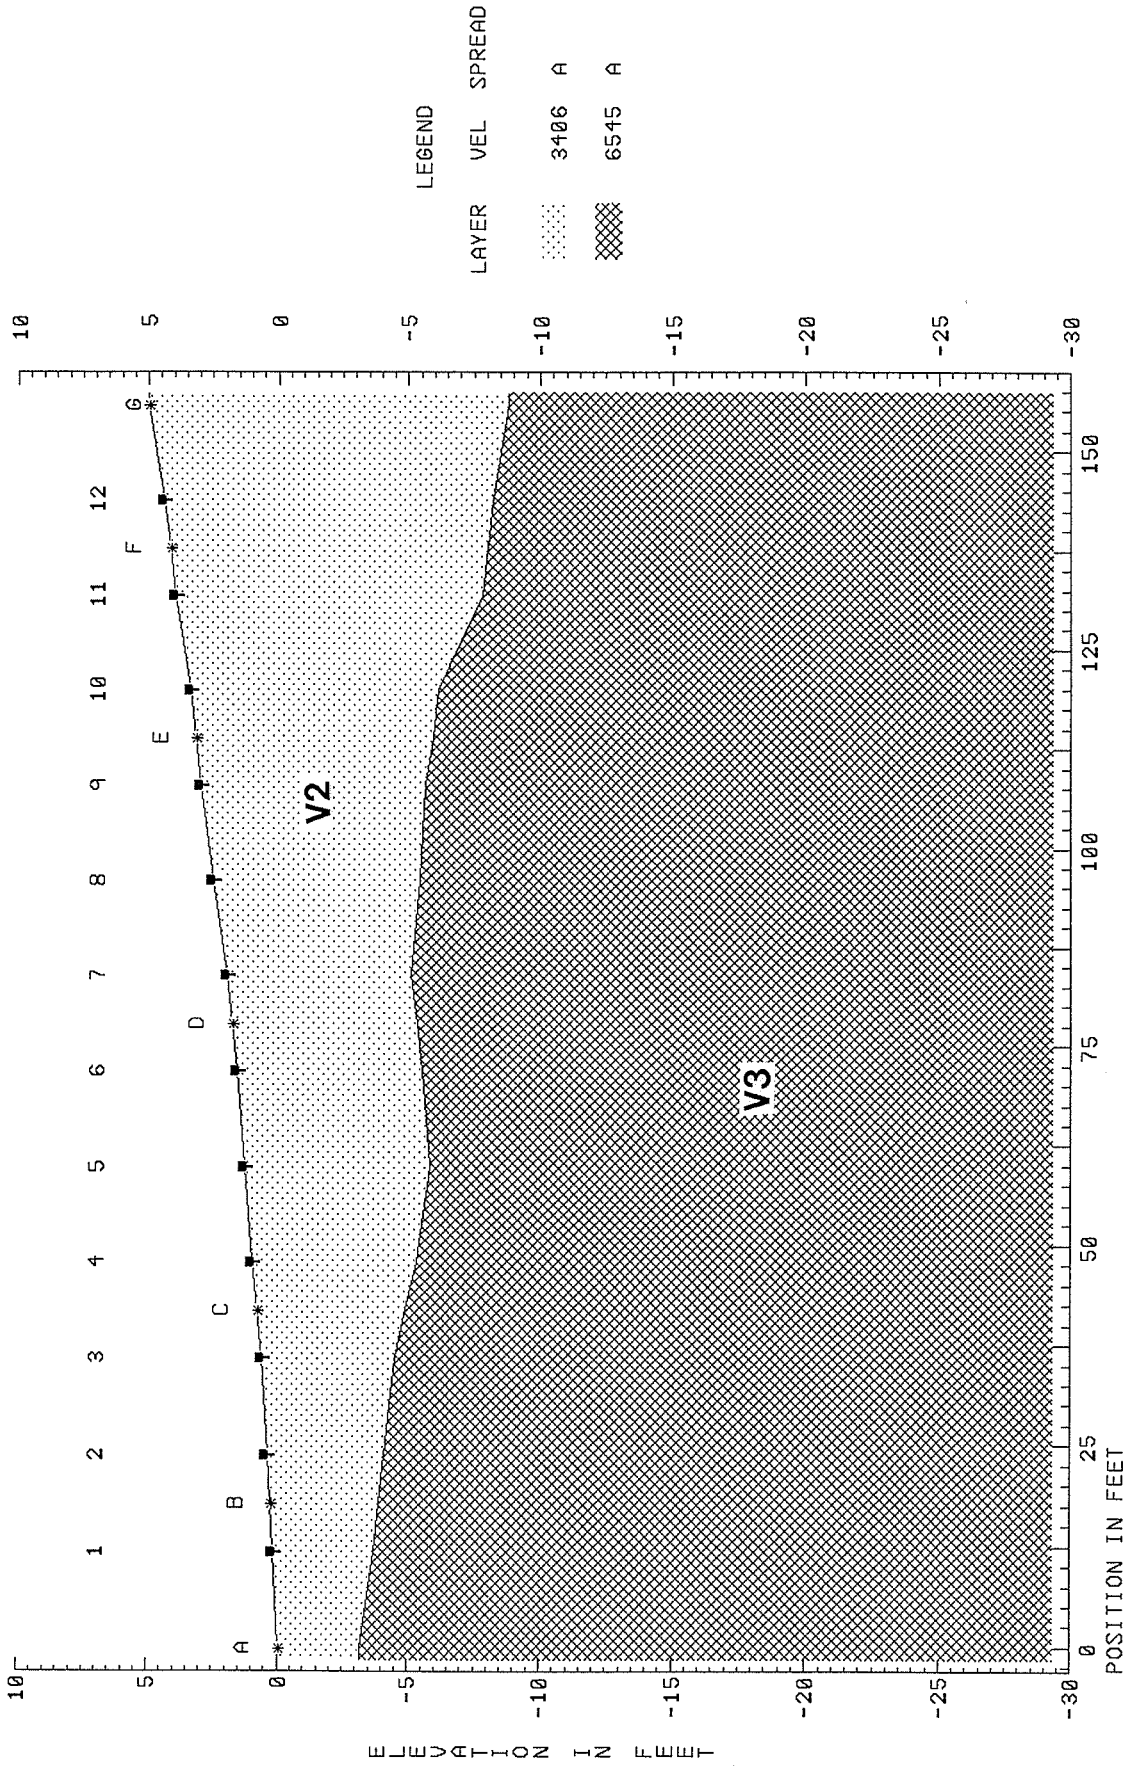

LEGEND


| LAYER           | VEL  | SPREAD |
|-----------------|------|--------|
| (Stippled)      | 3406 | A      |
| (Cross-hatched) | 6545 | A      |

# LAYER VELOCITY PROFILE S-5

← West - East →

FILE 2224-5.SIP  
SEISMIC LINE S-5

SPREAD A

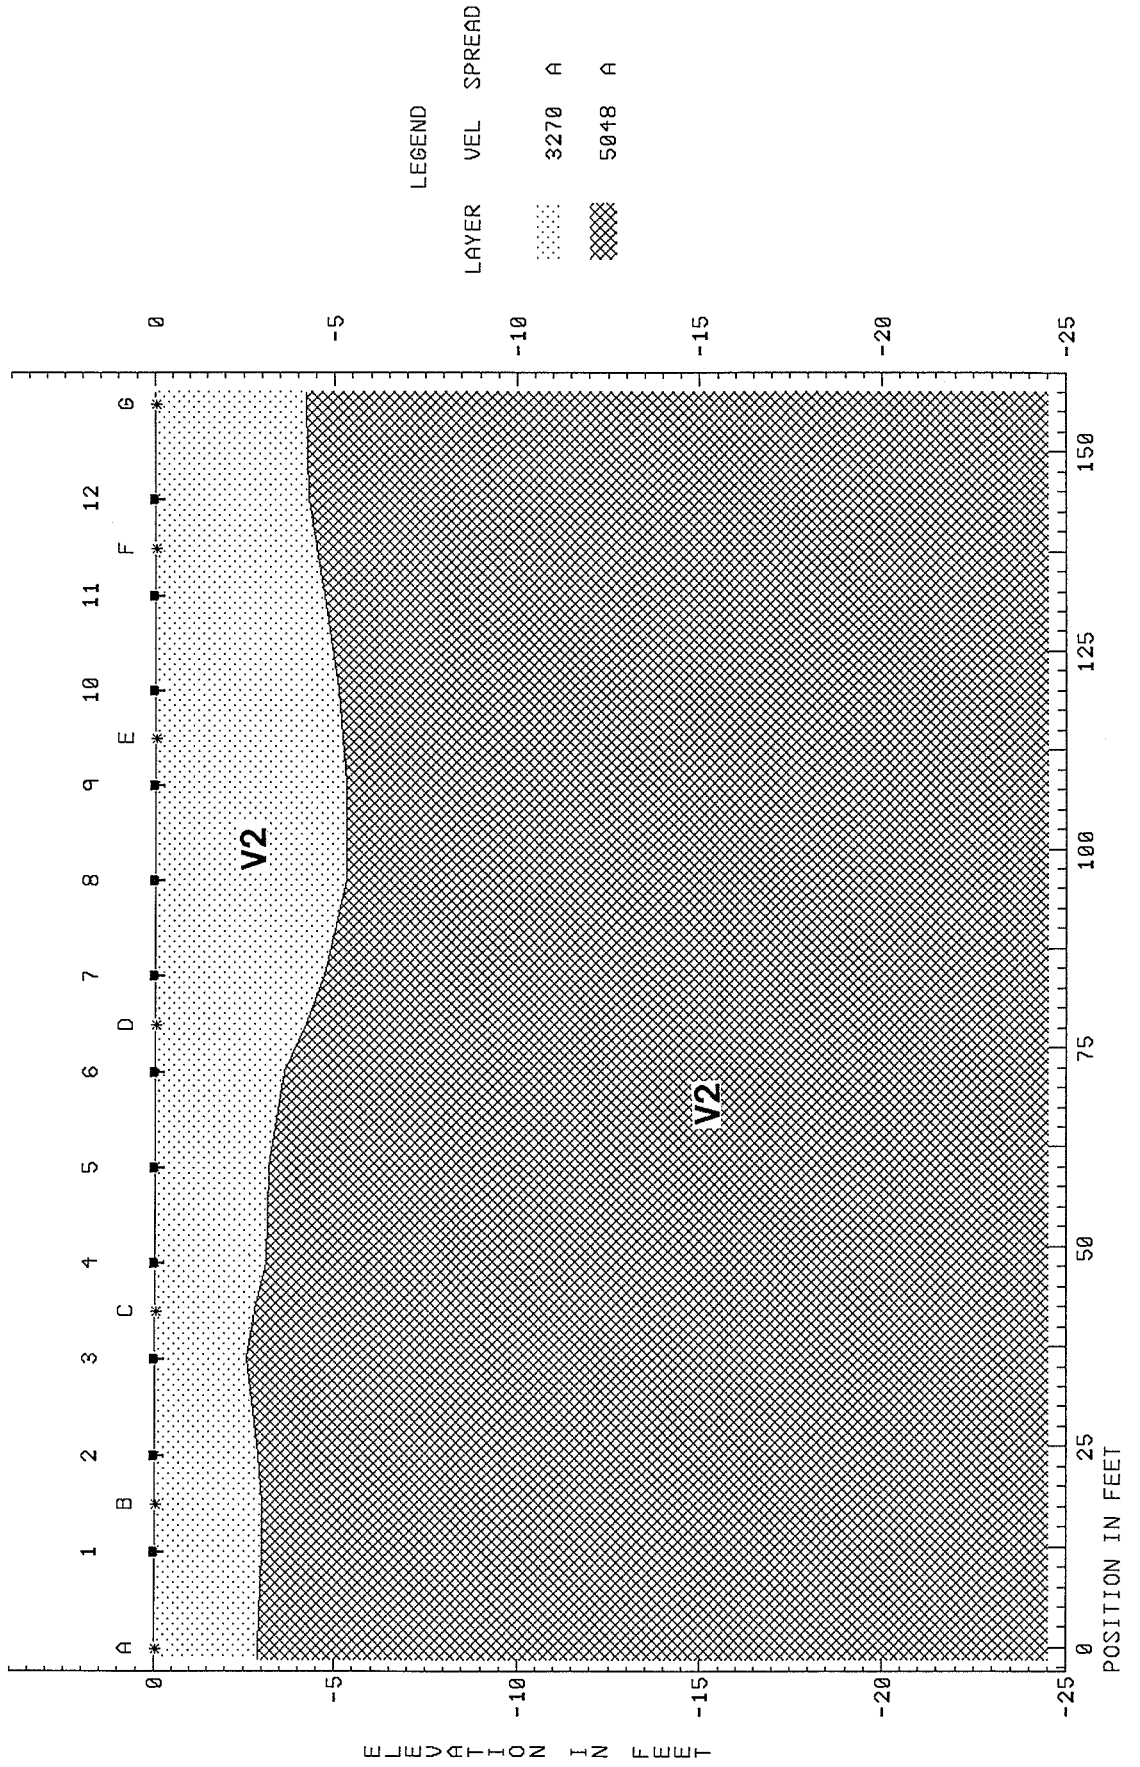


# LAYER VELOCITY PROFILE S-6

North 70° West →

FILE 2224-6.SIP  
SEISMIC LINE S-6

SPREAD A

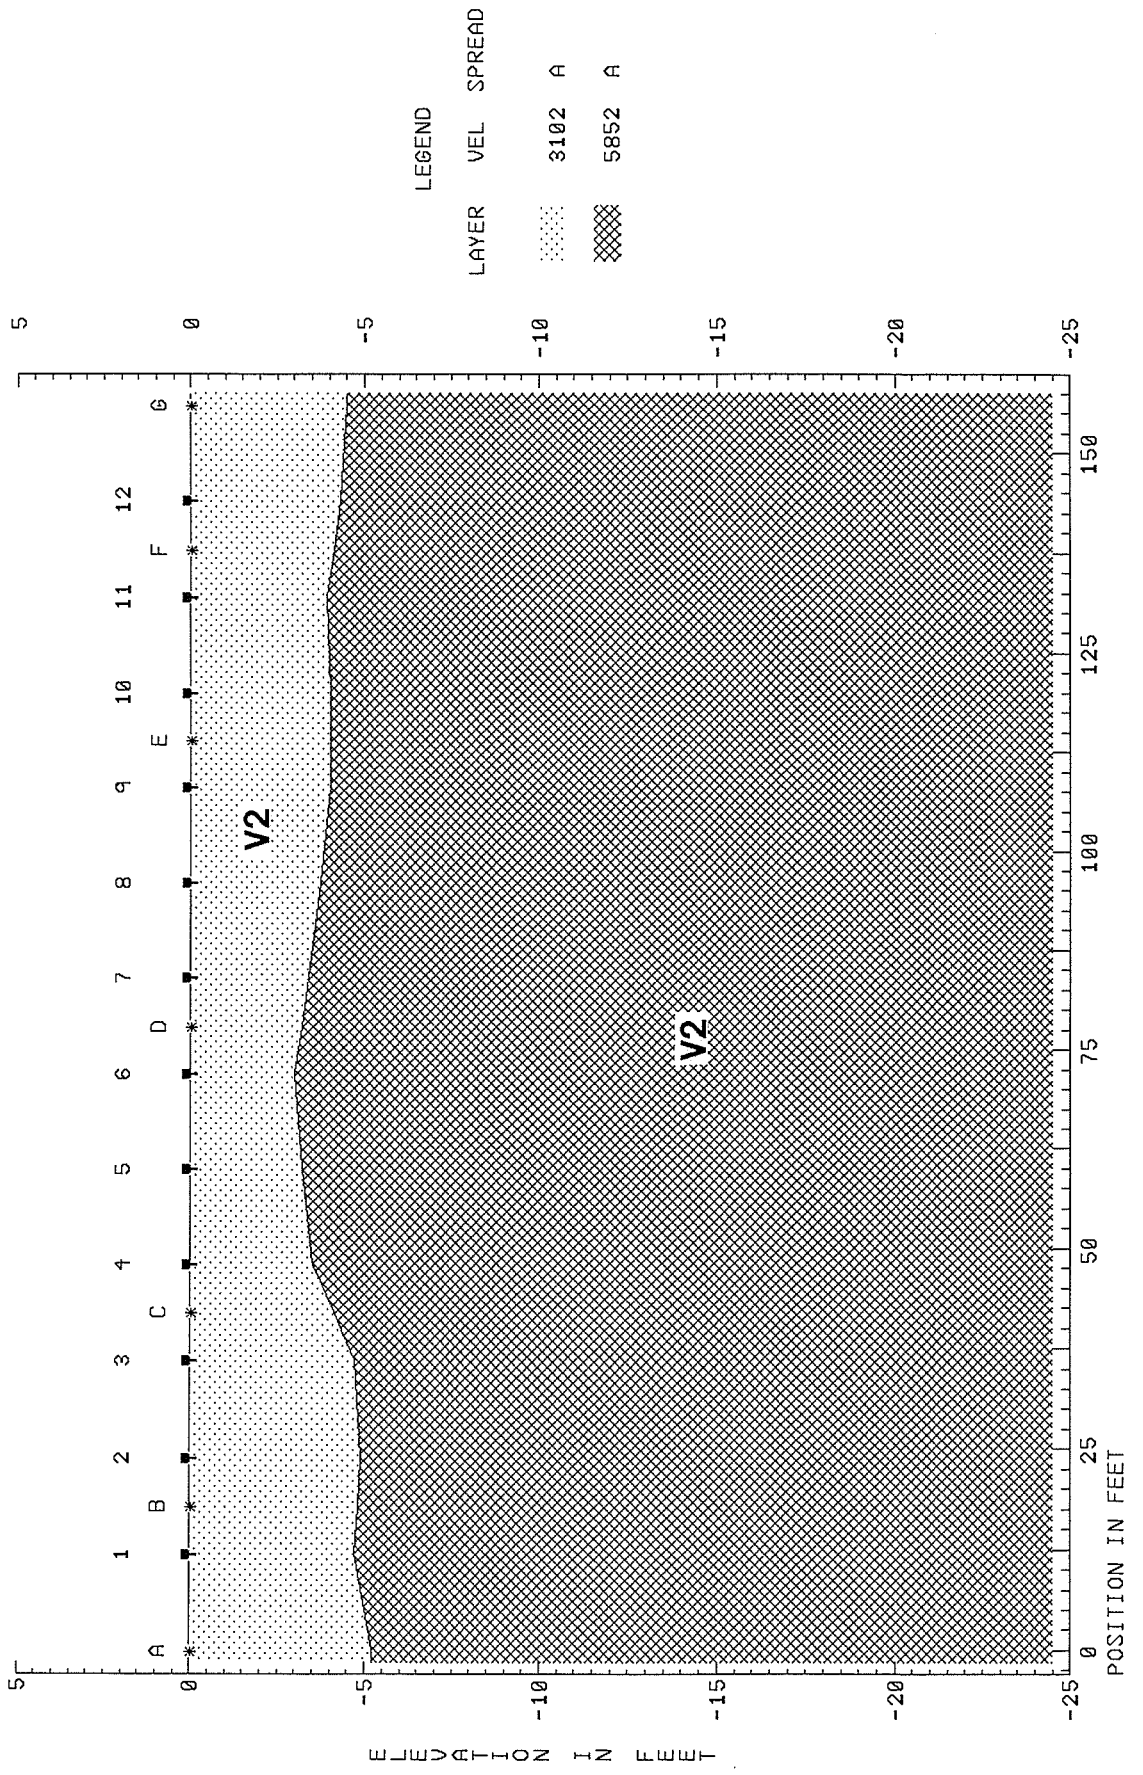


# LAYER VELOCITY PROFILE S-7

← North - South →

FILE 2224-7.SIP  
SEISMIC LINE S-7

SPREAD A

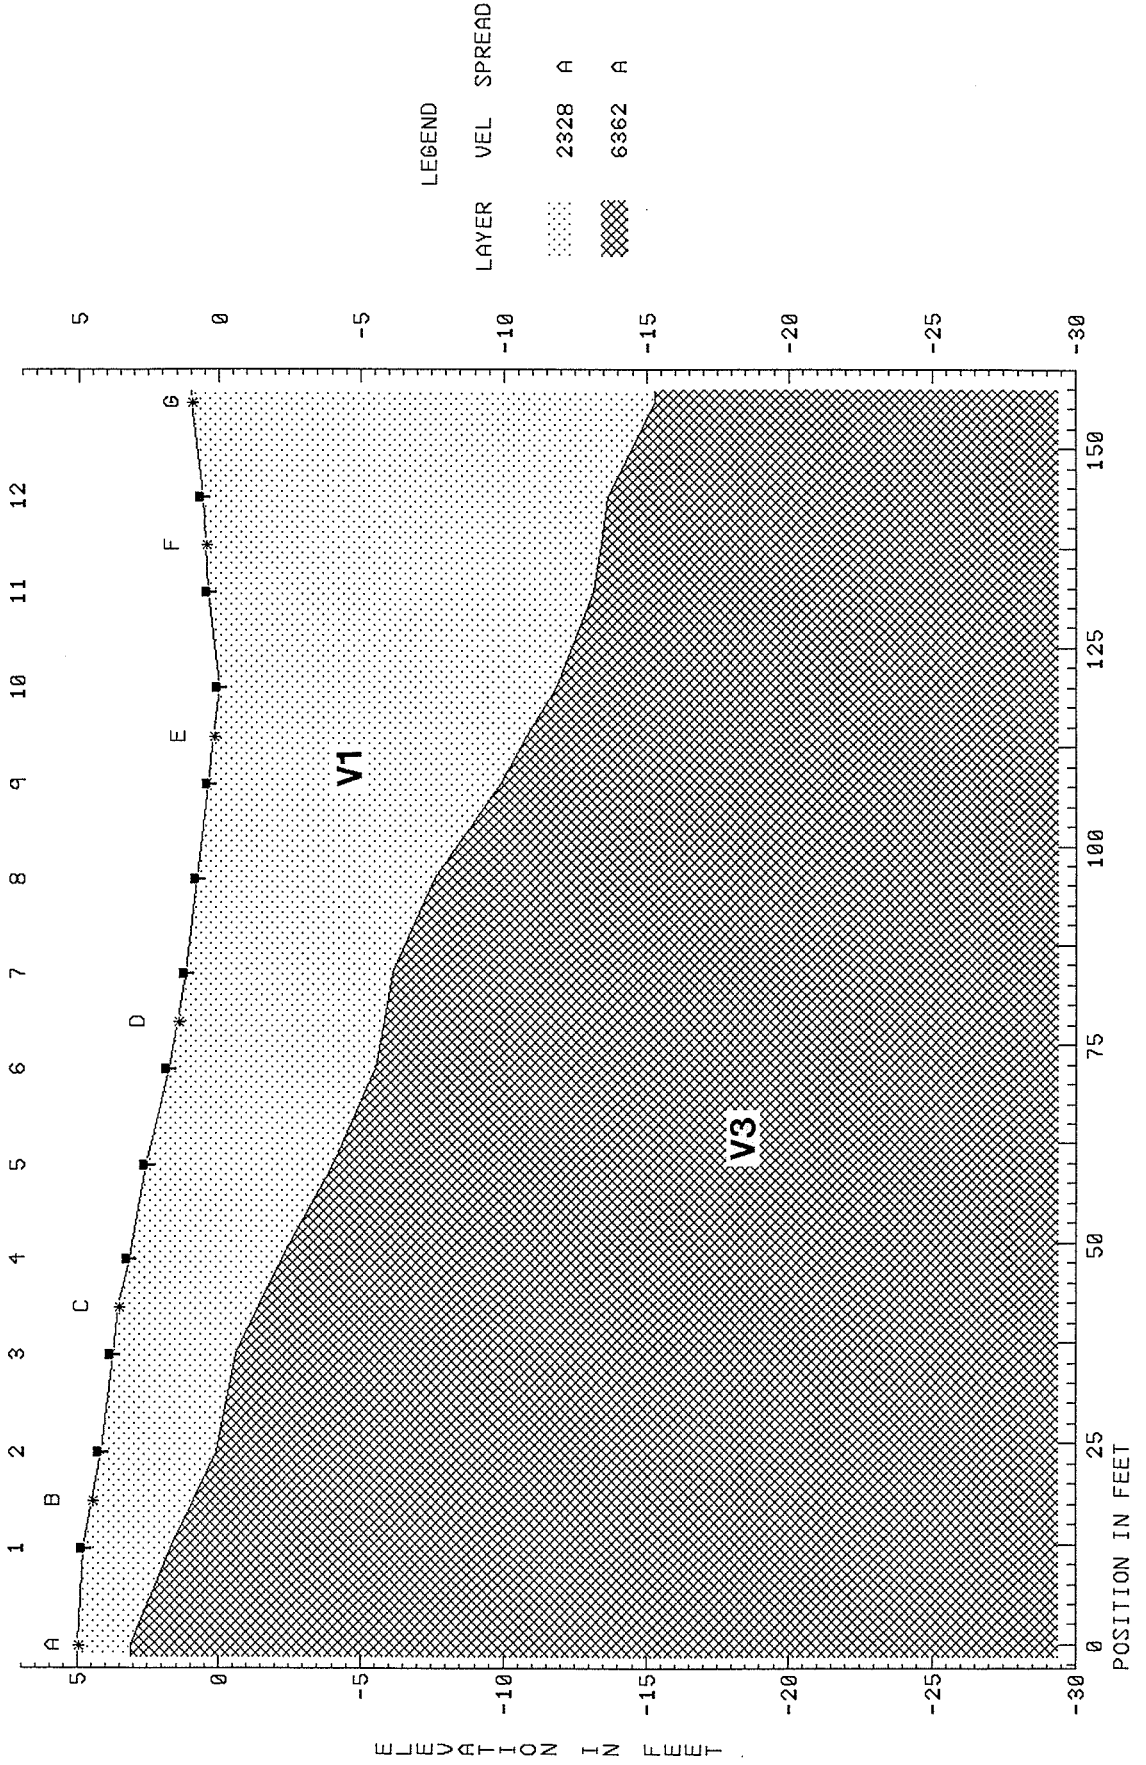




# LAYER VELOCITY PROFILE S-8

South 75° West →

FILE 2224-8.SIP  
SEISMIC LINE S-8

SPREAD A

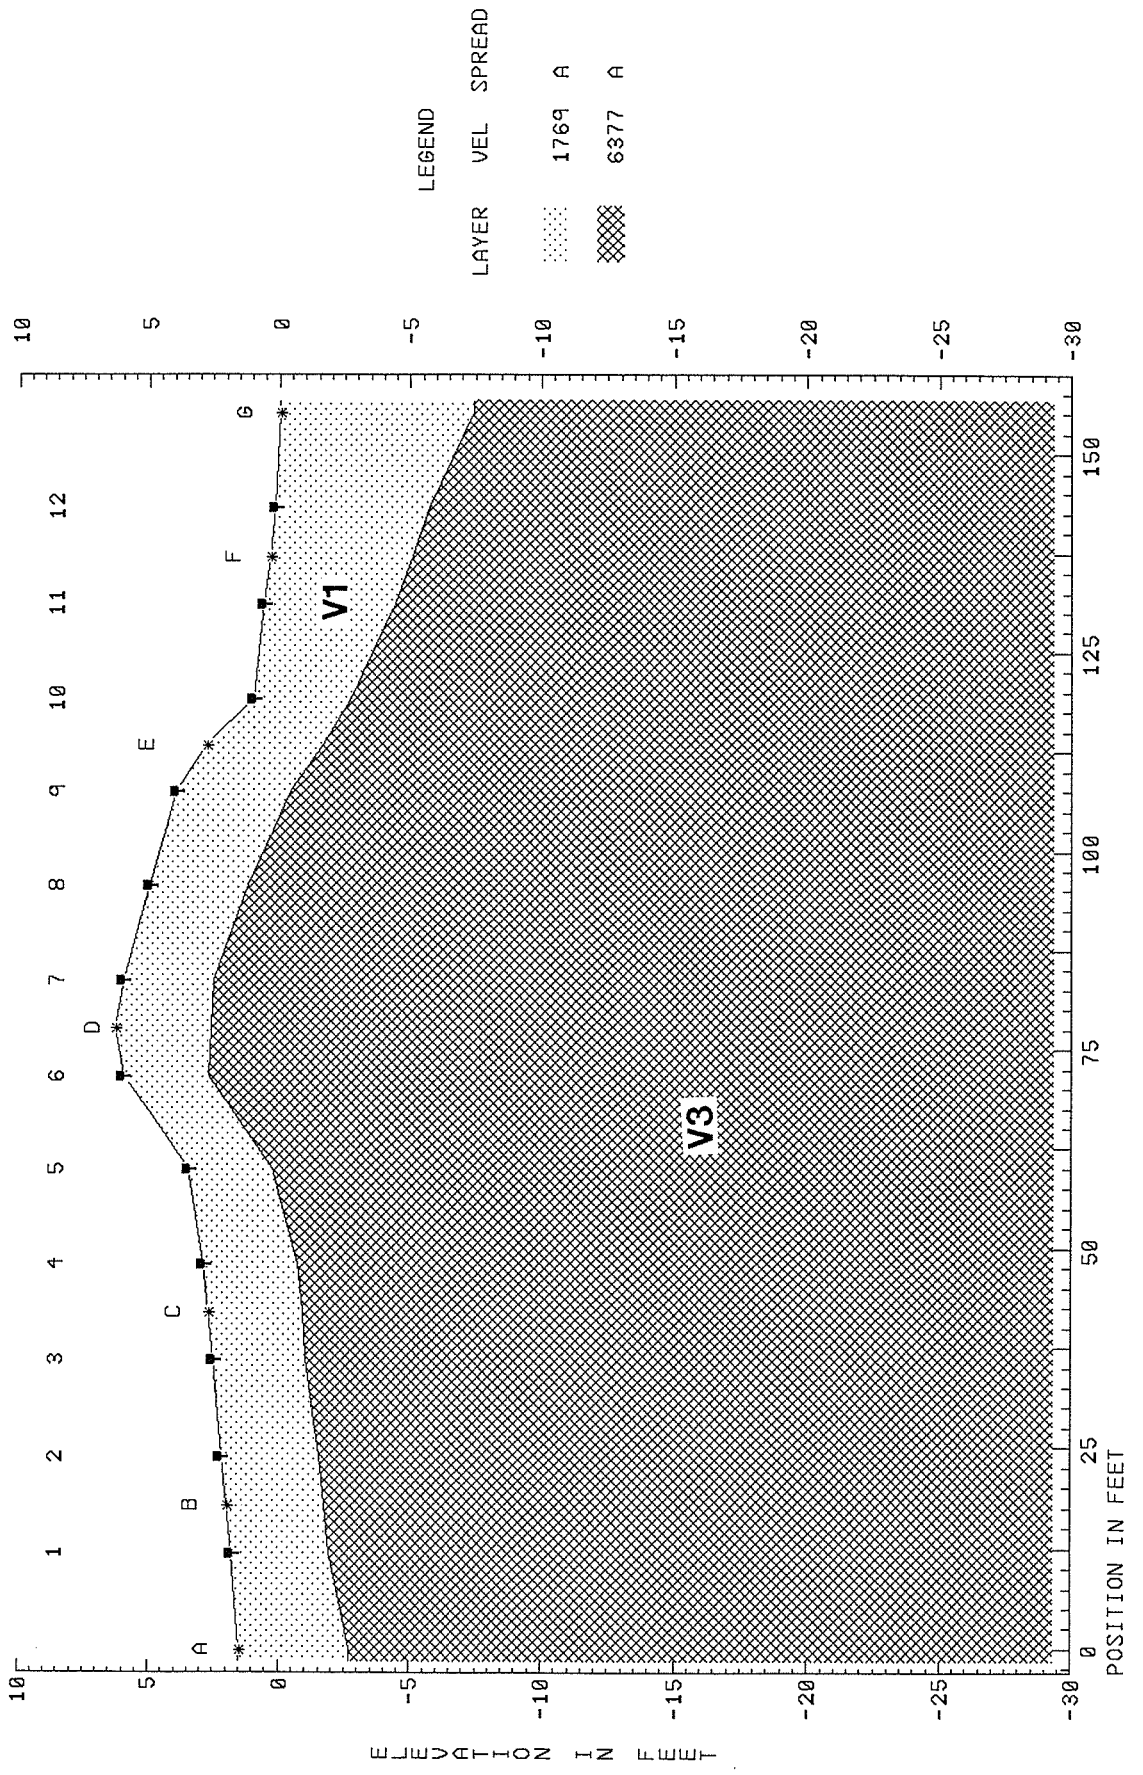


# LAYER VELOCITY PROFILE S-9

← East - West →

FILE 2224-9.SIP  
SEISMIC LINE S-9

SPREAD A

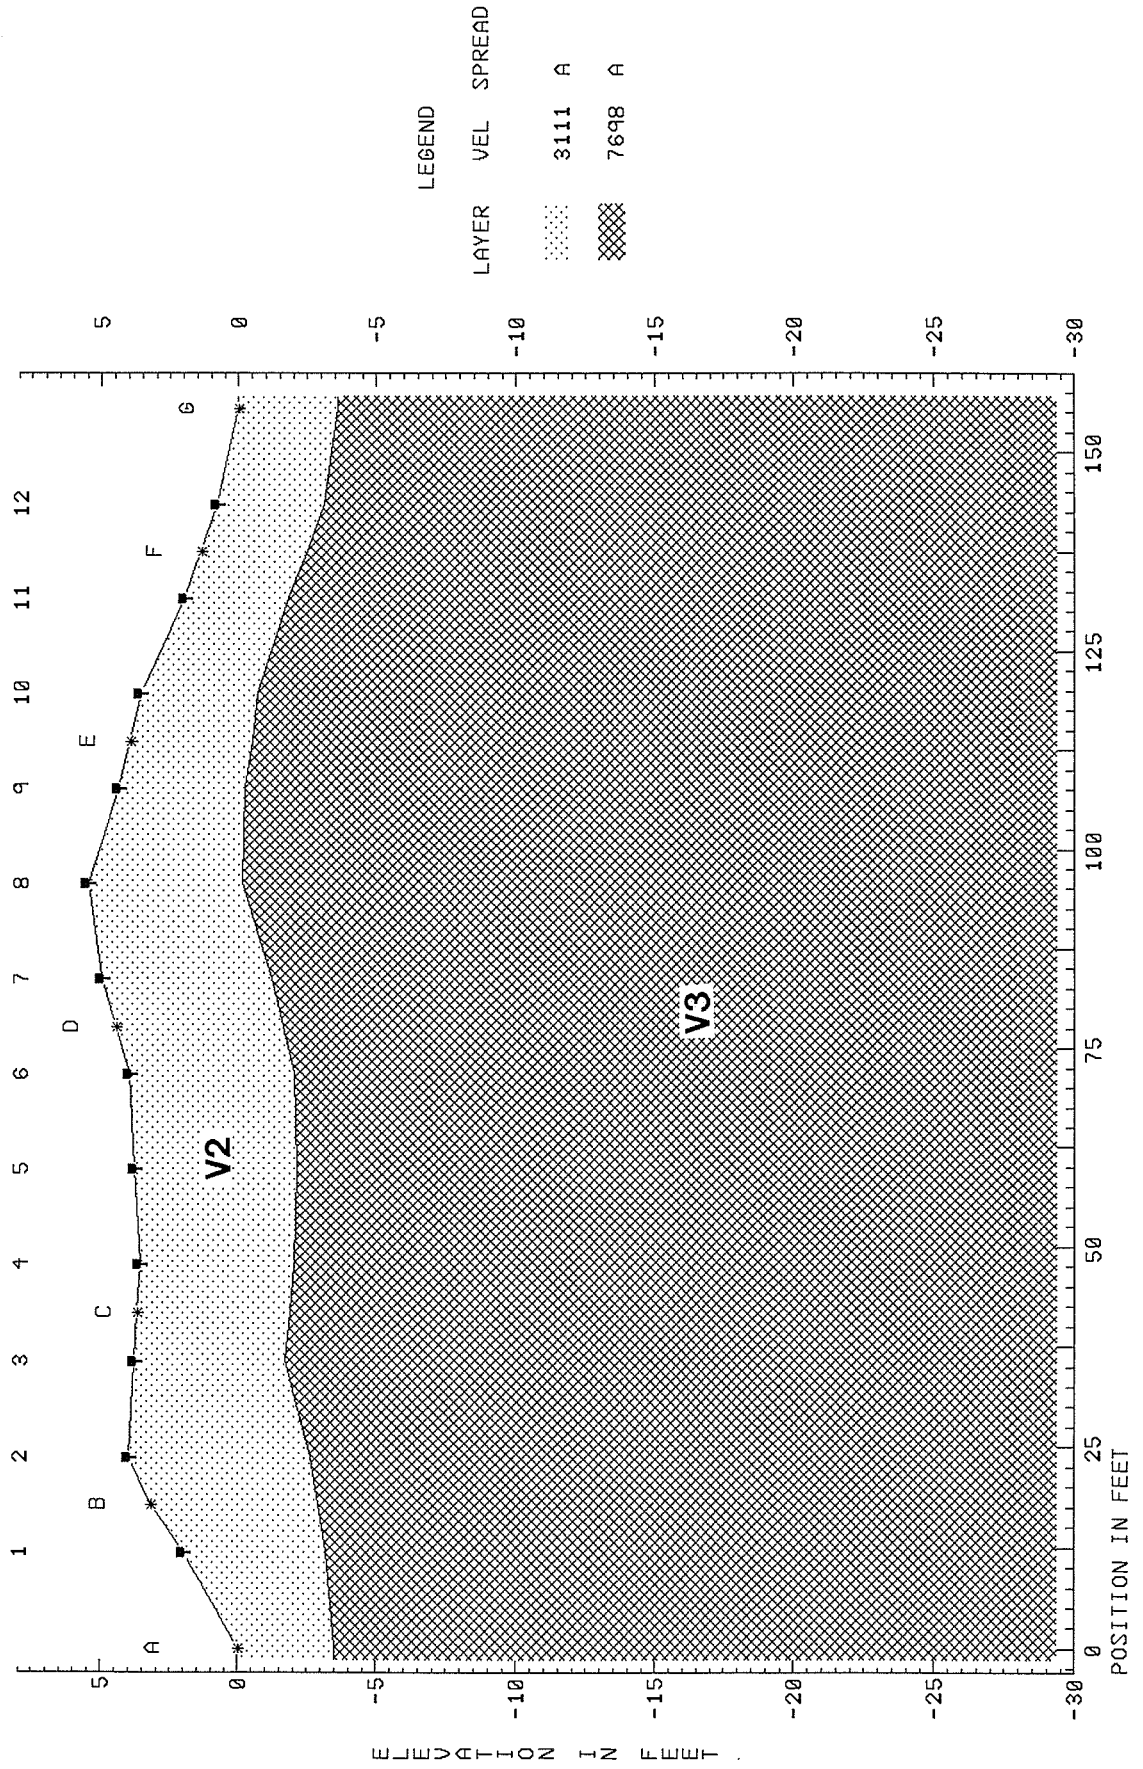


# LAYER VELOCITY PROFILE S-10

South 15° East →

FILE 2224-10.SIP  
SEISMIC LINE S-10

SPREAD A

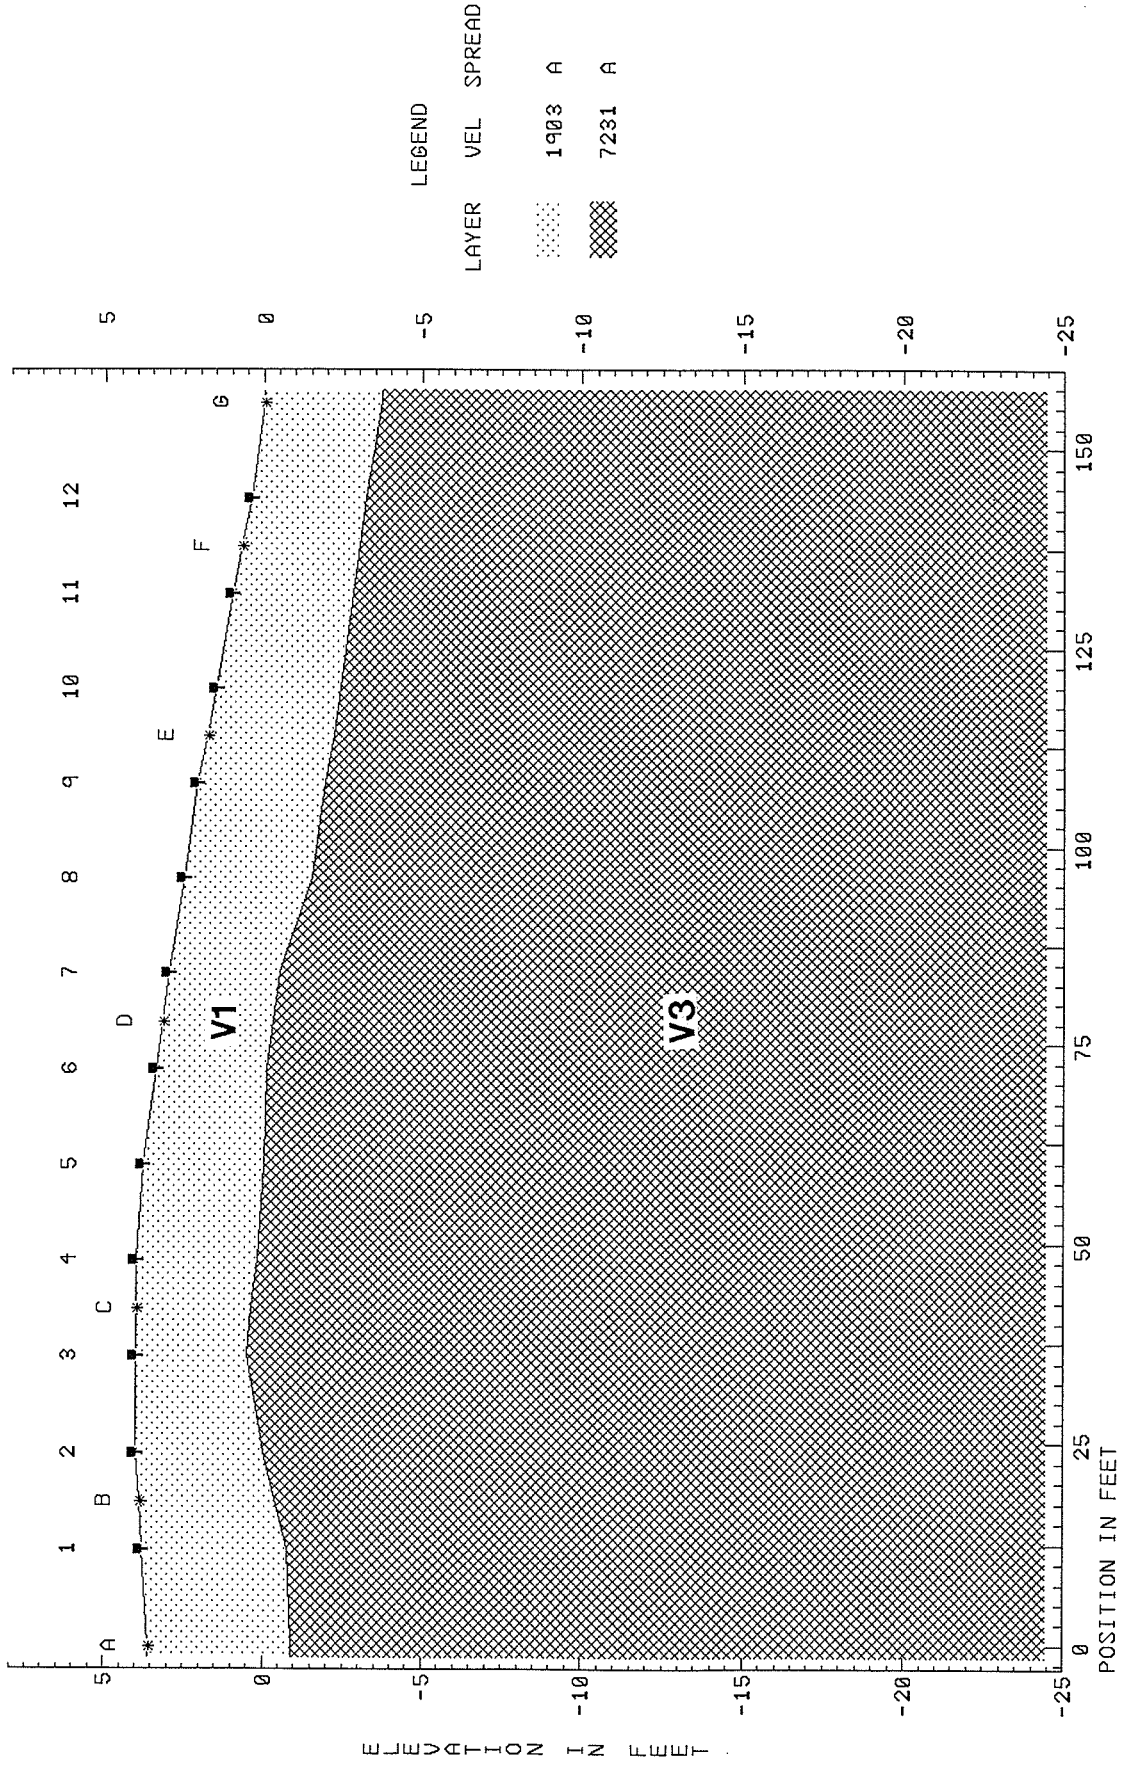




# LAYER VELOCITY PROFILE S-11

North 40° West →

FILE 2224-11 .SIP  
SEISMIC LINE S-11

SPREAD A

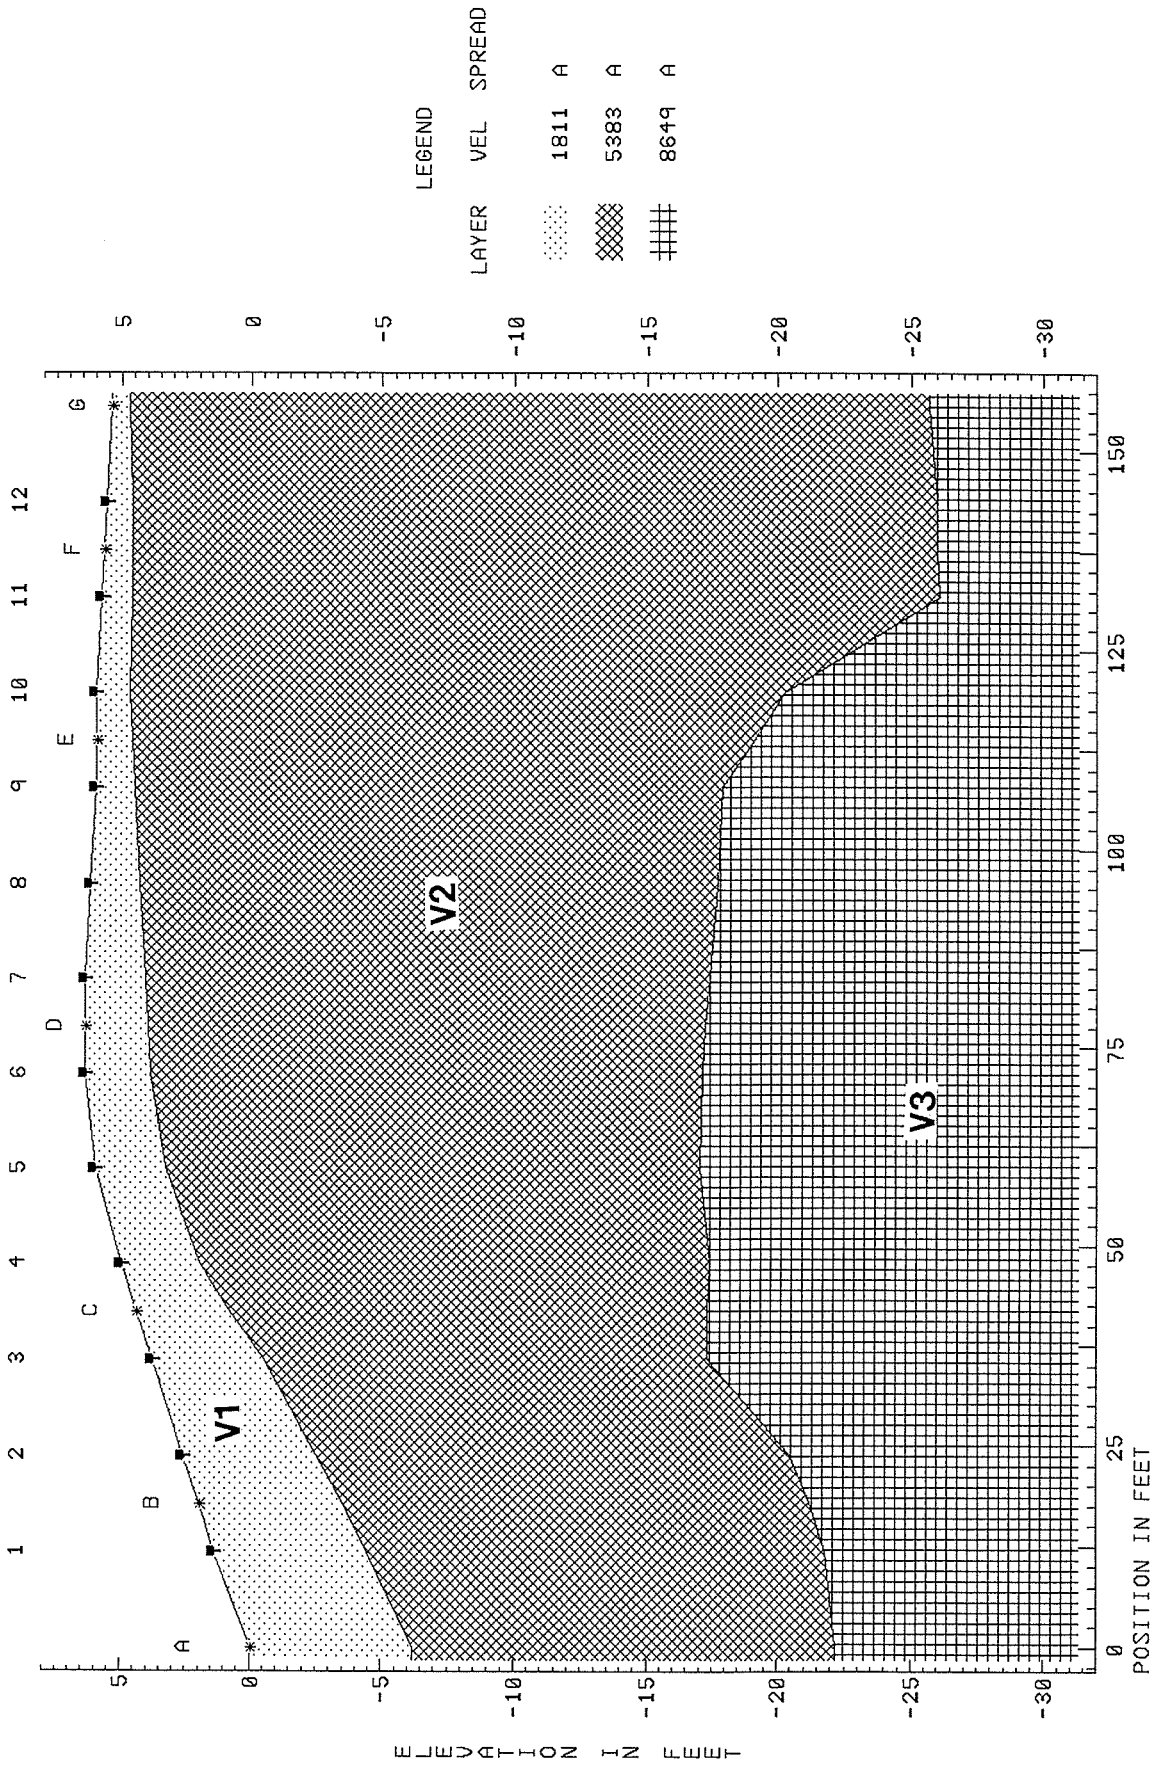


# LAYER VELOCITY PROFILE S-12

South 60° East →

FILE 2224-12.SIP  
SEISMIC LINE S-12


SPREAD A

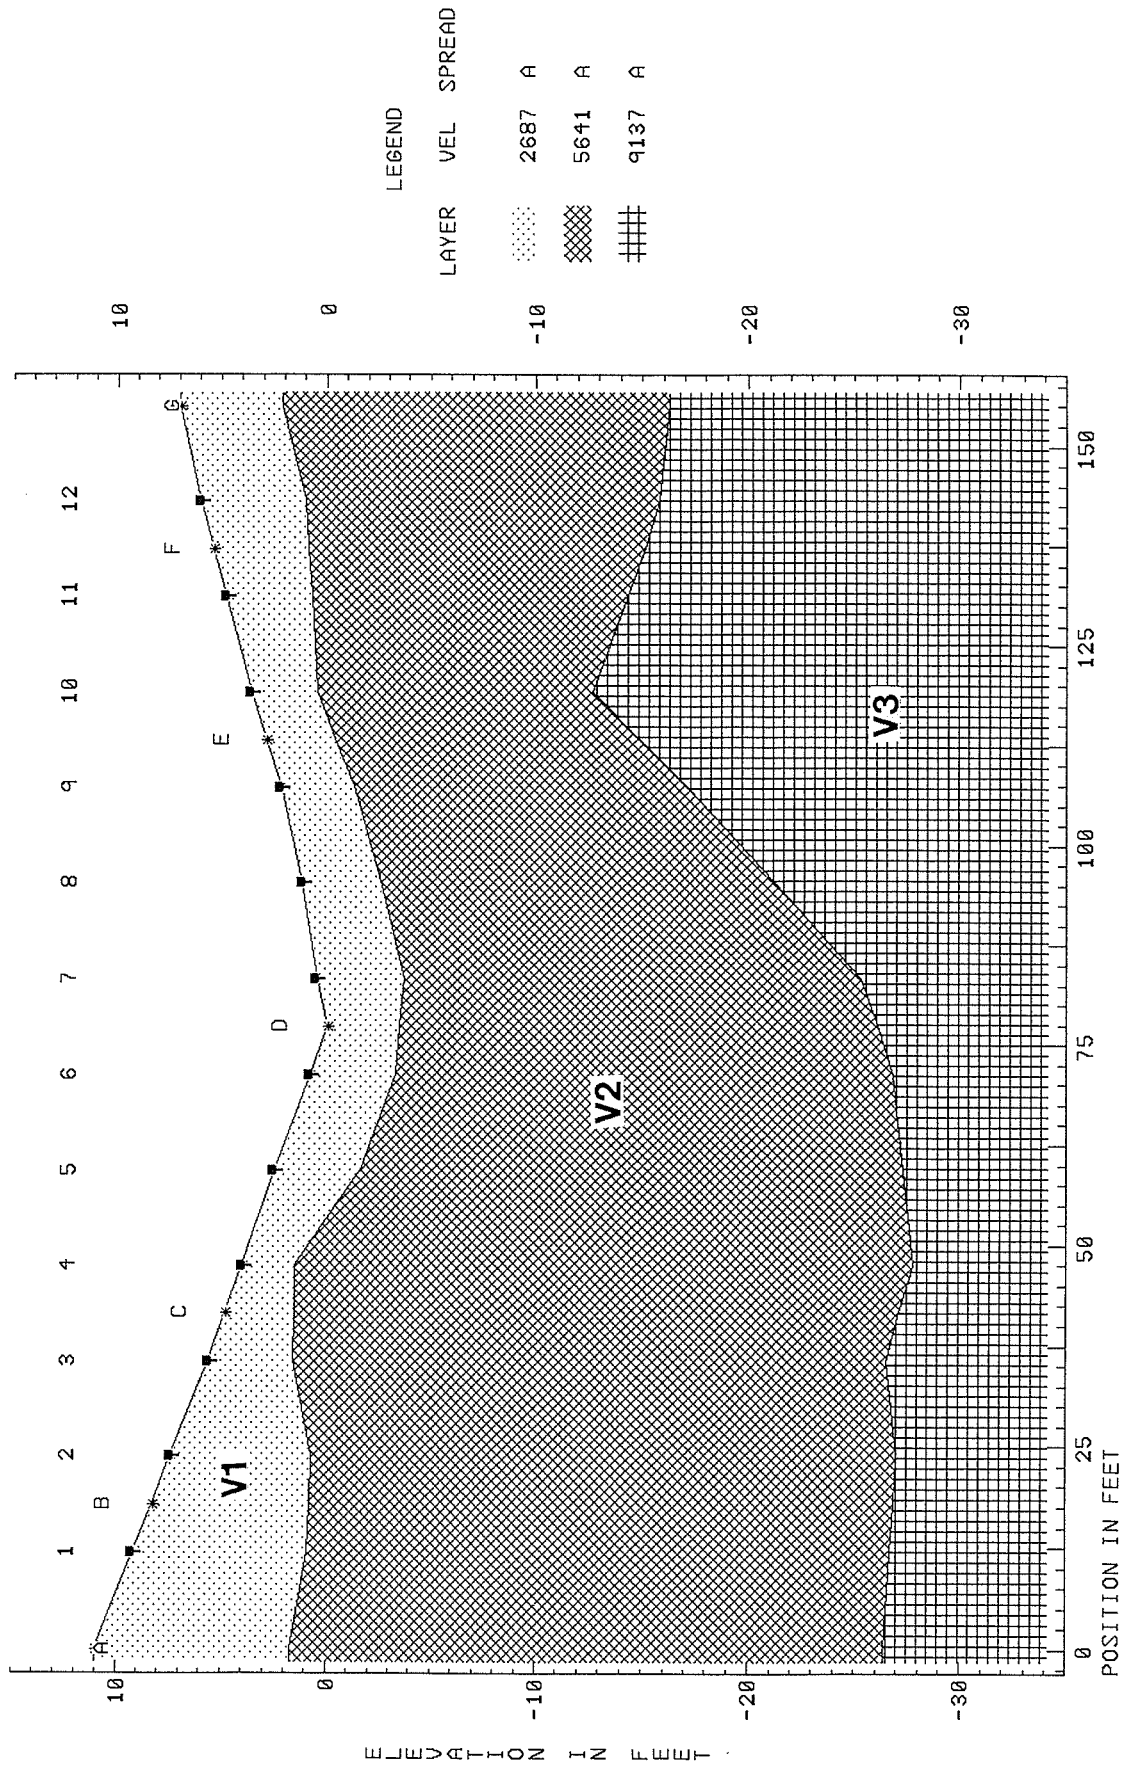

# **APPENDIX B**




## **TOMOGRAPHIC MODELS**

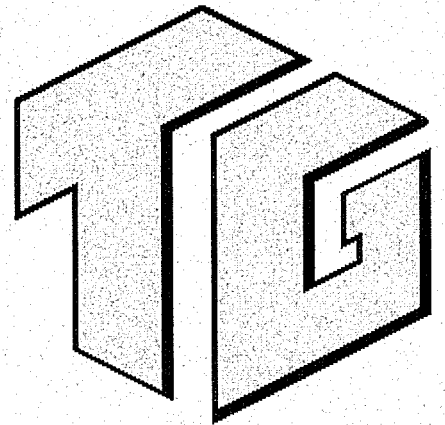

# SEISMIC LINE S-1

← West - East →


## TOMOGRAPHIC MODEL

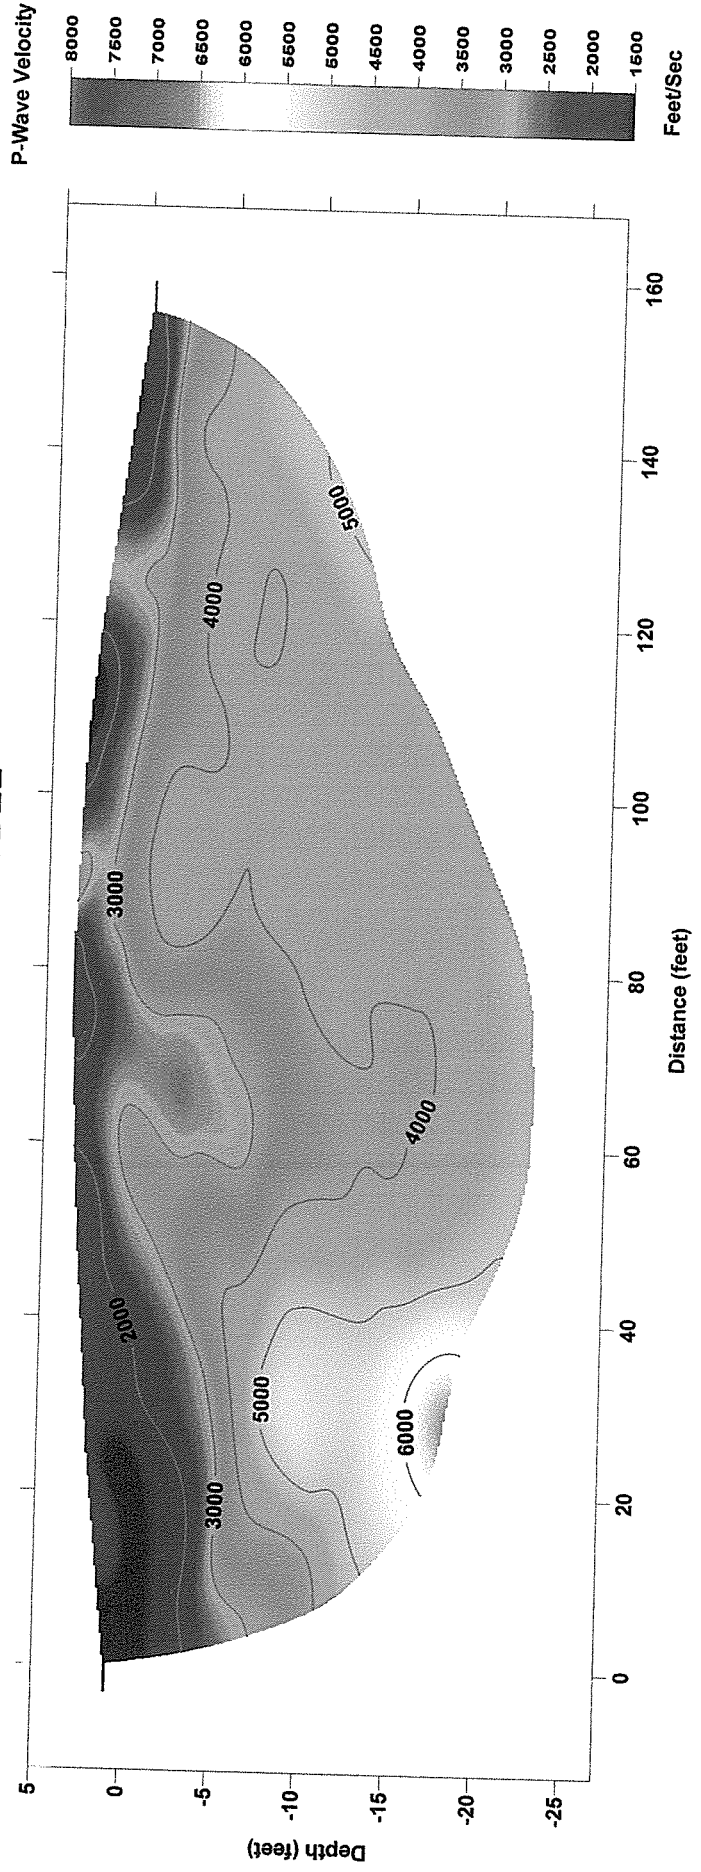

# SEISMIC LINE S-2

North 55 West →


## TOMOGRAPHIC MODEL

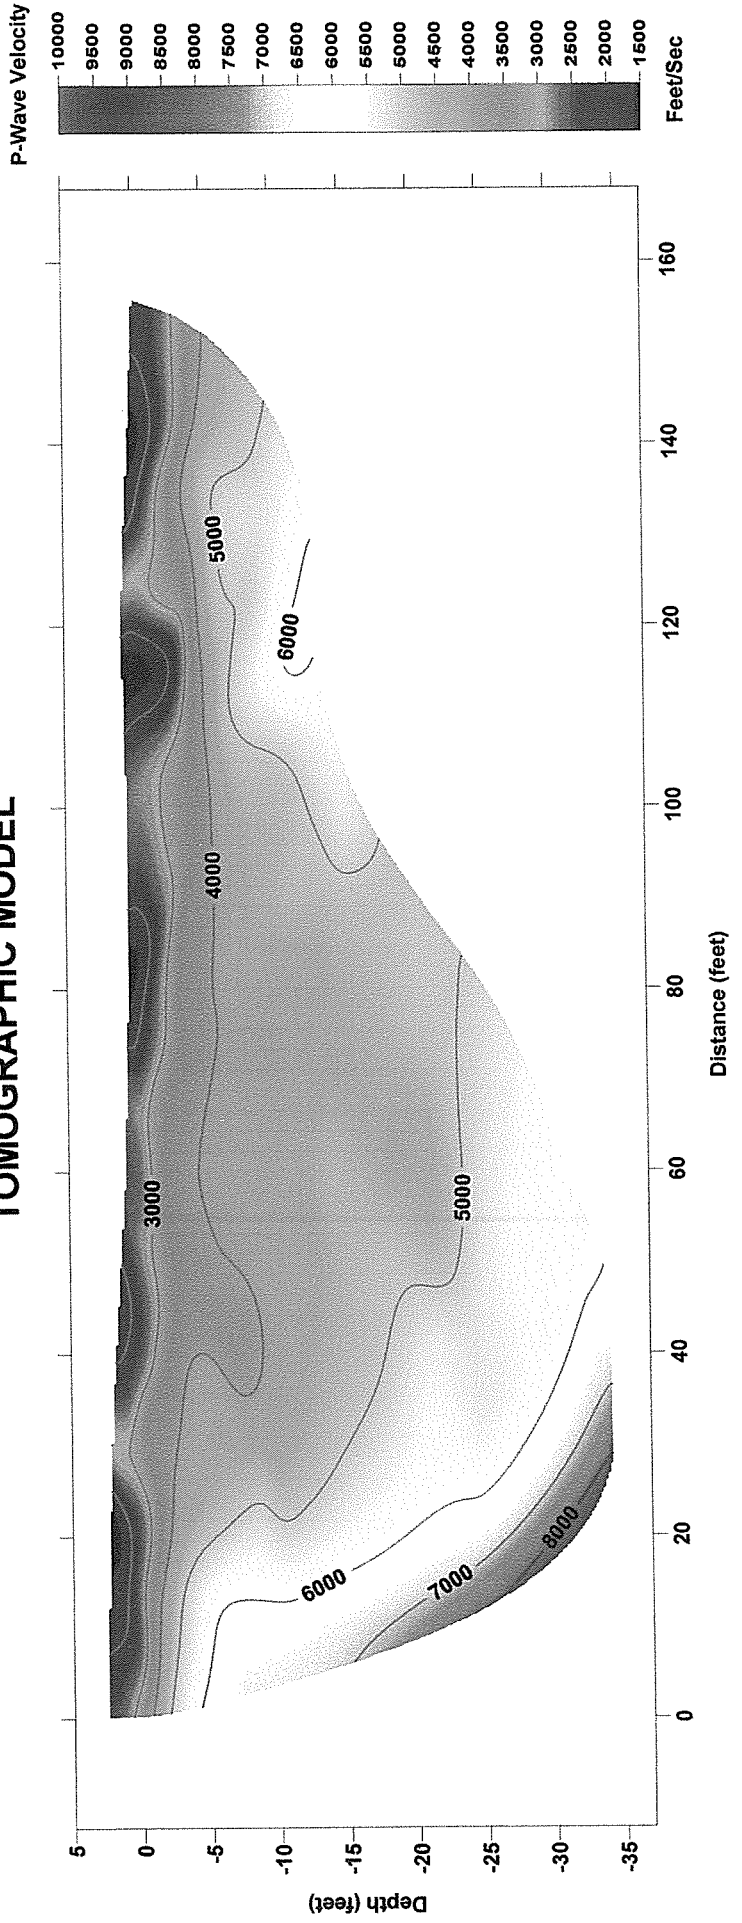

# SEISMIC LINE S-3

North 25 West →


## TOMOGRAPHIC MODEL

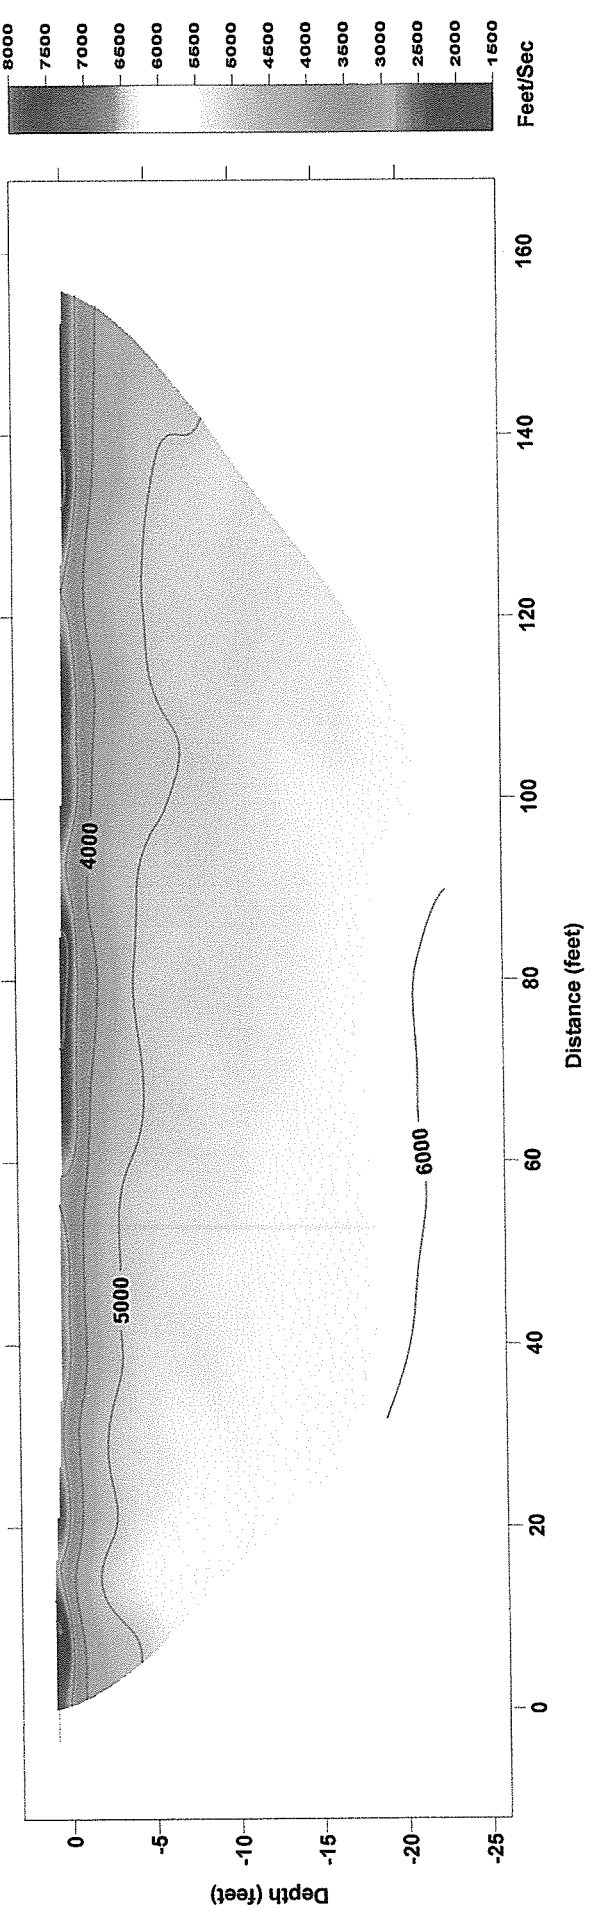

# SEISMIC LINE S-4

← East - West →


## TOMOGRAPHIC MODEL

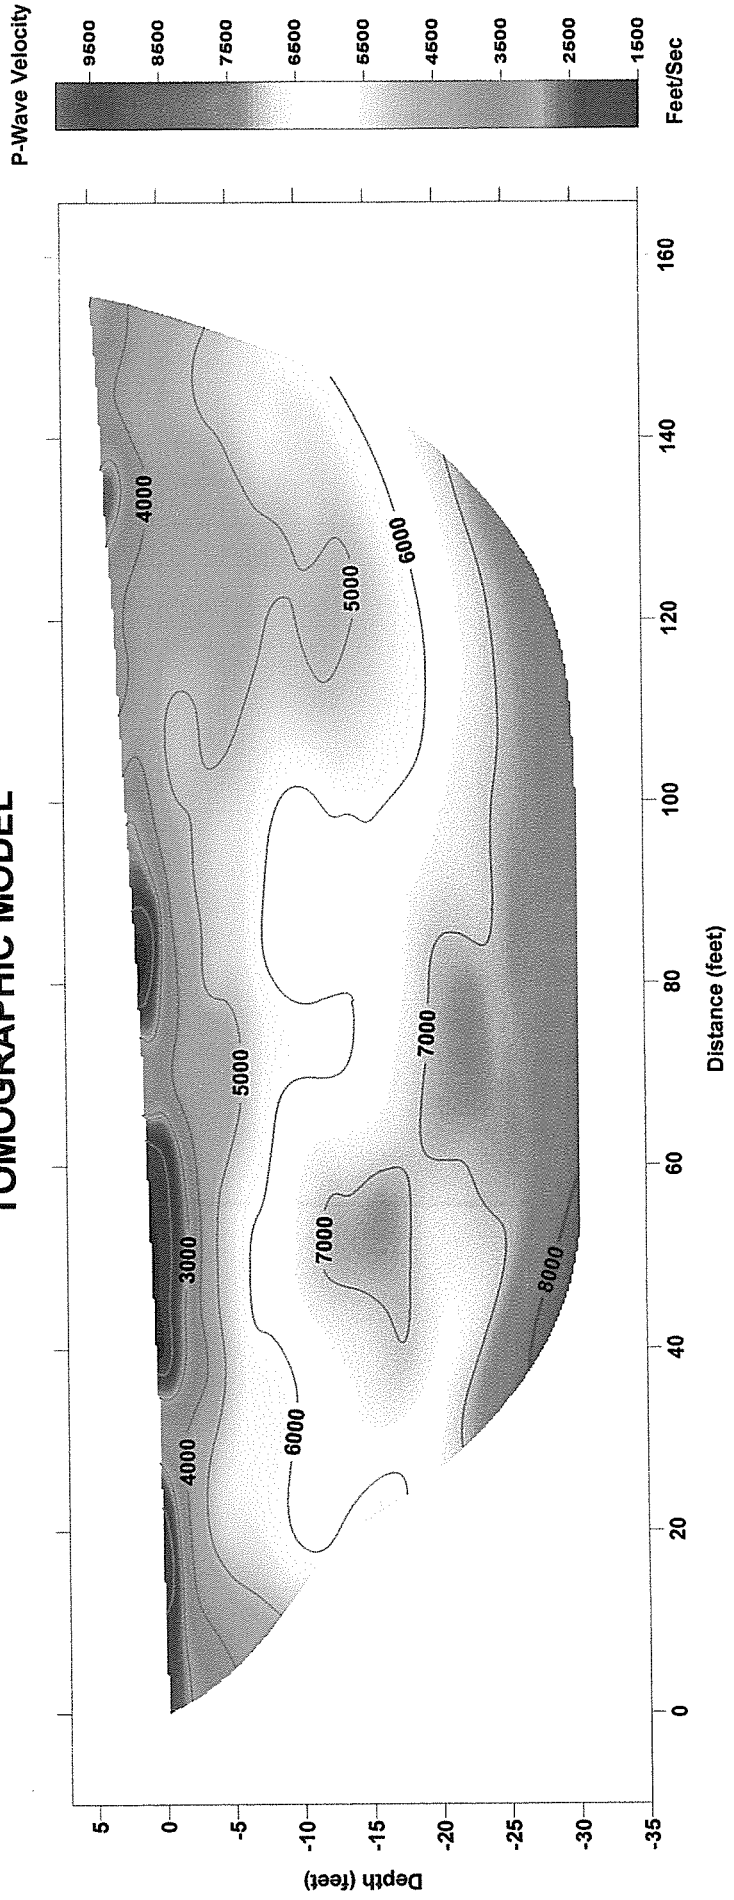

# SEISMIC LINE S-5

← West - East →

## TOMOGRAPHIC MODEL

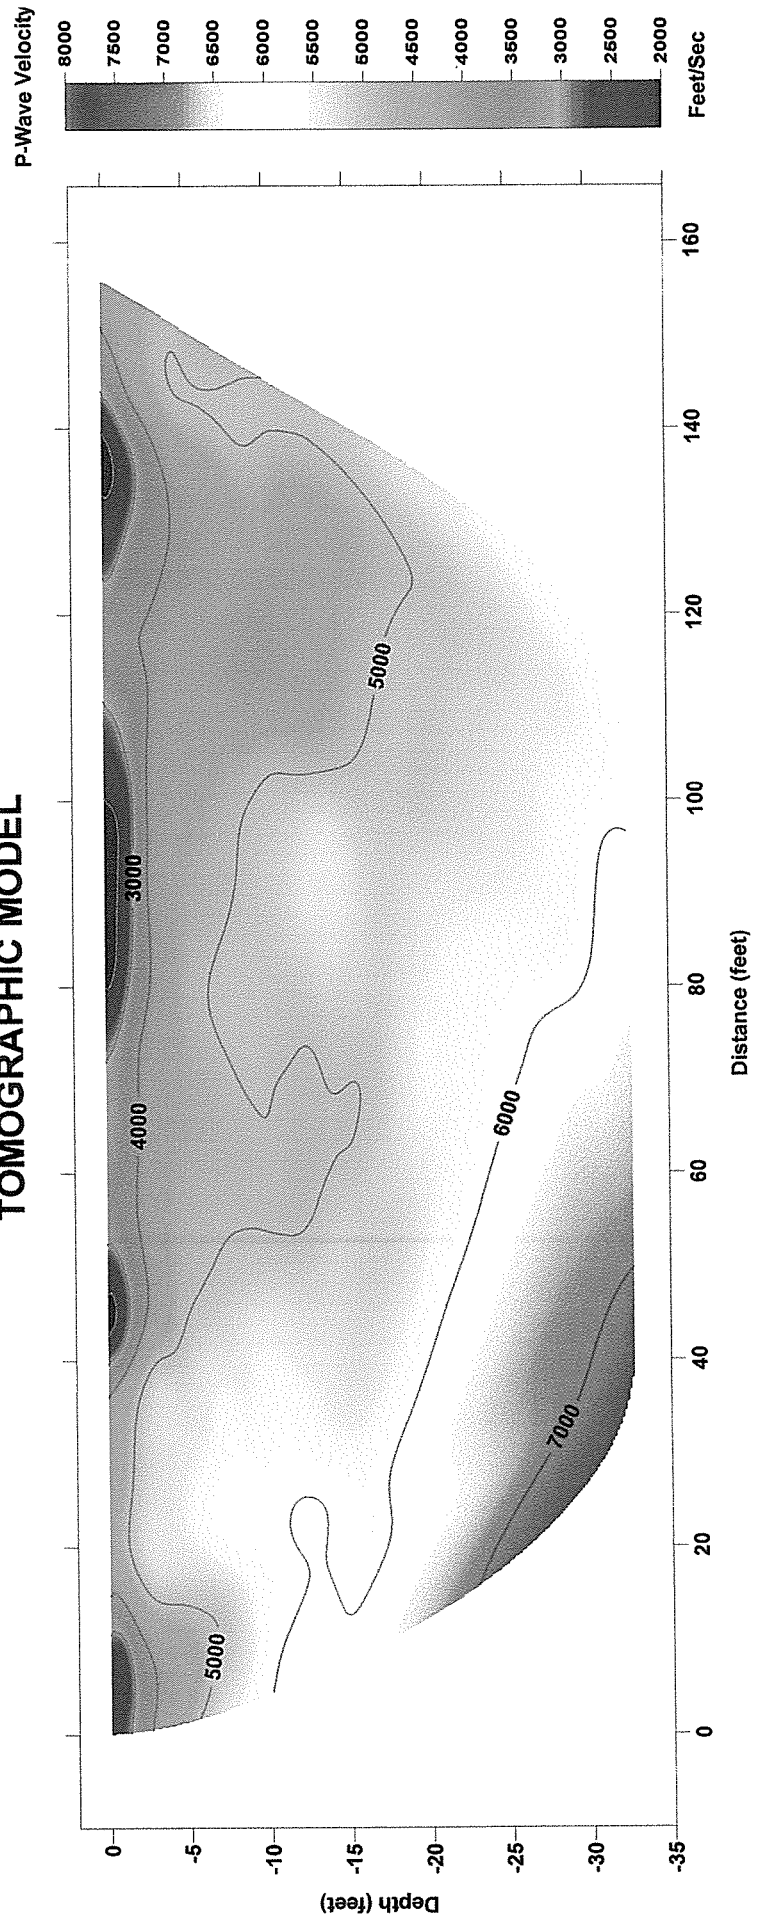




# SEISMIC LINE S-6

North 70 West →


## TOMOGRAPHIC MODEL

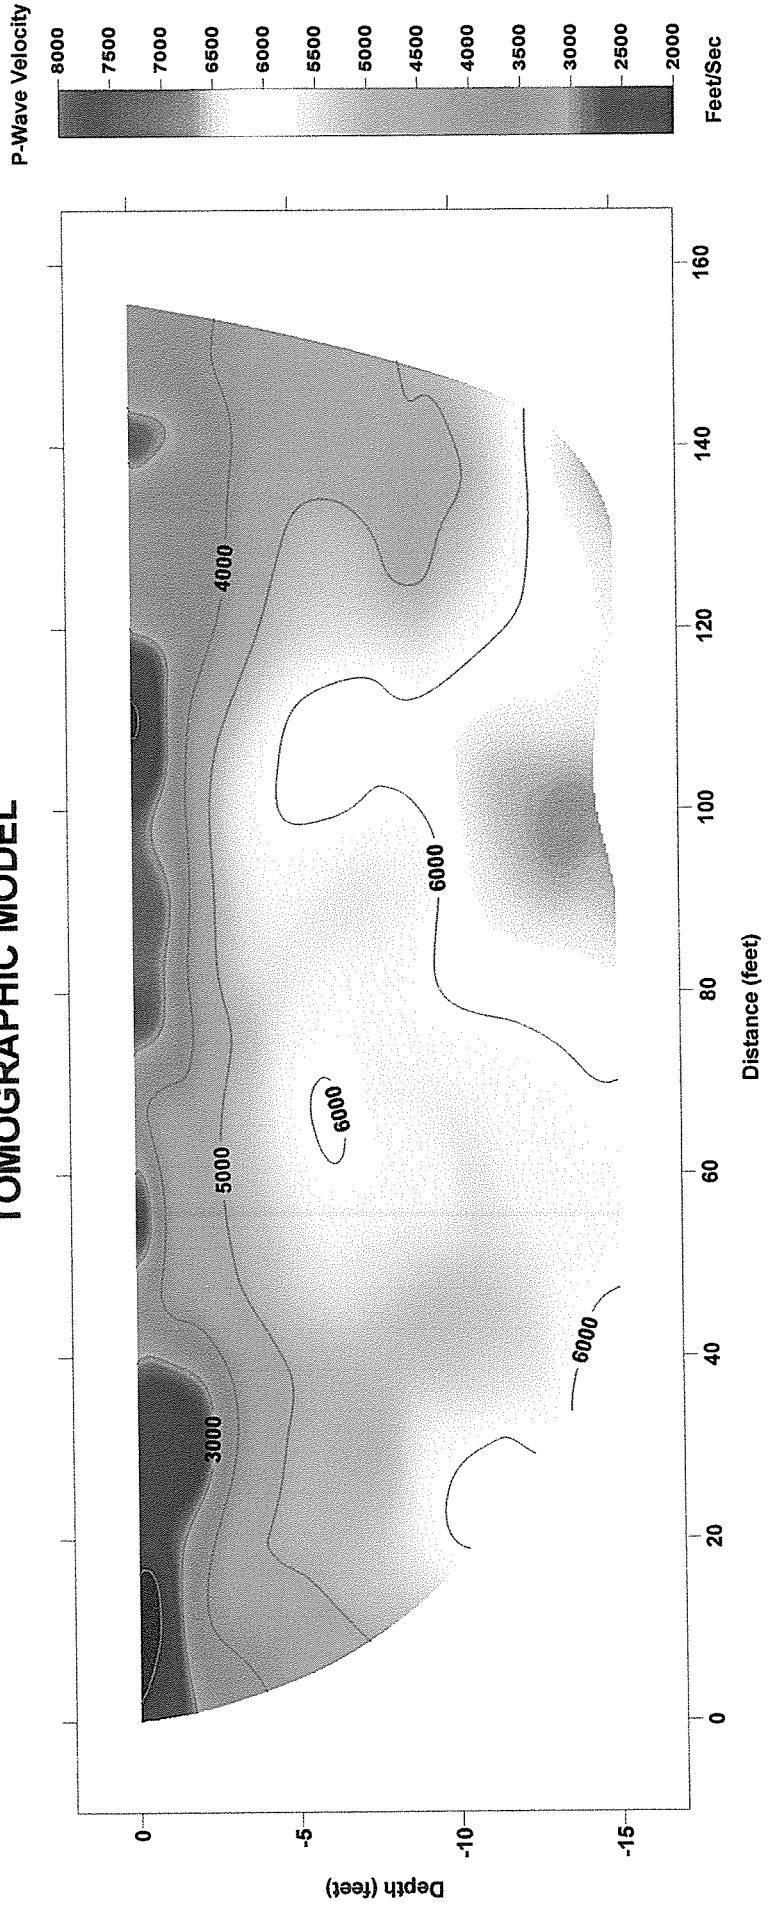

# SEISMIC LINE S-7

← North - South →

## TOMOGRAPHIC MODEL

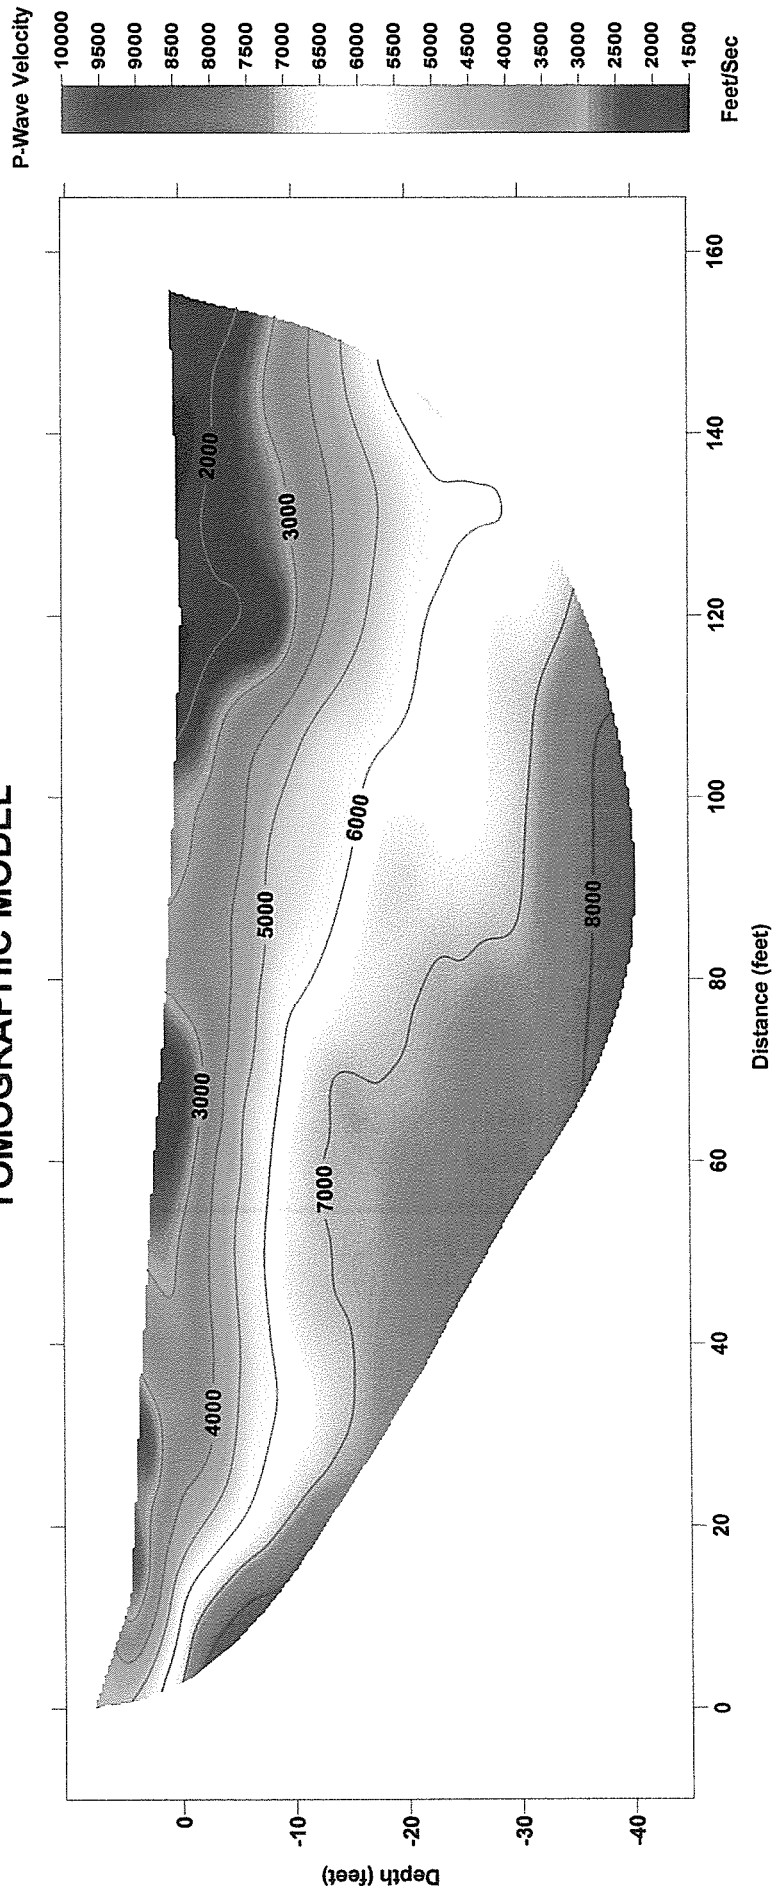




# SEISMIC LINE S-12

South 60 East →

## TOMOGRAPHIC MODEL

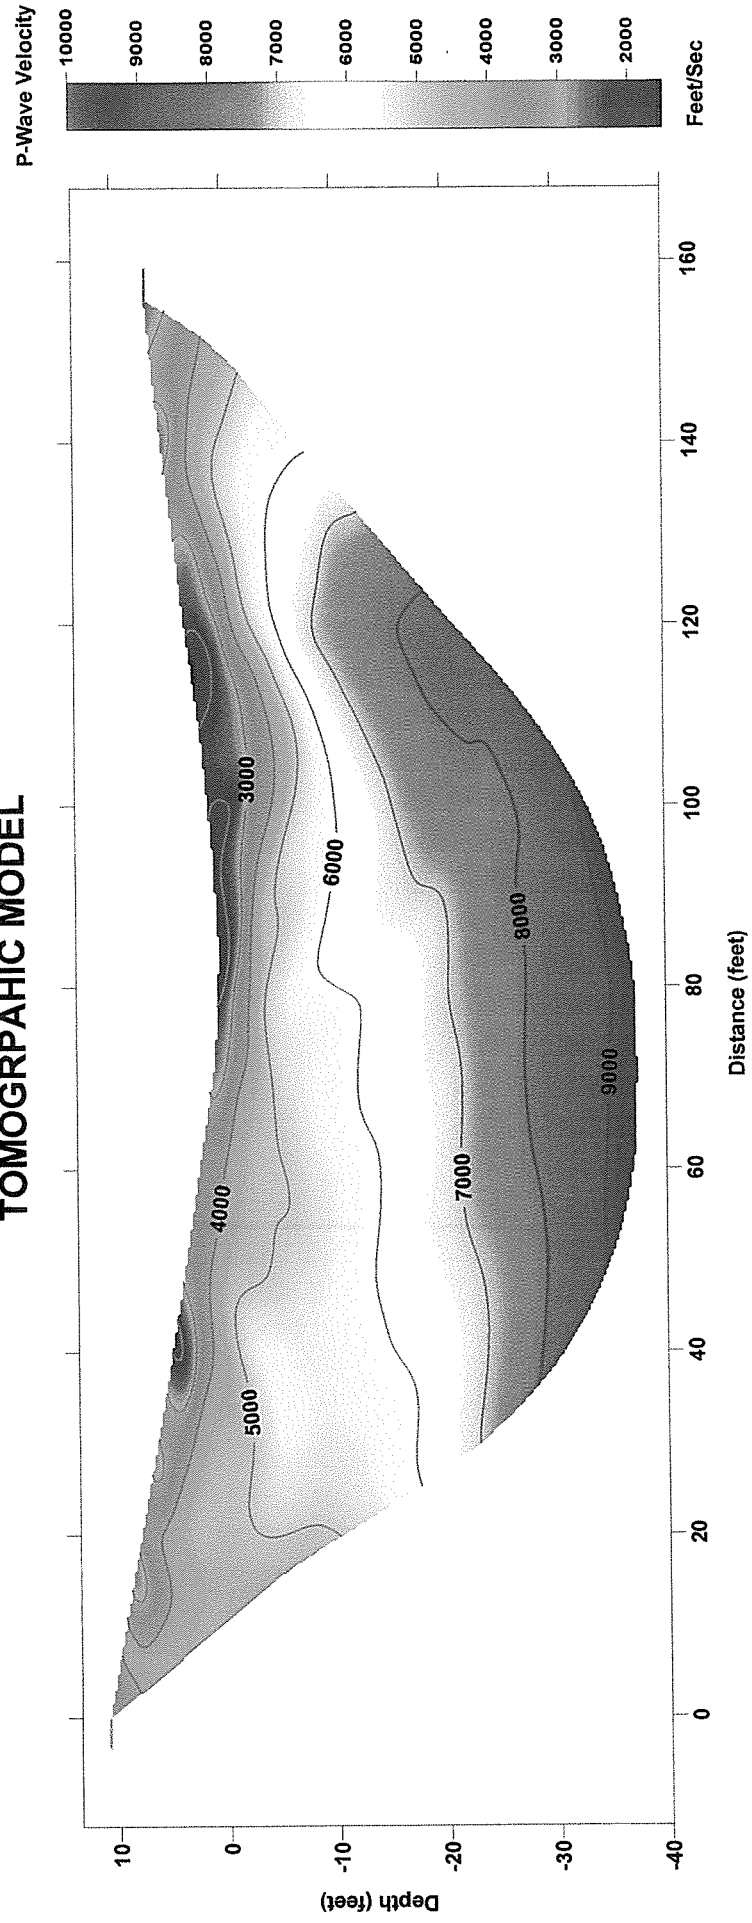


# **APPENDIX C**

---

---

## **EXCAVATION CONSIDERATIONS**

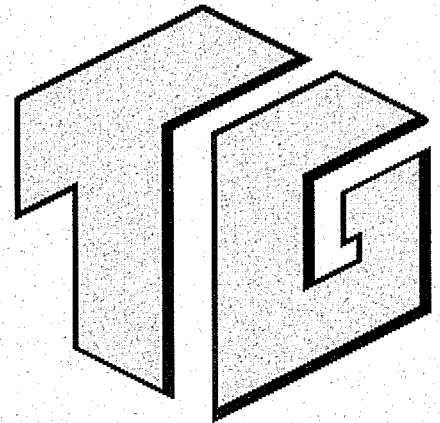

## EXCAVATION CONSIDERATIONS

These excavation considerations have been included to provide the client with a brief overall summary of the general complexity of hard bedrock excavation. It is considered the clients responsibility to insure that the grading contractor they select is both properly licensed and qualified, with experience in hard-bedrock ripping processes. To evaluate whether a particular bedrock material can be ripped, this geophysical survey should be used in conjunction with the geologic or geotechnical report prepared for the project which describes the physical properties of the bedrock. The physical characteristics of bedrock materials that favor ripping generally include the presence of fractures, faults and other structural discontinuities, weathering effects, brittleness or crystalline structure, stratification of lamination, large grain size, moisture permeated clay, and low compressive strength. Unfavorable conditions can include such characteristics as massive and homogeneous formations, non-crystalline structure, absence of planes of weakness, fine-grained materials, and formations of clay origin where moisture makes the material plastic.

When assessing the potential rippability of the underlying bedrock of a given site, the above geologic characteristics along with the estimated seismic velocities can then be used to evaluate what type of equipment may be appropriate for the proposed grading. When selecting the proper ripping equipment there are three primary factors to consider, which are:

- ◆ **Down Pressure available at the tip, which determines the ripper penetration that can be attained and maintained,**
- ◆ **Tractor flywheel horsepower, which determines whether the tractor can advance the tip, and,**
- ◆ **Tractor gross-weight, which determines whether the tractor will have sufficient traction to use the horsepower.**

In addition to selecting the appropriate tractor, selection of the proper ripper design is also important. There are basically three designs, being radial, parallelogram, and adjustable parallelogram, of which the contractor should be aware of when selecting the appropriate design to be used for the project. The penetration depth will depend upon the down-pressure and penetration angle, as well as the length of the shank tips (short, intermediate, and long).

Also important in the excavation process is the ripping technique used as well as the skill of the individual tractor operator. These techniques include the use of one or more ripping teeth, up- and down-hill ripping, and the direction of ripping with respect to the geologic structure of the bedrock locally. The use of two tractors (one to push the first tractor-ripper) can extend the range of materials that can be ripped. The second tractor can also be used to supply additional down-pressure on the ripper. Consideration of light blasting can also facilitate the ripper penetration and reduce the cost of moving highly consolidated rock formations.


All of the combined factors above should be considered by both the client and the grading contractor, to insure that the proper selection of equipment and ripping techniques are used for the proposed grading.

# APPENDIX D

---

---

## REFERENCES

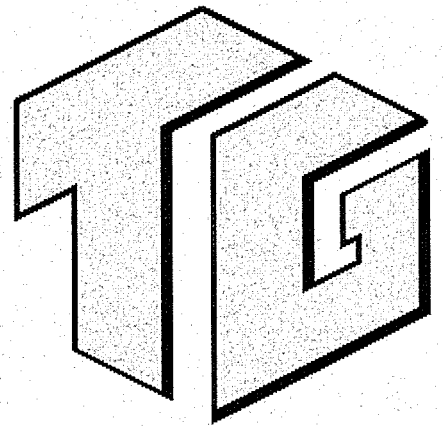

## REFERENCES

**American Society for Testing and Materials, Intl. (ASTM)**, 2000, Standard Guide for Using the Seismic Refraction Method for Subsurface Investigation, Designation D 5777-00, 13 pp.

**California State Board for Geologists and Geophysicists, Department of Consumer Affairs**, 1998, Guidelines for Geophysical Reports for Environmental and Engineering Geology, 5 pp.

**Caterpillar, Inc.**, 2000, Handbook of Ripping, Twelfth Edition, Caterpillar, Inc., Peoria, Illinois, 31 pp.

**Caterpillar, Inc.**, 2004, Caterpillar Performance Handbook, 35th Edition, Caterpillar, Inc., Peoria, Illinois.

**Geometrics, Inc.**, 2001, StrataVisor™ NX Operation Manual, San Jose, California, 195 pp.

**Intelligent Resources, Inc.**, 1996-2007, Rayfract™ Seismic Refraction Tomography Software, Version 2.73, <http://rayfract.com/>.

**Milson, John**, 1989, Field Geophysics, Geological Society of London Handbook, 182 pp.

**Morton, D. M. and Cox, B.F.**, 2001, Geologic Map of the Riverside East 7.5-Minute Quadrangle, Riverside County, California, U.S.G.S. Open-File Report 01-452, Scale 1:24,000.

**Redpath, Bruce B.**, 1973, Seismic Refraction Explorations for Engineering Site Investigation, Technical Report E-73-4, U.S. Army Waterways Experiment Station, Explosive Excavation Research Laboratory.

**Rimrock Geophysics, Inc.**, 1995, User Manuals for Computer Programs SIP Shell, SIPIK, SIPIN, SIPEDIT, and SIPT2.

**Scott, James H.**, 1973, Seismic Refraction Modeling by Computer, in *Geophysics*, Volume 38, No. 2, pp. 271-284.

**Sharma, Prem V.**, 1997, Environmental and Engineering Geophysics, Cambridge University Press, United Kingdom, 475 pp.